


[Home](#) > [ar.cn.de.en.es.fr.id.it.ph.po.ru.sw](#)

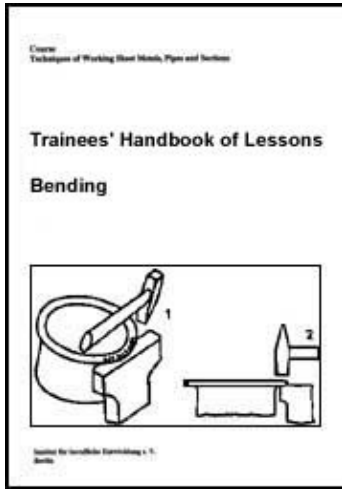


➔ **Bending - Course:Technique of working sheet metals, pipes and sections. Trainees' handbook of lessons (Institut fr Berufliche Entwicklung, 33 p.)**

- 📄 **(introduction...)**
- 📄 **Preliminary Remarks**
- 📄 **1. Purpose of Bending**
- 📄 **2. Selected Tools, Appliances and Machines**
- 📄 **3. Processes within in the Material**
- 📄 **4. Fundamentals of Calculation**
- 📄 **5. Bending Techniques**



[Home](#) > [ar.cn.de.en.es.fr.id.it.ph.po.ru.sw](#)

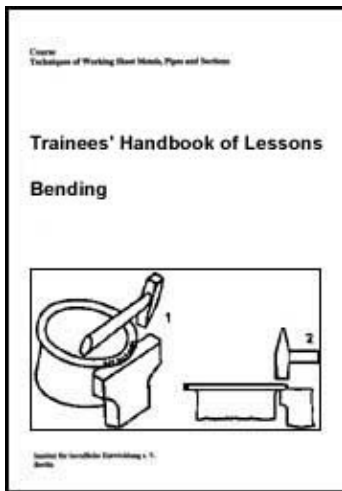

📖 **Bending - Course:Technique of working sheet metals, pipes and sections. Trainees' handbook of lessons (Institut fr Berufliche Entwicklung, 33 p.)**

- ➔ 📄 **(introduction...)**
- 📄 **Preliminary Remarks**
- 📄 **1. Purpose of Bending**
- 📄 **2. Selected Tools, Appliances and Machines**
- 📄 **3. Processes within in the Material**
- 📄 **4. Fundamentals of Calculation**
- 📄 **5. Bending Techniques**

**Institut fr berufliche Entwicklung e.V.
Berlin**

**Original title:
Arbeitsmaterial fr den Lernenden
"Biegen"**

Author: B. Zierenberg


First edition © IBE

**Institut fr berufliche Entwicklung e.V.
Parkstrae 23
13187 Berlin**

Order No.: 90-35-3114/2



[Home](#) > [ar.cn.de.en.es.fr.id.it.ph.po.ru.sw](#)

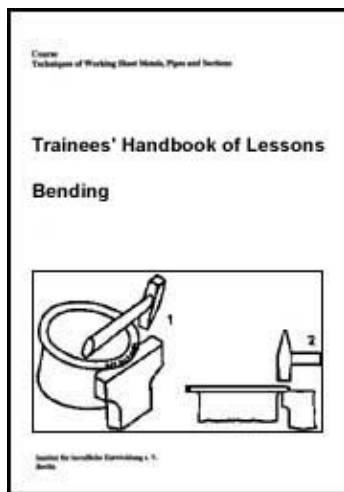

 **Bending - Course:Technique of working sheet metals, pipes and sections. Trainees' handbook of lessons (Institut fr Berufliche Entwicklung, 33 p.)**

 **(introduction...)**

  **Preliminary Remarks**

 **1. Purpose of Bending**

 **2. Selected Tools, Appliances and Machines**

 **3. Processes within in the Material**

 **4. Fundamentals of Calculation**

 **5. Bending Techniques****Preliminary Remarks**

This material is intended for vocational training in jobs where basic skills and abilities in the processing of sheet metals, pipes and sections, are required.

The handbook describes the execution of various bending techniques with tools, appliances and machines. The necessary calculations are explained with the help of examples.

Hints on Labour Safety

In general, the same labour safety rules apply to the bending techniques as to the manual techniques of hammering and straightening.

Especially the following focal points have to be attended to:


- Only use proper hammers - hammer shaft must be tightly wedged with the hammer head.**
- Select the correct striking base with regard to the form of bending - a hard and inflexible surface is required.**
- Workpieces to be clamped have to be tightly fixed in the clamping fixture so that they are not torn away by the striking impact**
- Always strike against the fixed vise jaw so that the vise screw will not be damaged.**
- Mind your hands and head when working on presses.**
- Work with welding torches must not be performed until the instructor has given the**

necessary instructions.

- **Always observe fire protection - place ready water for fire fighting, do not work in close vicinity to inflammable materials.**
- **Only bend sheet metals and sections of over 8 to 10 mm thickness and pipes of more than 1/2" in a heated state.**
- **Only use dry sand as filler for hot bending of pipes to avoid steam formation.**



[Home](#) > [ar.cn.de.en.es.fr.id.it.ph.po.ru.sw](#)

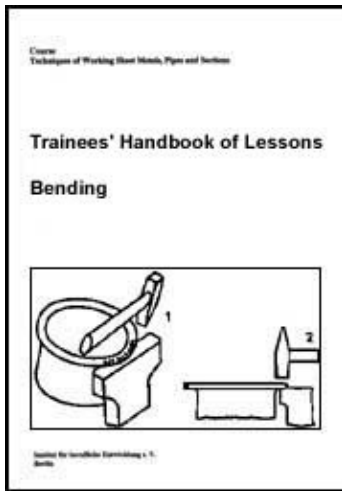

 **Bending - Course:Technique of working sheet metals, pipes and sections. Trainees' handbook of lessons (Institut fr Berufliche Entwicklung, 33 p.)**

 **(introduction...)**

 **Preliminary Remarks**

 **➔ 1. Purpose of Bending**

 **2. Selected Tools, Appliances and Machines**

 **3. Processes within in the Material**

 **4. Fundamentals of Calculation**

 **5. Bending Techniques**

1. Purpose of Bending

Sheet metals, pipes or sections are remodelled by various techniques in order to give angular or round forms to workpieces to be used for a certain purpose.

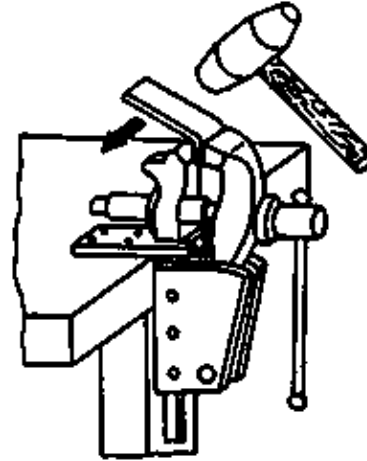


Figure 1 Bending

Due to its versatility, bending is applied in many manufacturing fields:


- Folding: Fabricating short sections, channels, sheet-metal containers or cases as well as frames and supporting structures made of sections.
- Turning over: Fabricating edge stiffenings of containers or cases, preparing saddle joints.
- Flanging: Fabricating sheet-metal joints and edge deformations on containers, preparing saddle joints.
- Seaming: Fabricating sheet-metal joints on containers and pipes.
- Crimping: Fabricating sheet-metal stiffenings on containers and sheet linings.
- Rounding: Fabricating arched sheet metals for containers and pipes as well as curved sections.
- Rolling: Fabricating sheet-metal stiffenings on container rims, hinge joints, cylindrical cavities with flat sections for accommodating pins and spiral springs.

What is the purpose of bending?

Which techniques are applied to bending sheet metals?



[Home](#) > [ar.cn.de.en.es.fr.id.it.ph.po.ru.sw](#)

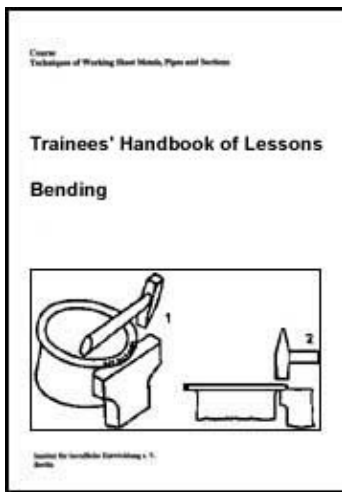

 **Bending - Course:Technique of working sheet metals, pipes and sections. Trainees' handbook of lessons (Institut fr Berufliche Entwicklung, 33 p.)**

 **(introduction...)**

 **Preliminary Remarks**

 **1. Purpose of Bending**

 **➔ 2. Selected Tools, Appliances and Machines**

 **3. Processes within in the Material**

 **4. Fundamentals of Calculation**

 **5. Bending Techniques**

2. Selected Tools, Appliances and Machines

Thin cross-sections of sheets, pipes and sections without requiring an exact accuracy to size may be bent by hand with appropriate clamping fixtures.

As for larger and thicker materials, the following tools, appliances and machines are employed:

Hammers:

Such as machinist's hammers, light-metal, wooden and rubber hammers as well as special hammers for manually bending sheet metals.

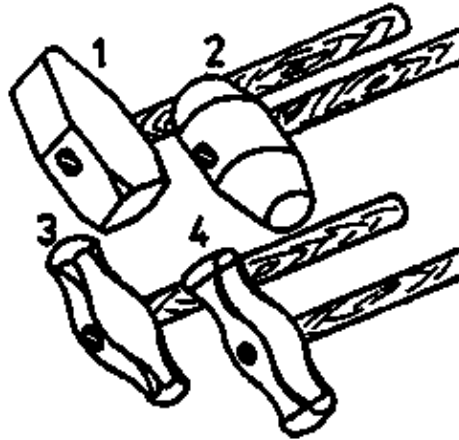


Figure 2 Hammers *1 machinist's hammer, 2 light metal hammer, 3 embossing hammer, 4 sweep hammer*

Pliers:

Such as round-nose and flat-nose pliers to bend small sheets and thin sections on the vise or freely in one's hand.

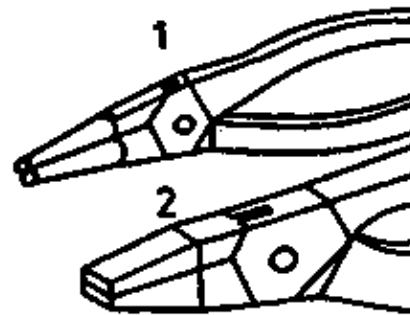


Figure 3 Pliers *1 round nose plier, 2 flat nose plier*

Welding torch:

Such as fuel gas-oxygen welding torches to locally heat the workpiece for hot bending.



Figure 4 Welding torch

Angle bending device:

This device is used to fold or round flat, square and round section.

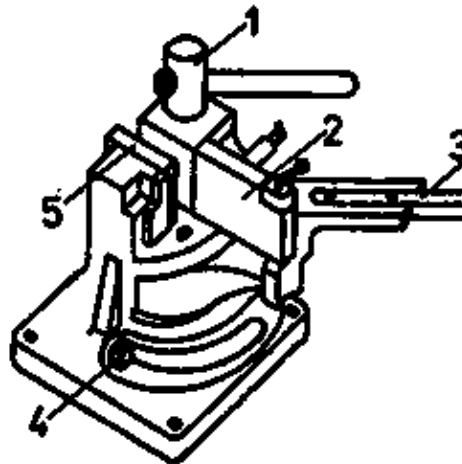


Figure 5 Angle bending device *1 eccentric chuck, 2 moveable bending jaw, 3 bending lever, 4 adjustable dog, 5 fixed bending jaw*

Strip rolling device:

This device is used to round and roll flats, squares and rounds.

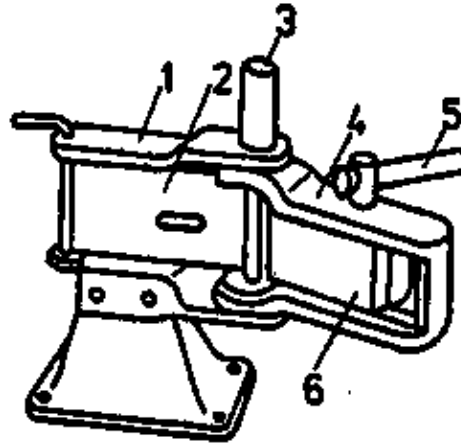


Figure 6 Strip rolling device 1 basic body, 2 adjustable sliding plate, 3 bending mandrel, 4 accommodation for moveable clamping segment, 5 bending lever, 6 clamping segment

Pipe bending device:

These manually operated or hydraulic devices are used to round pipes.

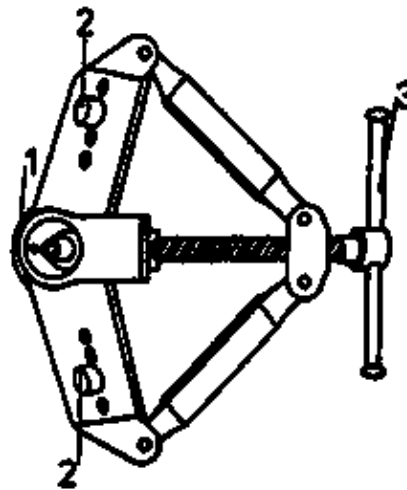


Figure 7 Pipe bending device 1 bending mandrel, 2 dogs, 3 bending screw

Screw press:

Such as hand-type screw or hydraulic presses with different screw insets and supports to bend sheet metals and sections.

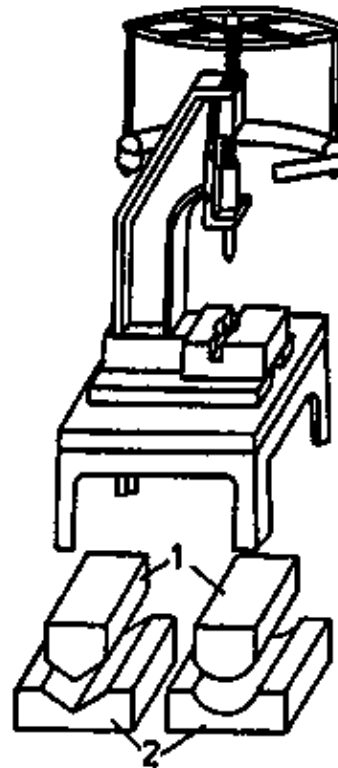


Figure 8 Screw press *1 screw inserts, 2 bases*

Folding press:

Such as table-type and column-type folding presses to fold and partially round sheet metals.

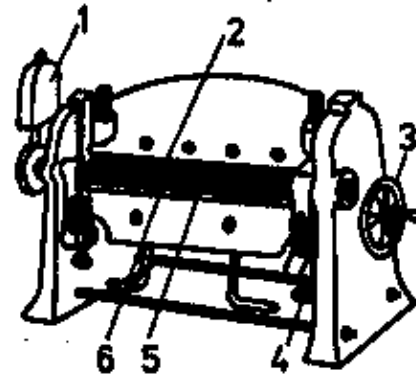


Figure 9 Folding press 1 weight, 2 clamping cheek, 3 crank to adjust top clamping cheek, 4 bolts to adjust bending cheek, 5 bending cheek, 6 bottom clamping cheek

Rounding device:

Such as hand-operated and mechanical roll bending machines to round and roll sheet metals.

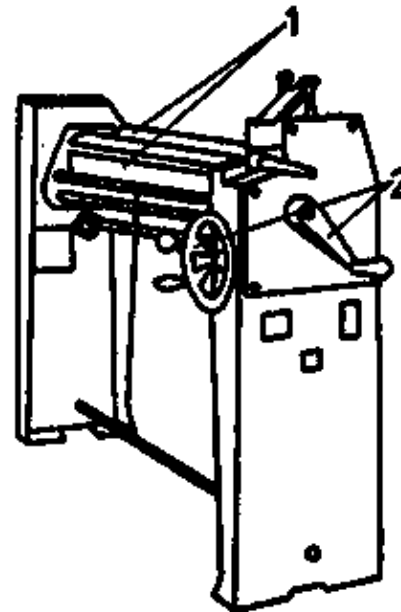


Figure 10 Round device 1 bending rolls, 2 crank to operate bending rolls

Crimping and flanging machines:

Manually operated and mechanical appliances and machines are used to crimp and flange sheet metals.

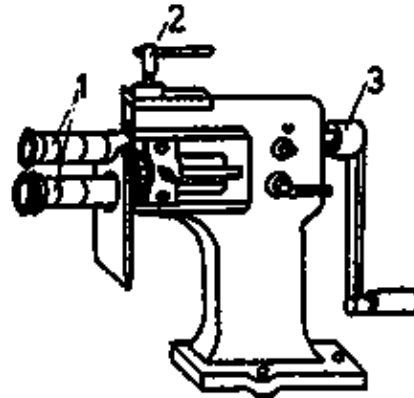


Figure 11 Crimping and flanging *1 bending rolls, 2 adjusting facility, 3 crank to operate bending rolls*

Apart from above tools, appliances and machines, the following clamping fixtures and supports are needed:

Vise:

Such as parallel vises and collet vises with different clamping jaws for manual bending.

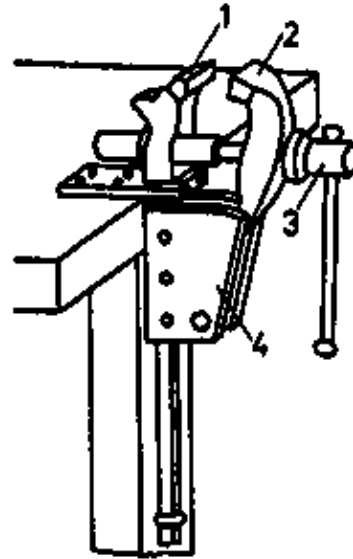


Figure 12 Collet vise 1 fixed jaw, 2 moveable jaw, 3 screw, 4 collet

Blacksmith's anvil:

Face, round horn and flat horn as well as slip-on striking supports such as creasing stake and double face sledge, hardy and bordering tools for bending work with hammers are used.


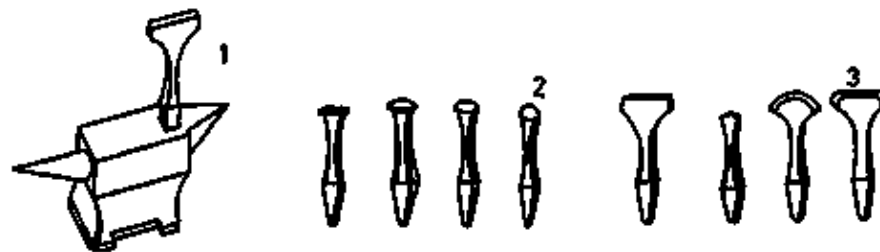


Figure 13 Blacksmith's anvil 1 anvil with slip-on striking base, 2 double face sledge, 3 flanging and hardy iron



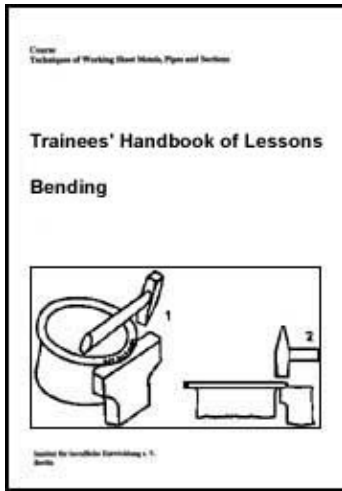

 **Bending - Course:Technique of working sheet metals, pipes and sections. Trainees' handbook of lessons (Institut für Berufliche Entwicklung, 33 p.)**

 **(introduction...)**

 **Preliminary Remarks**

 **1. Purpose of Bending**

 **2. Selected Tools, Appliances and Machines**

 **→ 3. Processes within in the Material**

 **4. Fundamentals of Calculation**

 **5. Bending Techniques**

3. Processes within in the Material

Acting bending forces cause stresses in the material affecting a remodelling of the workpiece.

Tensile stresses occur at external radii of bendings due to stretching the material, while compressive stresses occur at internal radii of bendings due to upsetting the material.

Between those areas where tensile and compressive stresses act, there is a transition zone where no stresses act It is denominated as neutral axis or neutral layer.

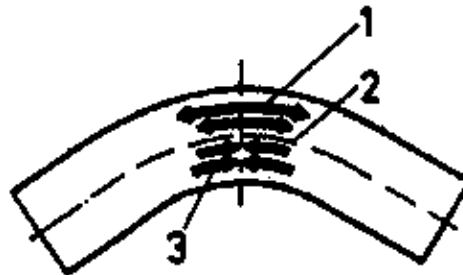


Figure 14 Stresses in the bent workpiece **1 tensile stresses, 2 neutral axis, 3 compressive stresses**

The neutral axis length is needed to calculate the stretched length of the workpiece to be bent

What does the term "neutral axis" mean?

3.1. Influence of Material Properties

Plasticity:

Only can such materials be bent that allow a change of shape. Hardened and brittle materials cannot be bent - they break when strong bending forces act

Spring-tempered materials cannot be bent either - they completely spring back to their initial position after bending forces have acted.

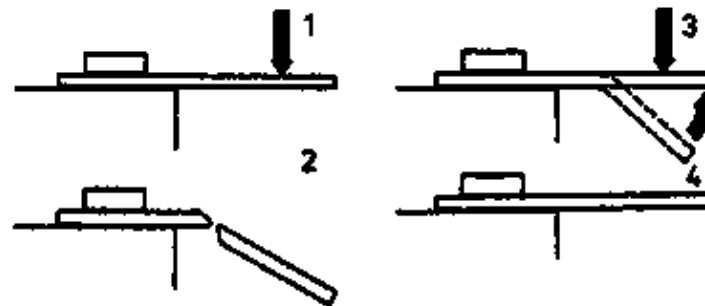


Figure 15 Bending property of various materials **1 bending force acts on brittle material, 2 workpiece fracture, 3 bending force acts on spring-tempered workpiece, 4 workpiece spring-back**

Elasticity:

Elastic materials spring back after application of force by a certain measure - what is called spring-back. This measure must always be taken into consideration when bending.

Hard metals spring more back than soft ones.

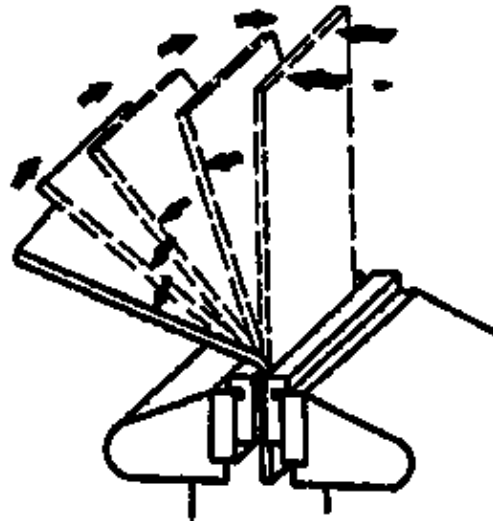


Figure 16 Workpiece spring-back after each force reaction

Strength:

When sheet metals are rolled, a fibre structure comes into being (similar to streaks in wood) which can be seen on the surface of clean sheet metals. To avoid streaks at the external edge of bendings, the bending edge must not be in accord with the streak flow.



Figure 17 Rolling direction to be considered during bending *1 rolling direction*

Strain-hardening:

When tensile and compressive stresses change for several times during the bending process (to-and-from bending), the material structure is more and more deformed. The increasing internal stresses lead to a hardening at the bending point. The more often the change of stresses takes place, the more brittle the material becomes. If deformation continues, it may result in a fracture.

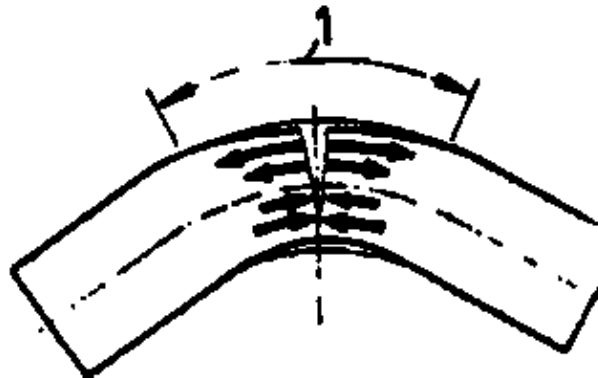


Figure 18 Crack formation at strain-hardened bending points *1 zone of strain-hardening*

Which material properties are not allowed for a piece to be bent?

What does the term "spring-back" mean?

What will happen when a sheet metal is bent around a bending edge being in accordance with streak flow of the rolling direction?

What does the term "strain-hardening" mean?

3.2. Influence of the Bending Radius

To avoid cracks due to bending, the bending radius has to be selected by a size sufficiently large.

The bigger the bending radius, the smaller the risk of cracks.

The thicker the material is, the bigger the bending radius must be.

The bending radius depends on both the shape and thickness of the workpiece as well as the temperature during bending and the kind of material.

Hence, there are fixed minimum radii for all metals and many section forms.

The following minimum bending radii can be applied to as empirical values:

Material	Radius
-----------------	---------------

Material	Radius
Copper	0.8 up to 1.2 × thickness
Brass	1 up to 1.8 × thickness
Zinc	1 up to 2 × thickness
Steel	1 up to 3 × thickness

Which influence has the bending radius on the formation of cracks in the workpiece?

Which influence has the workpiece thickness on the bending radius?

3.3. Heat Influence

The more the workpiece is being remodelled, the bigger are the stresses inside the material. Particularly, in bending thicker workpieces with small bending radius, there is such a strong stress on the material that it may crack at the bends' external side.

To avoid this formation of cracks, such workpieces must be heated red-hot. The resistance inside the material decreases with growing heat so that remodelling can be effected without great expenditure of force and without the risk of crack formation.

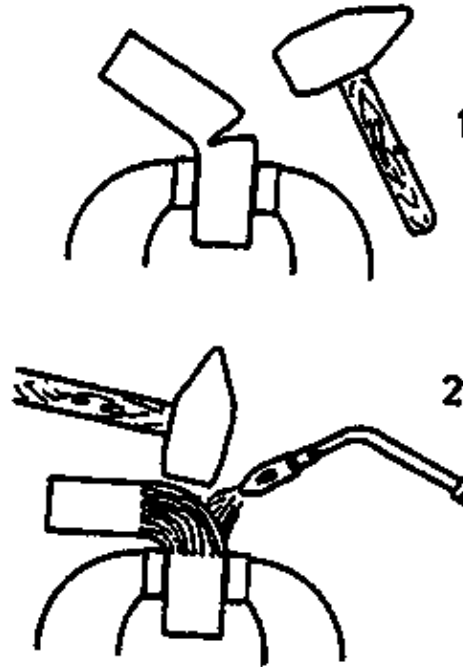


Figure 19 Bending of thick workpieces 1 cold bending leads to crack formation, 2 hot bending makes exact bending procedure possible


Which influence has the supply of heat on the bending process with thick workpieces?



[Home](#) > [ar.cn.de.en.es.fr.id.it.ph.po.ru.sw](#)

 **Bending - Course:Technique of working sheet metals, pipes and sections. Trainees' handbook of lessons (Institut fr Berufliche Entwicklung, 33 p.)**

 **(introduction...)**

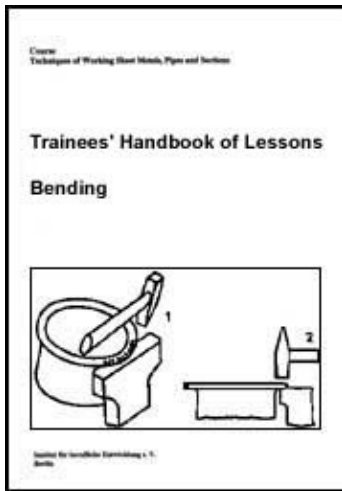

- 📄 **Preliminary Remarks**
- 📄 **1. Purpose of Bending**
- 📄 **2. Selected Tools, Appliances and Machines**
- 📄 **3. Processes within in the Material**
- ➔ 📄 **4. Fundamentals of Calculation**
- 📄 **5. Bending Techniques**

4. Fundamentals of Calculation

When a workpiece is being bent, its original length may alter by a certain measure.

Therefore, the workpiece has to be cut to size very exactly before being bent The required blank length is called "stretched length" and is to be calculated from the length of the neutral axis.

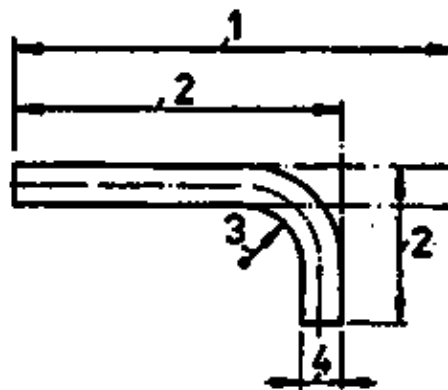


Figure 20 Dimensions on parts to be bent 1 stretched length, 2 leg lengths, 3 bending radius, 4 workpiece thickness

If the bending radius is bigger than five times the workpiece thickness, the neutral axis runs in the middle of the workpiece. Hence, the neutral axis bending radius is to be calculated with the following formula:

With $R_B > 5 \cdot S$ R_N = radius of neutral axis

therefore is $R_N = R_B + \frac{S}{2}$ R_B = bending radius

S = workpiece thickness

If the bending radius is smaller than five times the workpiece thickness, the neutral axis is displaced to the bending internal side during the bending process.

Then the bending radius of the neutral axis can be calculated with the following formula:

With $R_B < 5 \cdot S$

therefore is $R_N = R_B + \frac{S}{3}$

If workpieces are bent by 360°, the length of bend is calculated with the formula for calculating the circumference:

$L_B = U = D \cdot \pi$

or $L_B = U = 2 \cdot R_N \cdot \pi$

L_B = length of bend

U = length of circumference

D = circle diameter

π = constant with the value of 3.14

Hence, the following formula is used for a 180° bending:

$$L_B = \frac{D}{2} \cdot \pi$$

or $L_B = R_N \cdot \pi$

Hence, the following formula is used for a 90° bending:

$$L_B = \frac{D}{4} \cdot \pi$$

or $L_B = \frac{R_N}{2} \cdot \pi$

For any optional bending, the formula of the bending angle is to be considered:

$$L_B = R_N \cdot \pi \cdot \frac{\alpha}{180^\circ}$$

$\alpha = \text{bending angle}$

What does the term "stretched length" mean?

How does the position of the neutral axis change when a workpiece is bent around a bending radius smaller than five times the workpiece thickness?

Calculation example:

A flat section is to be bent for several times. Its dimensions are to be seen from the following illustration.

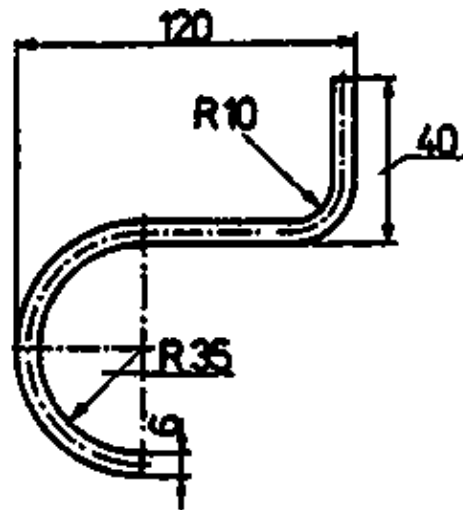


Figure 21 Example for dimensioning a part to be bent

For calculation, the total length is subdivided into 4 partial lengths:

Total length - sum of all partial lengths

$$L = L1 + L2 + L3 + L4$$

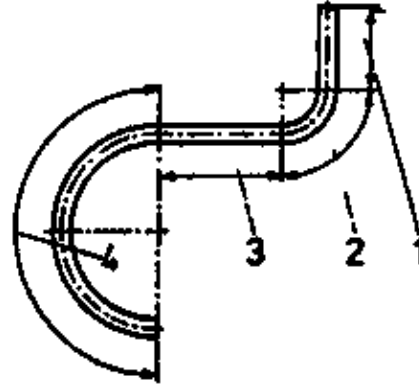


Figure 22 Subdividing the piece to be bent into partial lengths 1 partial length L_1 , 2 partial length L_2 , 3 partial length L_3 , 4 partial length L_4

The neutral axis of partial length L_1 is calculated as follows:

$$L_1 = 40 \text{ mm} - S - R_{B1}$$

$$L_1 = 40 \text{ mm} - 6 \text{ mm} - 10 \text{ mm}$$

$$L_1 = \underline{24 \text{ mm}}$$

The neutral axis of partial length L_2 is calculated with the formula derived from that to calculate the circumference for a 90° bending:

$$L_2 = \frac{D}{4} \cdot \pi = \frac{R_{N1}}{2} \cdot \pi$$

Since the bending radius R_{B1} is smaller than five times the section thickness, therefore R_{N1} is:

$$R_{N1} = R_{B1} + \frac{S}{3}$$

$$R_{N1} = 10 \text{ mm} + 2 \text{ mm}$$

$$R_{N1} = \underline{12 \text{ mm}}$$

This means for partial length L_2 :

$$L_2 = \frac{R_{N1}}{2} \cdot \pi$$

$$L_2 = \frac{12}{2} \cdot 3.14$$

$$L_2 = \underline{18.84 \text{ mm}}$$

The neutral axis of partial length L_3 is to be calculated as follows:

$$L_3 = 120 \text{ mm} - 2 \cdot S - R_{B1} - R_{B2}$$

$$L_3 = 120 \text{ mm} - 12 \text{ mm} - 10 \text{ mm} - 35 \text{ mm}$$

$$L_3 = \underline{63 \text{ mm}}$$

The neutral axis of partial length L_4 is calculated with the formula derived from that to calculate the circumference for a 180° bending:

$$L_4 = R_{N2} \cdot \pi$$

Since the bending radius R_{B2} is bigger than five times the section thickness, therefore R_{N2} is:

$$R_{N2} = R_{B2} + \frac{S}{2}$$

$$R_{N2} = 35 \text{ mm} + 3 \text{ mm}$$

$$R_{N2} = \underline{38 \text{ mm}}$$

Now, the neutral axis of partial length L4 can be calculated as follows:

$$L_4 = R_{N2} \cdot \pi$$

$$L_4 = 38 \text{ mm} \cdot 3.14$$

$$L_4 = \underline{119.32 \text{ mm}}$$

With the help of the partial lengths so calculated, the total stretched length of the flat section can be calculated now:

$$L = L_1 + L_2 + L_3 + L_4$$

$$L = 24 \text{ mm} + 18.84 \text{ mm} + 63 \text{ mm} + 119.32 \text{ mm}$$


$$L = \underline{225.16 \text{ mm}}$$

The calculated value is always brought up to a round millimetre figure, thus the stretched length of the flat profile is 226 mm.

How is the stretched length of a workpiece calculated, if several different bends are to be made?



[Home](#) > [ar](#).[cn](#).[de](#).[en](#).[es](#).[fr](#).[id](#).[it](#).[ph](#).[po](#).[ru](#).[sw](#)

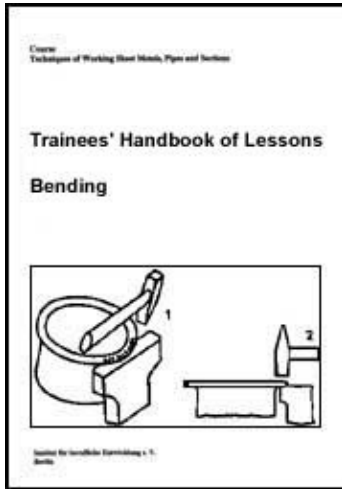

Bending - Course:Technique of working sheet metals, pipes and sections. Trainees' handbook of lessons (Institut für Berufliche Entwicklung, 33 p.)



(introduction...)



Preliminary Remarks



1. Purpose of Bending



2. Selected Tools, Appliances and Machines



3. Processes within in the Material



4. Fundamentals of Calculation



5. Bending Techniques

5. Bending Techniques

Depending on the form of bend and material thickness, manual and mechanical techniques of cold and hot bending can be applied.

5.1. Folding of Sheet Metals

If sheet metals with as small a bending radius as possible are bent, this process is called "folding". In this procedure, bending angles are fabricated up to 90° on a fixed bending edge.

The sheet has to be clamped in such a way that hammer strikes are directed against the fixed vise jaw during bending.

So, the vise screw is not stressed too strongly.

Always scribe the internal side of the bending with the steel scribe, since the crack (mark) is pressed together after bending and has no fracture effect any more.

The sheet metal is correctly clamped, when the scribed line is in accordance with the fixed vise jaw upper edge.

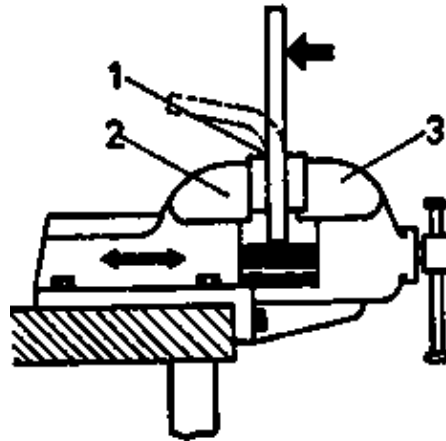


Figure 23 Bending procedure on a vise 1 scribed line, 2 moveable jaw, 3 fixed jaw

Thin, long sheet metals with short bending edges may be pie-bent by hand or with intermediate plates. Not until then do you strike with the hammer from the exterior towards the bending edge. To avoid the formation of cracks at the bending edge, you should not directly strike on the bending.



Figure 24 Bending of thin, long sheet metals 1 pre-bending by hand, 2 pre-bending with intermediate plates, 3 finish bending with a hammer

Wooden, rubber or light metal hammers are sufficient for most of the folding works. If, however, strong bending strikes are required, a machinist's hammer together with a

hardwood intermediate plate has to be used in order not to damage the workpiece surface.

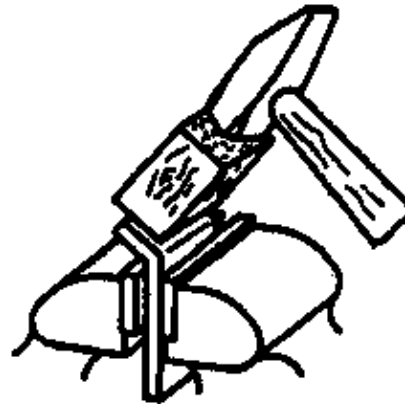


Figure 25 Bending of a thick sheet metal with hardwood intermediate plate and machinist's hammer

Thick sheets with short bending edges can be bent with the machinist's hammer in the vise. In case of hard and brittle sheets, however, a bending radius of at least 2½ times the sheet thickness is to be taken into consideration to prevent the sheet from breaking. This radius can be guaranteed by using appropriate intermediate plates.

Since sheet metals from 8 mm thickness onwards can only be bent with a great deal of manual energy, they are to be bent at a heated state.

If the sheet is to be bent several times, intermediate plates are to be used. The individual bending steps should be so stipulated that even the final bending step can be performed of in high quality.

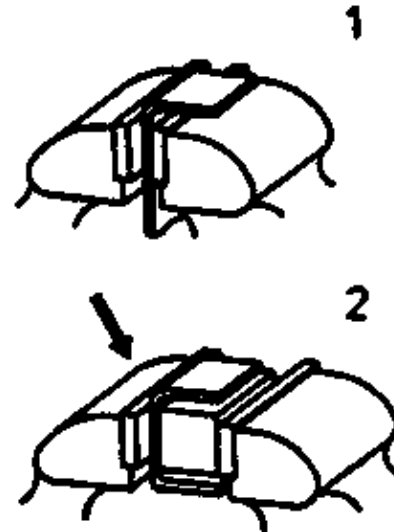


Figure 26 Gradual bending of a workpiece with two bending edges *1 bending of the 1st edge, 2 bending of the 2nd edge with intermediate plate*

Metal sheets with short bending edges may also be bent with the hand screw press. For that purpose, the sheet is to be put between punch and base. With the help of the screw the punch is run down and the sheet is pressed into a base corresponding to the shape.

To compensate spring-back, punch and base are so arranged that the sheet is slightly bent over during the process.

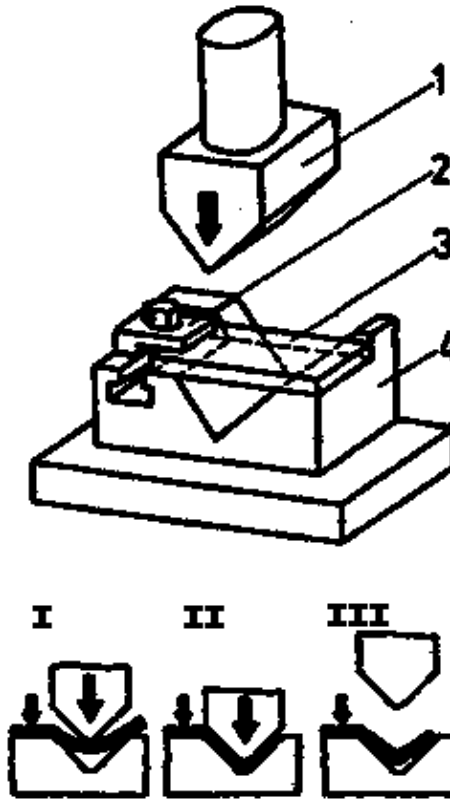


Figure 27 Bending of a sheet metal with the press 1 punch, 2 clamping fixture for the workpiece, 3 workpiece, 4 base I, II, III bending steps

Thin, soft sheets with long bending edges can be bent by hand with the help of a stable pressure plate. The bending edge should not be scribed with the steel scriber, but with a pencil to avoid formation of crack

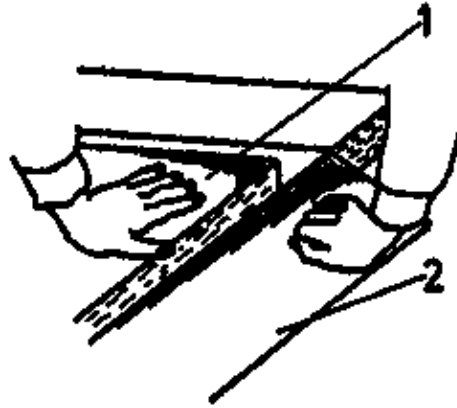


Figure 28 Bending of a soft sheet metal with a pressure plate *1 pressure plate, 2 sheet*

Thin, hard sheets can be bent manually with a hammer when they have long bending edges, by clamping them with additional clamping fixtures on the vise.

The sheet metal is either bent on an intermediate plate over the entire length or with hammer strikes directed from the vise towards the exterior. Finally, the bending edge can be smoothed with an intermediate plate by uniform hammer strikes.

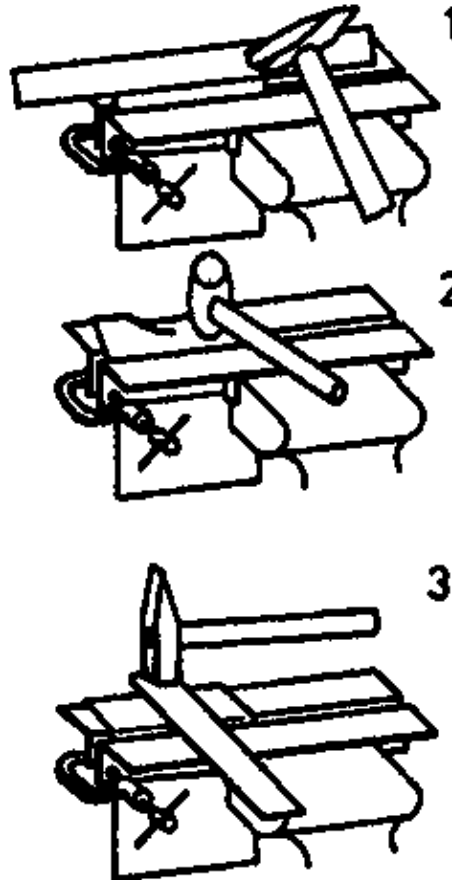


Figure 29 Bending of a hard sheet metal on the vise *1 bending with intermediate plate and hammer over the entire length, 2 continued bending with the hammer, 3 smoothing with intermediate plate and hammer*

Sheet metals with long bending edges can be bent on the folding press very well.

The sheet is put in the folding press in such a way that the scribed line can be seen from above.

The sheet is tightly clamped with the upper clamping cheek, while the bending cheek is so arranged that the sheet thickness is given special attention for bending. Subsequently, the

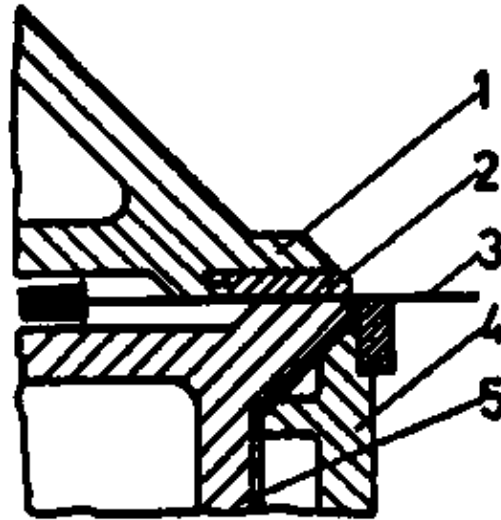
bending cheek is aimed over according to the angle to be bent

Figure 30 Bending of a long sheet metal in the folding press *1 top clamping cheek, 2 changeable bending rail, 3 sheet, 4 bending cheek, 5 bottom clamping cheek*

When sheets with several bending edges are bent, the respective intermediate plate must be used, with the sequence of bendings to be stipulated in advance so that the final bending edge can be made as to the requirement of good quality as well.

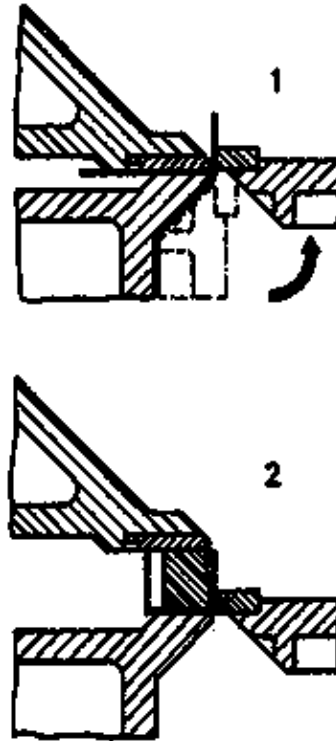


Figure 31 Bending of a sheet channel on the folding press *1 bending of the 1st edge, 2 bending of the 2nd edge with intermediate plate*

Sheets with long bending edges can also be bent with folding presses. The punch presses down on the sheet lying between punch and base and presses the sheet into the respective base recess. According to the desired bending radius, different bending punches are employed.

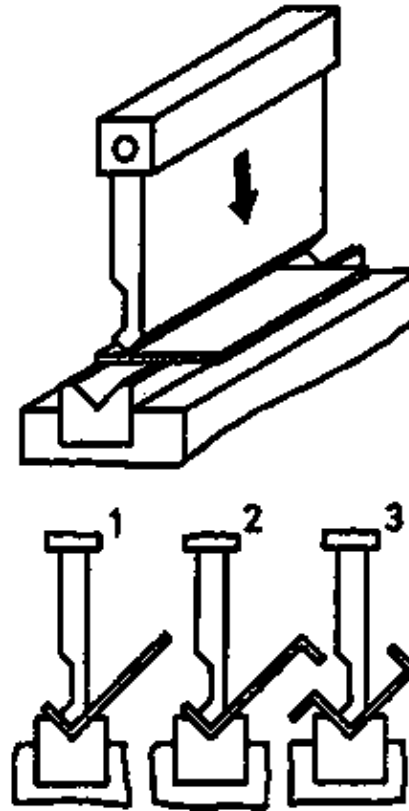


Figure 32 Bending of sheet metals with several bending edges on the folding machine *1, 2, 3* sequence of bending steps

Sections are folded by separating material off the upsetting zone, with the workpiece being bent on the vise subsequently. Depending on the bending angle, the dimensions of the workpiece zone to be cut out are so stipulated that there will not remain a gap between the surfaces after bending.

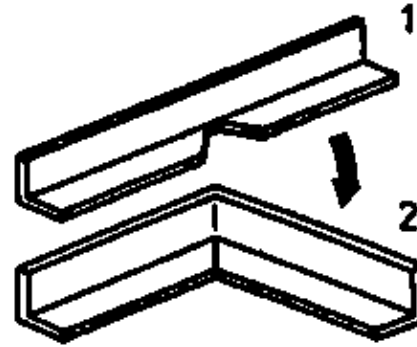


Figure 33 Bending of angular section 1 sawing out the upsetting zone, 2 bending

To which side is the hammer to be stroken, if a sheet metal is to be folded on the vise?

From which sheet thickness onwards should workpieces be hot bent?

What significance have hardwood or metal shims for bending on the vise?

How are sheet metals with long bending edges to be clamped in the vise?

What must be done before sections are folded?

5.2. Turning-up of Sheet Metals

If angles are to be bent over 90° up to 180° , this procedure is called "turning up", with the workpiece mostly being remodelled in several bending steps.

Sheets are turned up in bending them by the folding technique to an angle of 90° and subsequently bringing them up to 180° with hammers or presses.

The minimum turning-up length depends on the sheet thickness. As for small sheet thicknesses, the sheet rests closely on after being turned up, while in case of bigger sheet thicknesses, a small bead is formed at the place of turn-up.



Figure 34 Turning up 1 thin sheet, 2 thick sheet

How are sheet metals turned up?

5.3. Flanging of Sheet Metals

If sheet rims are bent horizontally or at an angle to the sheet level, this procedure is called as flanging". One distinguishes between external flange and internal flange, both being fabricated manually or mechanically.

Manual flanging is effected by the hammering technique, with the sheet rims being turned up with hammers on respective striking bases (bordering tool and hardy tool). Subsequently, the folds are upset with the machinist's hammer. These two procedures are denominated as "initial flanging" and "finish flanging".

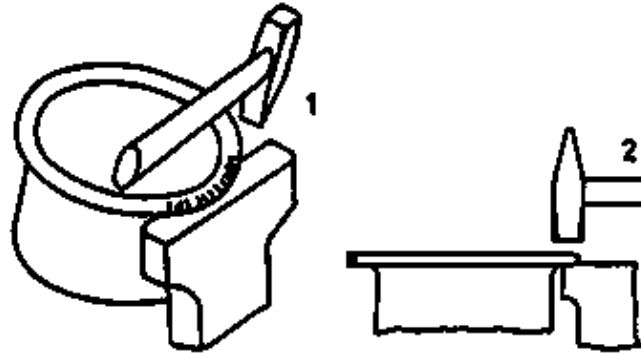


Figure 35 Manual flanging 1 initial flanging, 2 finish flanging

From the mechanical point of view, flanging is effected with crimping and flanging machines or with flanging devices. The sheet is turned up in several bending steps between a pair of rolls with external and internal roundings until there is the finished rim.

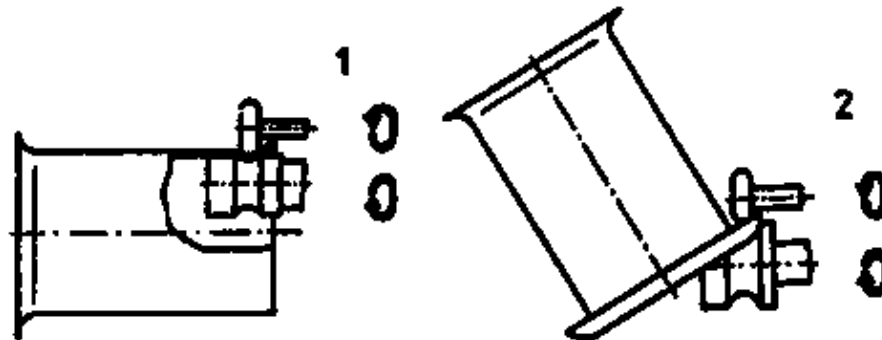


Figure 36 Mechanical flanging 1 initial flanging, 2 finish flanging

How is a sheet cylinder flanged manually?

5.4. Seaming of Sheet Metals

If sheet metals to be joint with each other are turned up or flanged, this procedure is called "seaming". According to the function of the scarf joint, there are different kinds) of seaming.

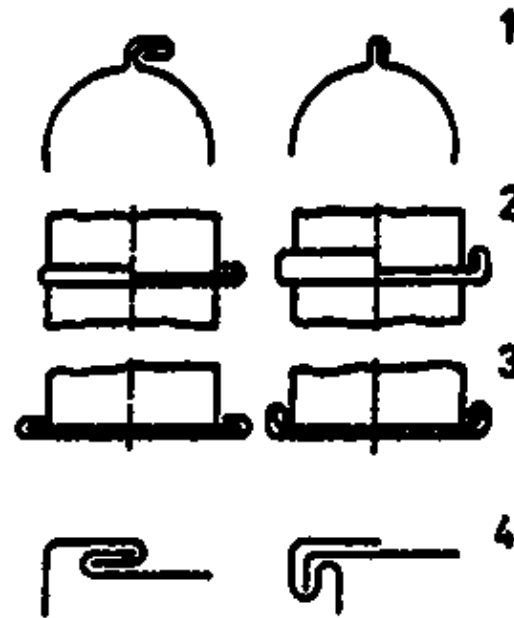


Figure 37 Selected kinds of seaming 1 *body seaming*, 2 *casing seaming*, 3 *bottom seaming*, 4 *corner seaming*

Seaming is effected in several working steps. After being folded, turned in or flanged, the sheets are joined by hooking in.

Subsequently, the scarf joint is pressed together and even upset, if need be. To fabricate tight scarf joints, packing rubber may be incorporated or the scarf joint is soldered subsequently.

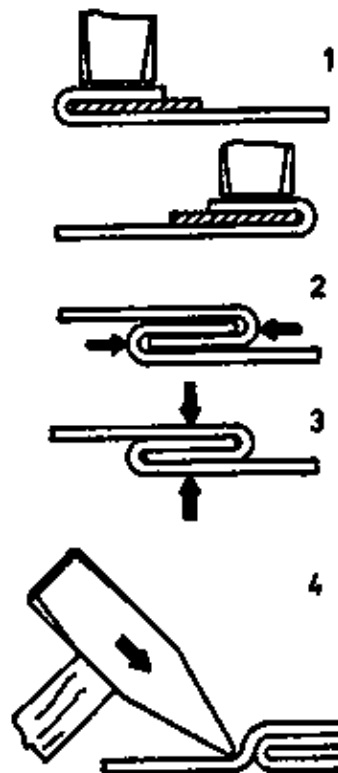


Figure 38 Fabricating a plane seam 1 turning-up with packing rubber, 2 hooking in, 3 pressing together, 4 upsetting

The following blank lengths are needed for scarf (seamed) joints:

- With single turn-up 3 times the seaming width
- With double turn-up 5 times the seaming width

Sheet thickness	Seaming width	Blank width	
		Single turn-up	Double turn-up
in mm	in mm	in mm	in mm
Sheet steel:			

0.3 to 0.5	5	16	28
0.5 to 0.7	6	19	34
0.8 to 1.2	8	26	45
Light metal sheets:			
to 0.5	6	16	34
0.6 to 0.7	8	26	45
0.8 to 1.4	10	33	56

Mechanically, scarf joints with longitudinal seams can be fabricated on folding presses and folding benches as well as on rolling devices. Round seams on containers and cases are prepared on crimping and flanging machines.

By which working steps is seaming marked?

5.5. Crimping of Sheet Metals

If curl-like recesses are made in plane or rounded sheets, which run from edge to edge or only inside the sheet metal, this procedure is called "crimping".

Manually, crimping is done with a swaging hammer by placing the sheet on the anvil creasing stake and striking it uniformly. So, the hammer strikes the sheet into the creasing stake recesses.

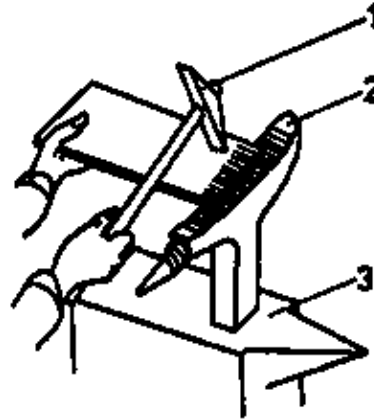


Figure 39 Manual crimping 1 swaging hammer, 2 creasing stake, 3 anvil

Mechanically, crimping is effected on crimping and flanging machines or crimping devices. The sheet metal is placed between the crimping rolls and formed by turning the rolls.

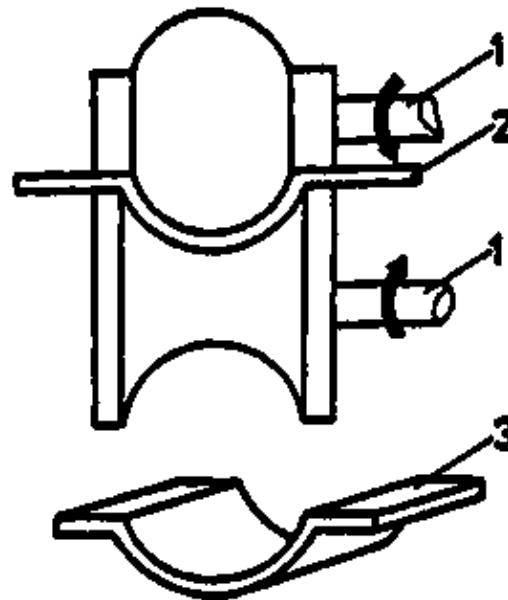


Figure 40 Mechanical crimping 1 seam rollers, 2 sheet, 3 finished piece

What does the "crimping" process mean?

5.6. Rounding of Sheet Metals

If sheet metals are bent with a bending radius bigger than the smallest possible one, this process is called "rounding" or "bending round". Here, the sheet metal is bent around a bending axis respectively far away from the workpiece surface. The bending angle may be up to 360°.

Short sheets can be bent round on the vise, if the bending die, depending on its kind, is clamped alone or jointly with the sheet. The radius of a bending die can be enlarged, when an intermediate plate is put on the bending die and the workpiece is bent over this plate.

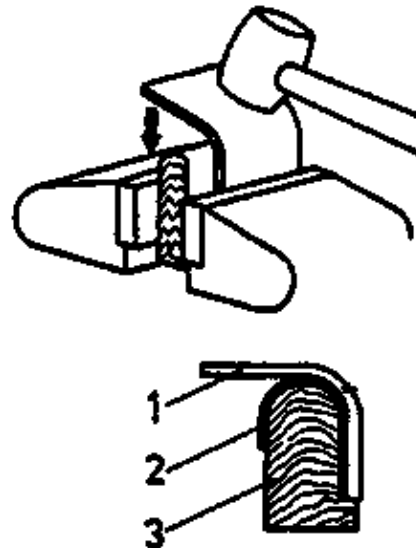


Figure 41 Rounding on the vise 1 sheet, 2 intermediate metal plate for enlarging the bending radius, 3 bending die

Sheets can be bent round with presses, when bending punches and bases, formed according

to the bending radius, are available. The punch is the bending die in this case. Should the need arise, the sheet would have to be bent in several bending steps.

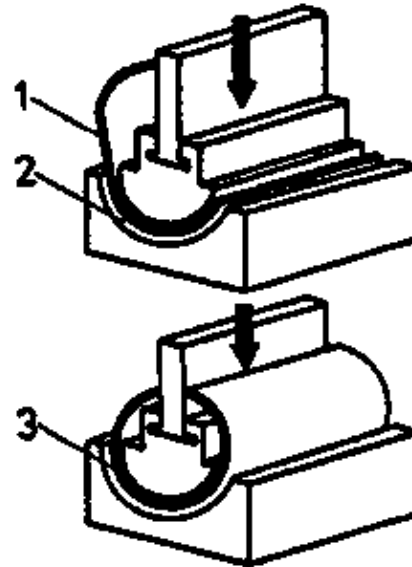


Figure 42 Rounding on the press *1, 2, 3* sequence of bending steps

Sheets can be rounded on the folding press, when a bending rail (e.g. round sections) with the respective radius is mounted on the upper clamping cheek.

The lower clamping cheek and the bending cheek must be so adjusted that they are away from the bending rail centre of rotation by bending radius plus sheet thickness. In case of bigger bending angles, the sheet has, if need be, to be rounded in several bending steps. However, the bending angle is limited by the adjustability of clamping and bending cheeks.

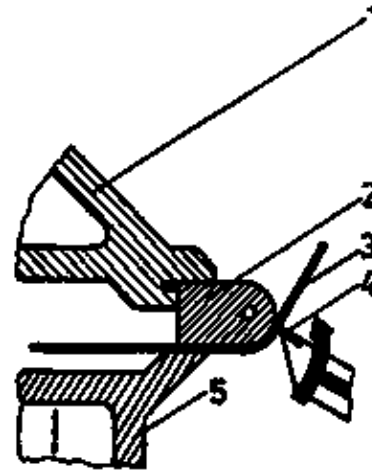


Figure 43 Rounding on the folding press 1 top clamping cheek, 2 changeable bending rail, 3 sheet, 4 bending cheek, 5 bottom clamping cheek

Long sheet metal can be bent up to the complete circle on the rounding device. Bending force is applied by a pressure roll, pushing the sheet away from the bottom roll and bending it around the top roll. Depending on the bending radius, one or several bending steps are necessary. When the three-roller bending machine is used, the sheet ends are to be pre-bent, otherwise they remain straight by half the length of the distance between bottom roll and pressure roll

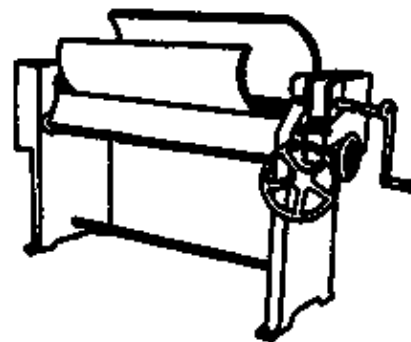


Figure 44 Rounding on the rounding device *1, 2, 3* sequence of bending steps

How can sheet metals be bent on the vise?

5.7. Rounding of Sections

Thin round sections may be bent manually or with bending devices. When bending dies are used, attention has to be paid to the fact that, due to spring-back, the radii of bending dies should be smaller than the desired bending radius requires it.

Smaller roundings can be made by turning the workpiece end, gripped with the round nose plier, around the jaws of plier. Bigger roundings are bent on respective bending mandrels of bending devices.

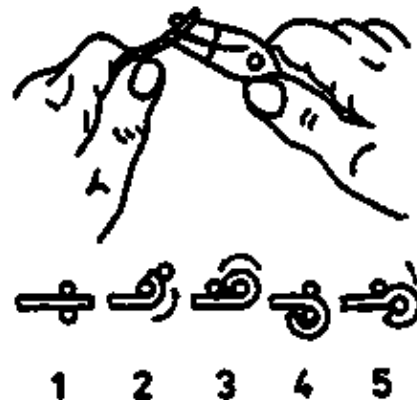


Figure 45 Rounding of thin round sections with the round nose plier *1, 2, 3, 4, 5* sequence of bending steps

Sections such as flats, angles, tees, and channels may be bent on devices or section bending machines.

Depending on the form of section, the workpieces to be bent are rounded between special profile rolls.

Distortions are avoided by special counter rollers.

According to the kind of profile and size of bending radius, bending has to be effected in cold or hot state.

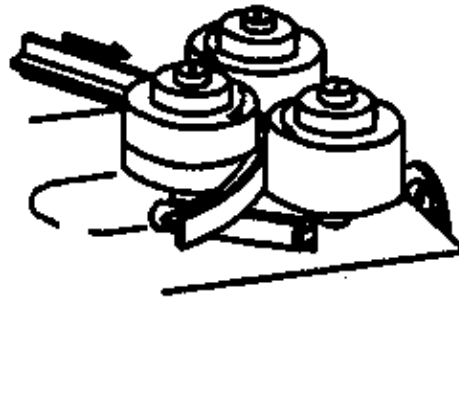


Figure 46 Rounding of angular section with the section bending machine

In bending with bending dies, the workpiece must be tightly clamped at one end and rounded around the bending die with auxiliary tools or hammers. Frequently, this is followed by straightening work.

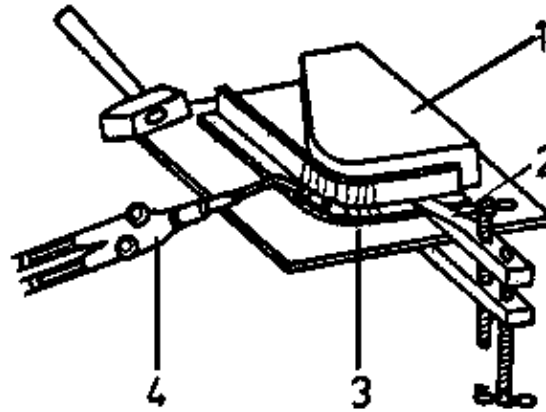


Figure 47 Rounding of angular section with a bending die 1 bending die, 2 bracing, 3 heating zone, 4 welding torch

Rounding may also be performed over bending dies on swage blocks. The workpiece is tightly clamped in a mounting support and rounded with relevant tools around the contact faces.

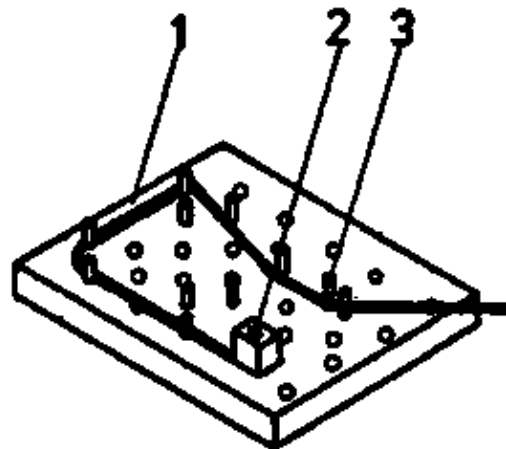


Figure 48 Rounding of round sections on the swage block 1 swage block, 2 bracing, 3 dogs

Rounding with mechanical bending devices is possible in case of round, square and rectangular cross-sections. The workpiece is fixed in a mounting support and bent with a slide roller to the angle desired.

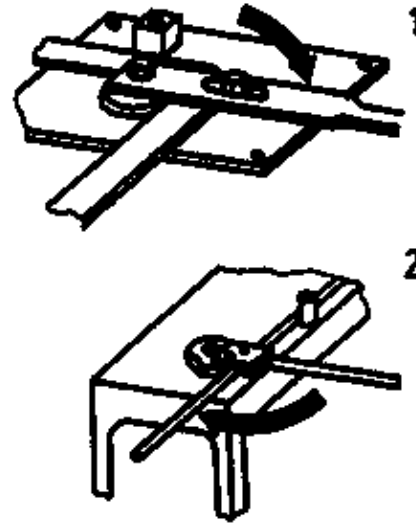


Figure 49 Rounding of sections with bending devices *1 flat section, 2 round section*

Which devices and tools are needed to round sections?

5.8. Rounding of Pipes

Rounding of pipes requires special measures to prevent them from being flattened at the bending point Counter measures would be:

- Heating to be locally changed on the pipe wall at the bending point during the bending procedure**
- Filling the pipe (quartz sand, resin, lead).**

Steel pipes having a diameter of more than 1/2" are to be bent in a heated state with filler. In case of welded pipes, attention has to be paid to the fact that the welding seam is lateral to the bending radius, because the neutral axis is there and thus, the welding seam cannot

rupture.

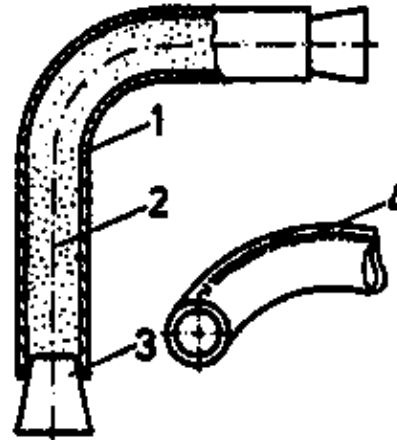


Figure 50 Rounding of pipes 1 steel pipe, 2 sand filler, 3 stopper, 4 position of welding seam lateral to the bending

Only use dry sand as filler for hot bending.

When being heated, moist sand forms water steam ejecting the locking stopper - risk of getting injured.

Manually, filled pipes can only exactly be bent with pipe bending and other bending devices.

Bending mandrels and bending rollers of appliances and devices should be adapted to the pipe diameter.

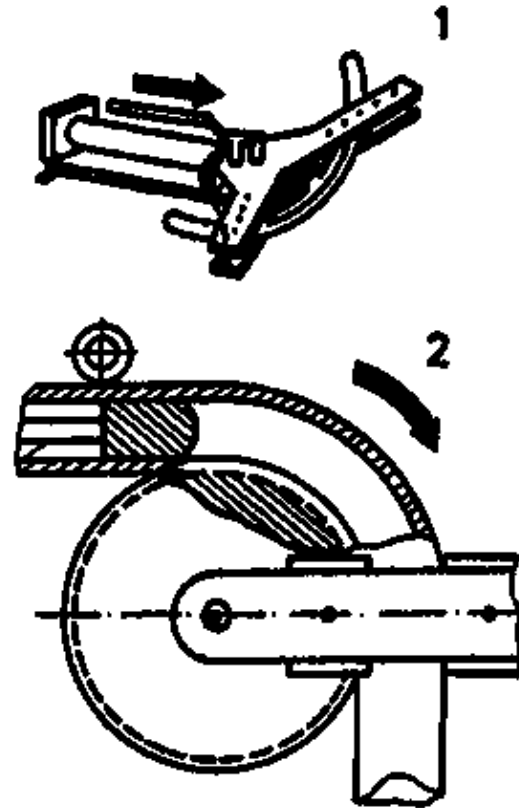


Figure 51 Rounding of pipes with: 1 pipe bending device, 2 bending appliance

When pipes are hot bent, the pipe zone to be bent is locally heated to a light-red heat (approx. 900°C). In case of thin-walled pipes the inside of the bending is more heated than the outside so that upsetting at the internal side can be done more easily.

As for pipes with larger diameters, one partial area of the bending zone after the other is heated and bent

Note:

When pipes are bent, a definite minimum bending radius should be adhered to.

Empirical values for steel pipes:

For hot bending:	radius = 2 to 4 × diameter
For cold bending:	radius = 10 × diameter

For hot bending, the bend length is to be calculated previously. It is calculated from the circumference with about 1.5 times the radius, with a bending angle of 90°.

Example:

A steel pipe is to be bent with a bending radius of 75 mm to 90°. The bend length to be heated is calculated as follows:

$$L = 1.5 \times R$$

$$L = 1.5 \times 75 \text{ mm}$$

$$L = \underline{112.5 \text{ mm}} \quad 120 \text{ mm selected}$$

The bend length to be heated is divided into two measuring ranges being in a certain relation to each other.

Band length = dimension leg + bending leg

$$1 \quad = \frac{2}{3} \quad = \frac{1}{3}$$

The dimension leg corresponds to $\frac{2}{3}$, of the bend length, while the bending leg is $\frac{1}{3}$, of the bend length.

To mark the bend length on the pipe, one has to proceed from the pipe's dimension length

being the measure from the pipe beginning to the centre of the pipe end to be bent. Proceeding from the dimension length on the unbent pipe, the dimension leg is scribed to one side and the bending leg to the other one.

Thus, the bend length to be heated has been established.

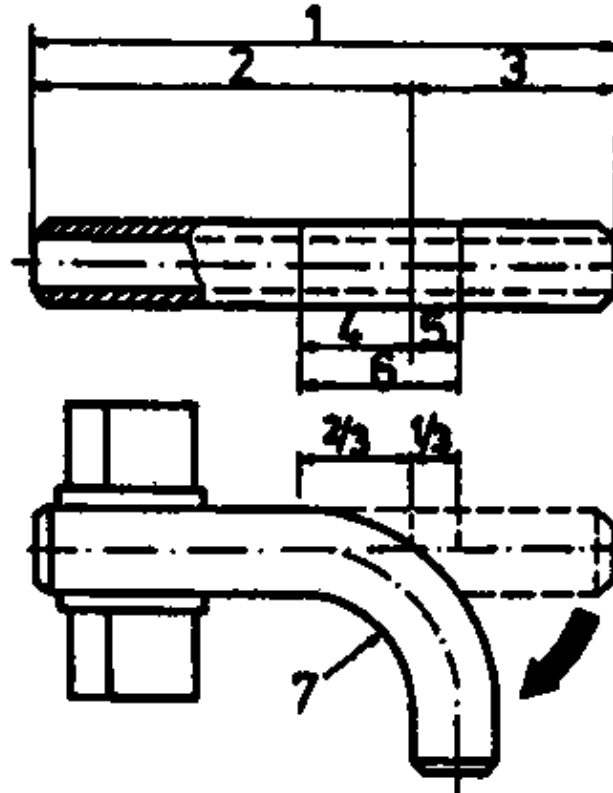


Figure 52 Dimensions on the 90° pipe knee 1 stretched length, 2 dimension length, 3 bending length, 4 dimension leg, 5 bend leg, 6 bend length to be heated, 7 bending radius

By which means can pipes be rounded?

What is to be noted when pipes of more than 1/2" in diameter are founded?

What is to be noted when welded pipes are rounded?

Which length is to be exactly calculated prior to hot bending?

How is the bend length scribed?

5.9. Rolling of Sheet Metals

If sheet metals arc so far rounded at their rims that they have a bending angle of 360° and more, this procedure is called "rolling" (or beading). The bending radius is constantly small. Sheet metals may be rolled over a round section manually. For that purpose, they are to be pre-bent over the round section and then brought to the final form over the round section with uniform hammer strikes. If wire is used as a round section, it remains as insert in the bead.

However, it is better to roll sheets on devices.

The device is adjusted to the diameter of the bead and the beaded bar with the respective diameter is inserted (overall bead diameter minus twice the sheet thickness).

Subsequently, the sheet is pushed into the holding slit of the beaded bar and the latter is turned.

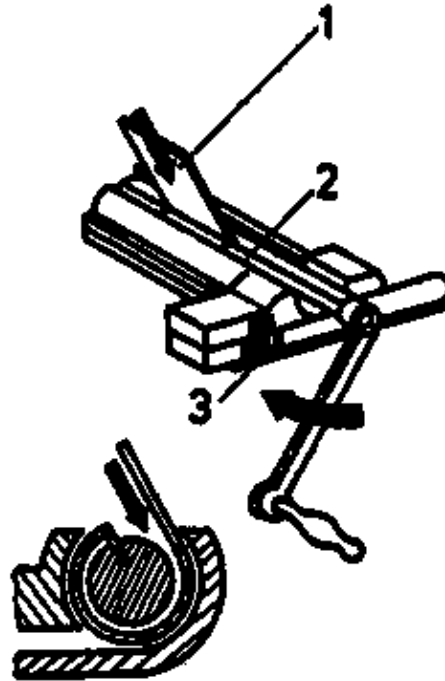


Figure 53 Rolling of sheet rims with a beading device *1 sheet, 2 beaded bar, 3 appliance with control dial*

Sheet metals can also be rolled with presses, if the punch takes over the rolling process by the respective shape arrangement and the sheet is clamped in a fixed base. The sheet metal has to be pie-bent by a small size before the punch is lowered.

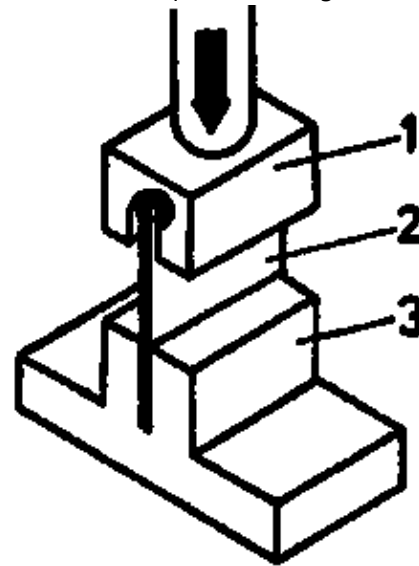


Figure 54 Rolling of sheet rims with presses *1 punch, 2 sheet, 3 base*

By which means can sheet metal rims be rolled?

5.10. Rolling of Sections

Flat sections are manually rolled with the rolling mandrel or on the rolling device. It is important to slightly sharpen the flat section prior to rolling so that after rolling the end sits close and shows a closed eye. After being sharpened the section is pre-bent and then finish rolled. These processes are performed like those for rolling sheet metals.

A special rolling technique is the winding of spiral springs from round sections. For that purpose, steels rich in carbon and having a tensile strength of 700 MPa are used. Mechanically, winding is effected on lathes around a winding mandrel.

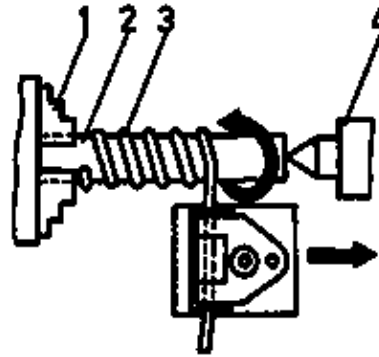


Figure 55 Mechanical winding of a compression spring on the lathe *1 lathe chuck, 2 winding mandrel, 3 compression spring, 4 tailstock with live centre*

Manually, winding is performed on a vise by employing wood clamping screw stocks and winding mandrels.

Tension and compression springs are made by winding spring wire in turns of a coil on a winding mandrel.

Procedure of fabricating a compression spring:

- Threading the spring wire through the winding mandrel hole.**
- Clamping the winding mandrel in the wood clamping screw stock on the vise - the winding mandrel can be just turned with the spring wire. When the wire is paid off, its tension must be released, i.e. it is wound in opposite direction to the tension.**

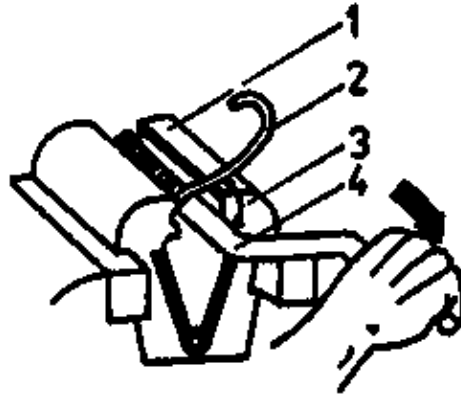


Figure 56 Manual winding of a compression spring 1 wood clamping screw stock, 2 wire tension contrary to winding direction, 3 bevel protractor, 4 winding mandrel

- **Winding the spring** - when the spring wire is applied in axial direction, the angle determines the spring lead of helix.
- **Carefully open the vise** to prevent the spring from bursting open heavily.
- **The spring is fitted on a mandrel and face-ground on a grinding wheel** - the fully annealed dead coils lie against the springy coils.

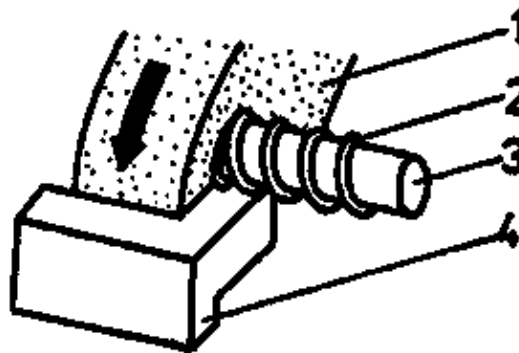


Figure 57 Face-grinding and close-setting of dead coils 1 grinding wheel, 2 spring, 3 mandrel, 4 grinding rest

Contrary to compression springs, tension springs are closely wound so that the coils are closely-spaced. As for the eyelets, 2 additional coils have to be taken into consideration. When the wire is paid off, its tension is utilized, i.e. it is wound in direction of tension.

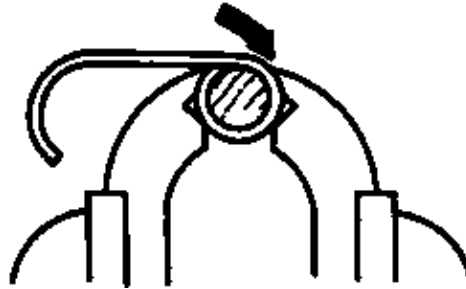


Figure 58 Winding a tension spring in direction of wire tension

After winding, the eyelets are bent off in a clamp.

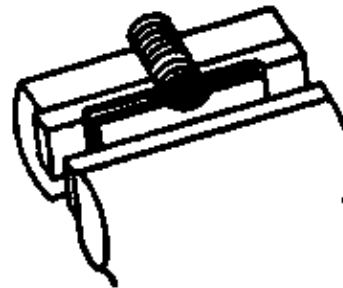


Figure 59 Bending of tension spring eyelets on the clamping plate

Calculation of the compression spring:

A compression spring with 10 active coils with 22 mm medium spring diameter and 30 mm in length is needed.

The spring wire is 2 mm thick.

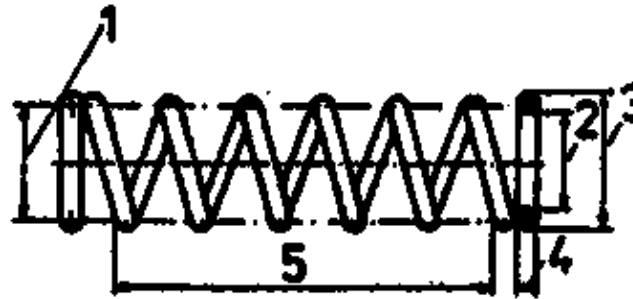


Figure 60 Compression spring 1 medium spring diameter D_m , 2 internal spring diameter D_i , 3 external spring diameter, 4 spring wire diameter D , 5 length of active coils

First the internal spring diameter must be calculated:

$$D_i = D_m - D$$

D_i = internal spring diameter

D_m = medium spring diameter

D = wire diameter

Calculation example:

$$D_i = D_m - D = 22 \text{ mm} - 2 \text{ mm} = \underline{20 \text{ mm}}$$

Afterwards, the diameter of the winding mandrel is to be calculated: $D_w = 0.8 \cdot D_i$

The winding mandrel, due to the wire spring-back, must be smaller than the internal spring diameter:

D_w = winding mandrel diameter

Calculation example:

$$D_w = 0.8 \cdot D_i = 0.8 \cdot 20 \text{ mm} = \underline{16 \text{ mm}}$$

Then the wire length is to be calculated: $L = \pi \cdot D_m(W + Z)$

In addition to the active coils, 2 times 0.75 of dead coils are to be considered:

$$L = \text{wire length} \\ = 3.14 \text{ (constant)}$$

W = number of active coils

Z = extra for dead coils = 1.5

Calculation example:

$$L = \pi \cdot D_m(W + Z) = 3.14 \cdot 22 \text{ mm} (10 + 1.5) = \underline{794.5 \text{ mm}}$$

To be able to hold the wire in the clamp jaw, this length has to be given an extra.

Calculation of a tension spring:

A tension spring of 2 mm spring wire with 25 mm medium spring diameter and 30 active coils is to be wound. 2 coils are additionally needed for the suspension loops.

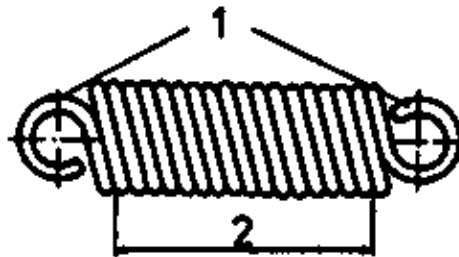


Figure 61 Tension spring 1 *hang-up eyelets*, 2 *length of active coils*

Internal spring diameter

$$D_i = D_m - D = 25 \text{ mm} - 2 \text{ mm} = \underline{23 \text{ mm}}$$

Diameter of the winding mandrel:

$$D_w = 0.8 \cdot D_i = 0.8 \cdot 23 \text{ mm} = \underline{18.4 \text{ mm}}$$

Wire length:

$$L = \pi \cdot D_m(W + Z) = 3.14 \cdot 25 \text{ mm} (30 + 2) = \underline{2512 \text{ mm}}$$

By which means can springs be wound?

