

## IBM HPS POWER5 Readme - Service Pack 14 Addendum #1

---

[Introduction](#)

[Supporting documentation](#)

[Component updates/Download information](#)

[Installation sequence](#)

[AIX LP](#)

[Known problems and workarounds](#)

[Fix list](#)

[Readme archive](#)

---

### Introduction

07/17/2007

The IBM pSeries High Performance Switch (HPS) POWER5 Service Pack provides updates and code levels for these components:

- Hardware Management Console (HMC).
- Global Firmware (GFW).
- Power Subsystem Microcode (BPC code).
- HPS Network Manager (HPSNM).
- HPS/Switch Network Interface (SNI) Devices LP.
- Cluster Systems Management (CSM) LP.
- Reliable Scalable Cluster Technology (RSCT) software.
- AIX 5L Version 5.2 and 5.3.
- Various supporting AIX LPs.

HPS POWER5 Service Pack 14 Addendum #1 provides support for release SF240\_320 / BP240\_214.

Issues moving to BASE GA7 that are resolved in Release Level SF240\_219 are that 9118-575 systems with 01SF230\_126\_120 (or a later 01SF230 firmware level) that are upgraded to 01SF235\_160\_160 firmware will not boot if the I/O chassis on 9118-575 has been replaced. The failure requires that the VPD card for the 9118-575 be replaced to fix the problem.

If you are coming from SP2 there is no new microcode. This means that if you are following the new code load procedure; then you will not have to re-IPL the CEC nor Power Off the CEC; you will only have to reboot the LPARs to activate the alt\_disk.

This document also contains general guidelines for upgrading the components listed in [Component updates/Download information](#).

These guidelines are intended to be a supplement to the other IBM documents referred to in this document.

You must have all referenced documents available before you begin the upgrade process. A list of referenced documents can be found in [Supporting Documentation](#).

The Code Levels listed in [Component updates/Download information](#) reflect the levels available at the

time of this HPS POWER5 Release. Some components support only a single version, notably the Microcode for GFW and the Power Subsystem. Subsequent released versions are expected to be backward compatible.

The procedure outlined in [Recommended Installation Sequence](#) is the standard sequence of installation. Non-standard sequences or undocumented code levels may cause unforeseen problems. In this event please contact your Customer Service Representative.

HPS POWER5 SP3 introduced a modified install plan intended to reduce the maintenance window down time. Refer to the [Alternate procedure to reduce downtime](#).

HPS POWER5 SP5 introduced support for system firmware level 240.

HPS POWER5 SP11 allows use of the HPS TOD "Time of Day" function (refer to "Restrictions" section).

## Service Pack Levels

### 230 Service pack code levels:

**HMC:** Version: 4; Release: 5.0 - Build level 20050629 + MH00454  
IBMhsc.HPSNM\_log-1.4.1.3-1 RPM

**CEC:** Global Firmware (GFW) - Version SF230\_158  
**FRAME:**Power Code (BPC code) - Version BP230\_155

### 235 Service Pack code levels:

**HMC:** Version 5.1 + MH00593  
IBMhsc.HPSNM\_log-1.4.1.1-1 RPM  
IBMhsc.NM\_Common-1.0.0.0-12

**CEC:** Global Firmware (GFW) - Version SF235\_214  
**FRAME:** Power Code (BPC code) - Version BP235\_212

### 240 Service pack code levels:

**HMC:** Version: 6 Release: 1.0 + MH00915 (HMC V6R1.2)  
HMC V6R1.2 + MH00946 (efix for the CSM component)+  
MH00985 (Miscellaneous fixes for HMC V6)

HPSNM Service Pack 10: IBMhsc.HPSNM\_log-1.4.1.12-1 RPM

IBMhsc.NM\_Common-1.1.0.4-1 RPM

IBMhsc.IBMNM\_GUI-1.1.0.3-1 RPM

**CEC:** Global Firmware (GFW) - Version SF 240\_320

**FRAME:** Power Code (BPC code) - Version BP240\_214

AIX Service Packs and Supported Cluster and High Performance Computing (HPC) LPs:

- AIX 5L Version 5.2 TL 10 SP1 + APAR IY99799.
- AIX 5L Version 5.3 TL 06 SP1 + APAR IY99798.
- HPSNM - csm.hpsnm 1.4.1.17 (CSM Management Server only).
- AIX 5L Version 5.2 / HPS Devices LP 1.1.3.x as listed in [Detailed LP level check](#).
- AIX 5L Version 5.3 / HPS Devices LP 1.2.0.x as listed in [Detailed LP level check](#).
- Other supported AIX LP's as listed in [Detailed LP level check](#).

New functions and features

The following items are new functions and features in release 240 for the High End systems that support the IBM HPS:

- Support for 2.2 GHz processors on the model 570.
- Support for 1.9 GHz processor cards on the model 9406-570.
- Support for 4, 8, and 16 GB memory cards with 0% initial activation, and 1 GB activation increments, on model 590 and model 595 systems.
- Support for two CUoD DDR2 memory features on the model 570: a 4/8 GB feature, and an 8/16 GB memory feature.
- Support for mixing CoD-capable DDR2 memory with DDR2 memory that is not CoD-capable in a system.
- Support for F/C 0649, a new high-performance SCSI with RAID 6 disk controller.
- Support for the collection (and viewing on the HMC) of logical partitions' utilization of processor and memory resources.
- Support for enhanced model 575.
- Support for concurrent maintenance of the following entities on model 590 and 595 systems:
  - Node addition or upgrade.
  - RIO bus adapter addition or upgrade.
  - RIO bus adapter repair.
  - Clock card repair.
  - Various enhancements to the server firmware to reduce IPL times.
  - Support for huge pages (16 GB) in the Advanced System Management Interface (ASMI) menus.
  - Enhancements to the "Restore to factory default" option, CoD options, time-of-day, and firmware update policy menu on the ASMI menus.

- Enhancements to the memory deconfiguration menu interface in the ASMI menus.
- The option to set the number of virtual LAN (VLAN) switches was added to the ASMI menus.
- A feature was added to the system firmware so that booting a system or partition from a hard disk will be retried, instead of immediately failing, to handle the situation in which disks are not yet available to boot before the firmware wants to boot from them. This typically happens when the boot disk is in an external disk enclosure.
- Add support for USB devices in system firmware.
- The maximum number of I/O towers on a loop was increased to six on iSeries model 595.

## IBM HPS POWER5 Readme - Service Pack 14 Addendum #1

---

[Introduction](#)

[Supporting documentation](#)

[Component updates/Download information](#)

[Installation sequence](#)

[AIX LP](#)

[Known problems and workarounds](#)

[Fix list](#)

[Readme archive](#)

---

### Supporting Documentation

Use the following information to reference the supporting documentation for this Readme:

- [High Performance Switch Planning, Installation, and Service for IBM server p5 servers](#)
- [Hardware Management Console](#)
- [eServer pSeries and AIX Information Center](#)
- [Switch Network Interface for eServer pSeries High Performance Switch Guide and Reference](#)
- [AIX 5.2 documentation](#)
- [AIX 5L Version 5.2 Installation Guide and Reference](#)
- [AIX 5L Version 5.2 Performance Management Guide](#)
- [Reliable Scalable Cluster Technology \(RSCT\) Library](#)
- [General Parallel File System \(GPFS\) Library](#)
- [GPFS FAQs](#)
- [Cluster System Management \(CSM\) Library](#)
- [IBM Parallel Environment \(PE\) Library](#)
- [LoadLeveler for AIX5L and Linux V3.3](#)
- [Guide to Multiple Page Size Support on AIX 5L Version 5.3](#)
- [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#)
- [CSM for AIX5L V1.x Planning and Installation Guide](#)
- [CSM for AIX5L V1.x Administration Guide](#)

## IBM HPS POWER5 Readme - Service Pack 14 Addendum #1

[Introduction](#)[Supporting documentation](#)[Component updates/Download information](#)[Installation sequence](#)[AIX LP](#)[Known problems and workarounds](#)[Fix list](#)[Readme archive](#)

## Component Updates/Download Information

The following table contains information about component updates and locations for downloading the updates.

*Service pack update and download information*

Component	Service pack updates	Download sites
<b>HMC</b>  This release requires that the HMC is installed with code levels that are related to specific firmware.	<b>230</b> HMC V4R5.0. Select HMC Version 4.5 HMC_Update_V4R5.0_1.zip HMC_Update_V4R5.0_2.zip  This release requires efix MH00454.  You can download the HMC Recovery CD V4R5.0 package as a set of .iso images by using Download Director or you can download the corrective service file directly from the Internet.  See Notice regarding 7310-C04 and 7310-C05/ internal modem compatibility issue.	<a href="#">HMC Support</a>  Select "HMC 4.5"  Downloads for updates and fixes are on the "Corrective service" tab.  For the HMC Update ReadMe, select "View" in the "ReadMe" column for the specific update package.  For fix locations and installation instructions, select the "Installation instructions" link on the "Corrective service" tab.

**235**

## HMC V5R1

Select "HMC\_Recovery\_CD\_V5R1.0"

This release requires that the HMC is installed with HMC V5R1.0.

PTF MH00593 is an HMC Required Maintenance Package (HMC Version 5, Release 1.2.). This Maintenance Fix *must* be installed on HMC Version 5 Release 1.0.

Updating to HMC 5.1 requires an Upgrade via the Recovery media process. There is no "update" corrective service to upgrade your current HMC Version to HMC 5.1.

The HMC Recovery DVD V5 R1.0 is a bootable image and contains the HMC Base Code. You can order the package DVDs from the HMC "Recovery Media" tab. You can also download the DVD images in ISO format, and then use the images to burn your own DVD.

Click the "Installation instructions" tab for procedures for burning DVDs and for using the HMC Recovery DVD V5 R1.0.

See Notice regarding 7310-C04 and 7310-C05/ internal modem compatibility issue.

**240**

HMC V6R1.0 + MH00915 (updates HMC V6R1.0 to V6R1.2)

+ MH00985 (Miscellaneous fixes for HMC V6)

+ MH00946 (CSM fix for Cluster Ready Hardware Server)

This release requires that the HMC is installed with HMC V6R1.2.

See Notice regarding 7310-C04 and 7310-C05/ internal modem compatibility issue.

[HMC Support](#)

Select "HMC 5.1"

Downloads and media ordering for Recovery DVDs are on the "Recovery media" tab. Click the "View" link for the ISO images to see the HMC Readme.

Downloads for updates and fixes are on the "Corrective service" tab.

For the HMC Update ReadMe, select "View" in the "ReadMe" column for the specific update package.

For fix locations and installation instructions, select the "Installation instructions" link on the "Corrective service" tab.

[HMC Support](#)

Under "HMC products for servers with POWER5 processors" and select "HMC 6.1.2"

**Notes:**

1. There is a known problem when upgrading the HMC from version 5 and early version 6 to version 6.1 or later. In this scenario, the Hardware Server Resource Manager on the HMC fails to start after the upgrade. This failure results in the HMC not displaying the hardware configuration.

To avoid this problem when upgrading to HMC version 6.1.2, you must also install HMC interim fix PTF MH00946. Obtain this fix from the [HMC Support](#) page. MH00946 will be picked up in a future HMC V6.x update package.

2. MH00915 is required to get to V6R1.2.
3. You must use Recovery media or the Network to perform an Upgrade to update to HMC Version 6 Release 1.0.
4. MH00985 is recommended with GA7SP6 (Miscellaneous fixes for HMC V6).

Contact your IBM Sales Representative or Business Partner, and order Hardware Feature Code (MES) 0960 for the initial upgrade CDs.

**230:** Fix pack BP230\_155  
Fix pack SF230\_158

**235:** Fix pack BP235\_212\*\*  
Fix pack SF235\_214

**\*\*Note:**Power Subsystem update BP235\_212 should only be installed on POWER5 systems using the IBM pSeries High Performance Switch. Download this update by clicking on the following links:

- o [02bp235\\_212\\_156.rpm](#)
- o [02bp235\\_212\\_156.xml](#)
- o [02bp235\\_212\\_156.html](#)

Downloads for updates and fixes are on the "Corrective service" tab.

For the HMC Update ReadMe, select "View" in the "ReadMe" column for the specific update package.

For fix locations and installation instructions, select the "Installation instructions" link on the "Corrective service" tab.

**Power Subsystem  
Microcode**

[Microcode Updates](#)

AND

**System Firmware**



**240:** Fix pack BP240\_214  
Fix pack SF240\_320

Power Subsystem Microcode is available up to 1 week earlier and GFW is available 3-4 days earlier than the web download site.

Please contact your IBM Service Support Rep (SSR) for the Power Subsystem Microcode or GFW package if not available on website.

AIX levels for this Service Pack:

**AIX52**

Service Pack 5200-10-01  
bos.mp64: 5.2.0.106

APAR [IY99799](#) ([Problem Opening Paths to Fibre Disks](#))

devices.fcp.disk.rte.5.2.0.107

[pSeries support fixes](#)

**AIX53**

Service Pack 5300-06-01  
bos.mp64: 5.3.0.61

[AIX V 5.2](#)

[AIX V 5.3](#)

**AIX**

APAR [IY99798](#) ([Problem Opening Paths to Fibre Disks](#))

[AIX 5L Critical fixes](#)

devices.fcp.disk.rte.5.3.0.62

Also Apply Critical fixes as appropriate.

**Note:**

Critical fixes for AIX 5L service are no longer being updated.

Because critical and pervasive fixes are now delivered as part of Service Packs, Critical Fix Packs will no longer be created. To better understand this direction, read [AIX 5L Service Strategy and Best Practices](#).

To download Service Packs for AIX visit [Quick links for AIX fixes](#).

**Notes:**

1. CSM 1.4 requires RPM update openCIMOM 0.8 (5.2)
2. If you are APPLYING software for csm.server 1.4.1.1, please install the following images from the AIX Installation Media Volume 2:  
**tcl**  
**tk**  
**expect**  
**conserver-8.1**

**openCIMOM**  
(CSM requisite)

[openCIMOM](#)

openssl-0.9.7d-2

**SSL\_**  
(CSM requisite)

AIX-rpm-5.2.0.40-1

[sourceforge.net -  
openssh-aix](#)

**SSH\_**  
(CSM requisite)

openssh-3.8.1p1\_52.tar.gz

[sourceforge.net -  
openssh-aix](#)

**On the CSM MS:**

This release requires AIX HPSNM LP csm.hpsnm 1.4.1.17

apply HPSNM AIX PTF U811265, [APAR IY92631](#)

[pSeries support fixes](#)

**Note:**

AIX filesets csm.hpsnm and csm.server may be included in AIX Maintenance or Technical Level Update Packages, should *only* be installed on the CSM MS and *not* on production LPARS.

[Fix Central](#)

**On the HMC:**

**HPSNM**

230 Level:

HMC v 4.5

HPSNM Service Pack 3 MB01192 MH00401

HPSNM\_Serv\_Pack3.zip

[Hardware  
Management Console](#)  
Support for UNIX servers and Midrange servers

235 Level:

HMC v 5.1

HPSNM Service Pack 4 MB01237 MH00461

HPSNM\_Serv\_Pack4.zip

Select an HMC release, and then select the "HPSNM/IBMNM fixes" tab

240 Level:

HMC v 6.1.2

HPSNM Service Pack 10 MB02132 MH01013

HPSNM\_Serv\_Pack10.zip

## IBM HPS POWER5 Readme - Service Pack 14 Addendum #1

[Introduction](#)[AIX LP](#)[Supporting documentation](#)[Known problems and workarounds](#)[Component updates/Download information](#)[Fix list](#)[Installation sequence](#)[Readme archive](#)

## Installation Sequence

Complete the information in the following subsections to install this service pack:

1. Install HMC
2. Install Power Subsystem Microcode
3. Install GFW
4. Create LPAR definition and assign adapters.
5. Install Cluster System Manager (CSM) Software
6. Define the nodes/LPARs in the cluster.
7. Assign IP Addresses for SNIs
8. Install AIX on all LPARs in the cluster
9. Apply HPS/SNI Updates
10. Dynamic Host Configuration Protocol (DHCP)
11. Power Off CECs
12. Configure the High Performance Switch Network Manager (HPSNM)

In order to coordinate the tasks necessary for the installation and configuration of the HPS Cluster, we recommend that Service Support Representatives and System Administrators review the following documents applicable to your CSM release:

- [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#)
- [CSM for AIX5L V1.x Planning and Installation Guide](#)
- [CSM for AIX5L V1.x Administration Guide](#)

Especially Chapter 6 *Installation* of the [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#) provides detailed information on the hardware, firmware, and software sequence of installation.

## Alternate procedure to reduce downtime

Perform the following upgrade procedure to reduce the maintenance window for the service packs upgrades.

1. On the CSM MS - install / upgrade:
  - Install the new AIX PTFs.
  - Install the new RSCT PTFs.
  - Install the new CSM PTFs.
  - Install the new FNM PTFs.
  - Reboot the CSM MS.
2. On the HMC - install / upgrade:
  - Upgrade ELA master and wait until ELA master is up and running.
  - Upgrade the rest of the HMCs.
3. Power Code upgrade:
  - If the new Power Code supports concurrent upgrade; then select concurrent upgrade during

the update process.

- If the new Power Code does not support concurrent upgrade; then select concurrent install only with deferred disruptive activate.

#### 4. GFW upgrade:

- Disable SNM.
- If the new GFW supports concurrent upgrade; then select concurrent upgrade during the update process.
- If the new GFW don't supports concurrent upgrade; then select concurrent install only with deferred disruptive activate.
- Enable SNM.

#### 5. On the LPARs - install / upgrade AIX and LPPs:

- Use alternative disk install for AIX and LPPs.
- Change the bootlist to the alternative disk.

#### 6. Stop the workload:

- If you don't have to activate Power Code or GFW; then reboot the LPARs to activate alt disk install.
- If you don't have to activate Power Code or GFW but have new microcode; then shutdown the LPARs
  - Re-IPL CECs.
  - Activate the LPARs.
- If you do have to activate Power Code or GFW:
  - Shutdown the LPARs.
  - Power off the CECs.
  - Activate the Power Code or the GFW Code.
  - Power on The CEC(s) the LPARs.

#### 7. Restart the workload.

### Note:

This SP updates both the GFW and the BPC code concurrently.

### Install HMC

Install Hardware Management Console (HMC) software on all HMCs in the cluster. There are no required efixes to apply.

### Documentation Reference:

- [Hardware Management Console](#)
- [Hardware Management Console V4R5.0 Readme](#)
- [Hardware Management Console V5R1.0 Readme](#)
- [Hardware Management Console for pSeries Maintenance Guide](#)
- [Hardware Management Console for pSeries Installation and Operations Guide](#)
- [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers \(SA38-0646-00\)](#)

### HMC Software Download Information

In the HMC corrective service support section on the [HMC Power5servers page](#), scroll to "Supported HMC products" and select from the following:

- SF230: Version 4.5 machine code updates
- SF235: Version 5.1 machine code updates
- SF240: Version 6.1 machine code updates

Follow the information and HMC installation instructions.

**Note:**

Check if your HMC is listed in the BIOS updates sub-section. If you are updating the HMC on a listed model, you must first update the BIOS of that HMC model. The BIOS and installation instructions are also available on the [HMC support page](#).

**Installation Notes**

If the HMC was used in standalone mode before CRHS setup, reboot the HMC after running the addpeer command to add the HMC into the peer domain. This ensures that the HMC GUI displays hardware in cluster mode.

Upgrading an HMC in the ClusterPeerDomain should not require that the addpeer command be run again for that HMC. The ClusterPeerDomain should be preserved after an upgrade.

**Caution:**

There is a known problem when upgrading the HMC from Version 5 and early Version 6 to Version 6.1 or later. In this scenario the hardware server resource manager on the HMC fails to start after the upgrade. This results in the HMC not displaying the hardware configuration.

To avoid this problem when upgrading to HMC version 6.1.2 (in this p5 HPS SP13 Service Pack release), you must also install HMC interim fix PTF MH00946. Obtain this fix from the HMC 6.1.2 [HMC support page](#). MH00946 will be picked up in a future HMC V6.x update package.

To preserve the Cluster Ready Hardware Server configuration on an HMC, be sure to save "Save upgrade data" prior to upgrading the HMC. This data should automatically be restored after the HMC is upgraded and doesn't require a reboot of the HMC.

Install the HMC code using the most recent copy of the [HPS Install and Planning Guide](#).

Review the HMC information on the web page where you downloaded the images.

For new HMC install follow the instructions in Chapter 3, "Installing and Configuring the HMC":  
[Hardware Management Console for pSeries Installation and Operations Guide](#).

**Level Check**

Level Check by running the lshmc -V command on the HMC command line or selecting the "Help --> About Hardware Management Console" option on the HMC GUI.

Level Check from HMC command line where lshmc -V shows:

**SF230:**

```
version= Version: 4
Release: 5.0
HMC Build level 20051010.1
MH00454: Maintenance Package for V4R5.0 (10-10-2005)
```

#### SF235:

version= Version: 5  
Release: 1.1  
HMC Build level 20060104.1

#### SF240:

version= Version: 6  
Release: 1.2  
HMC Build level 20070123.1  
MH00946: Fix Cluster Ready Hardware Server issues after upgrade (02-07-2006)

Level Check from HMC GUI

Menu "Help" "About Hardware Management Console" shows:

#### 230 level:

Version: 4  
Release: 5.0  
HMC Build level 20051010.1  
MH00454: Required Maintenance Fix for V4R5.0 ( 10-10-2005)

#### 235 level:

Version= Version: 5  
Release: 1.0  
HMC Build level 20060104.1  
MH00523: Remote HMC Management fix (01-12-2006)  
MH00607: Fix Dump collection issues (02-25-2006)

#### 240 level:

Version= Version: 6  
Release: 1.2  
HMC Build level 20070123.1  
MH00946: Fix Cluster Ready Hardware Server issues after upgrade (02-07-2006)

### Service Network

The HMC requires a 'Service Network' to communicate with the Cluster components:

- HMC
- Managed Frames
- Managed Systems (CEC FSP's)
- CSM Management Server (MS)

This service network is an Ethernet hub to which the cluster components are connected via an Ethernet cable. There is a requirement to connect only one port of the frames A-side BPA Ethernet hub to the primary service network (a.k.a. external Ethernet hub).

Connect an Ethernet cable from the A-side BPA network hub at the top of the frame (labeled J00 RJ45 ports A, B, C or D). All 24-inch frames, including frames for the p575, p590, p595 servers and switch-only frame, are provided with their internal networks pre-cabled to the internal network hub on both sides of the frame. No additional internal Ethernet cable connections are required.

The other ports on the hub are connected to frame components such as the SP and BPA. HMCs typically have two integrated

Ethernet ports labeled 1 and 2, eth0 and eth1, respectively. eth0 must be connected to the private service network. Any other Ethernet port can be used for a public network if desired.

Check if BIOS hyperthreading is disabled on the HMC. Many of the rack mounted HMCs (8187-KUH, 7315-C03) have a BIOS option to enable hyperthreads. The HMC's embedded kernel will not run well when this option is enabled. Hyperthreading must be disabled before upgrading to HMC R4V5 or higher.

## WEBSM

After a successful HMC installation or upgrade, the Install Shield version of the Web-based System Manager Remote Client a.k.a WebSM PC Client may need to be re-installed on your remote server or PC. Uninstall any existing WebSM PC Client. Failure to uninstall will result in undefined behavior of the WebSM PC Client.

To install the PC Client software on your remote server or PC, complete the following steps:

1. Go to [http://<hmc-hostname>/remote\\_client.html](http://<hmc-hostname>/remote_client.html).
2. Select the image to install: Linux Or Windows
3. Select "Open" to immediately install on the machine on which the browser is running.

### Note:

The installation may take up to 10 minutes to complete.

For complete instructions on installing and using the Remote Client please refer to Chapter 9, "Installing and Using the Remote Client" in

[Hardware Management Console for pSeries Installation and Operations Guide](#).

## HMC Properties

Additional information on the HMC properties is also available in Chapter 6, "Installation" of the [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#).

**Important:** The login available at virtual console 0 (via the CTRL-ALT-F1 key sequence) is no longer available. Set the date and time

Check that the date and time is set on the Hardware Management Console. Refer to "Step 3: Set the date and time on the console" of the "Firmware Installation" section in Chapter 6 ("Installation") of the [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers \(SA38-0646-00\)](#) for more details.

Enable the CRHS port

Enable the Cluster Ready Hardware Server 8899:tcp port on the service network on the HMCs in the cluster.

To enable the Cluster Ready Hardware Server port, complete the following steps:

1. Open the HMC GUI.
2. Select *Customize Network Configuration*.
3. Select *Ethernet interface*.
4. Click on *Details*.
5. Click on *Firewall*.
6. Highlight *Cluster Ready Hardware Server 8899:tcp* from upper window.
7. Click the *Allow incoming* button.
8. Verify that *Cluster Ready Hardware Server* appears in the lower part of the window.



## 9. Reboot HMC after the configuration.

### Set frame numbers

Set frame numbers on each frame in the cluster. Refer to "Step 4: Setting frame numbers" of the "Firmware Installation" section in Chapter 6 ("Installation") of the [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#) for more details.

### Install Power Subsystem Microcode

Install Power Subsystem Microcode on all server and switch frames in the cluster.

Refer to "Step 5: Installing power subsystem microcode and managed system (GFW) firmware" of the "Firmware Installation" section in Chapter 6 ("Installation") of the pSeries High Performance Switch (HPS) Planning, Installation and Service Guide for IBM eServer p5 server (SA38-0646-00) for installation details.

#### Important Preliminary Notes:

- A complete install/update consists of two files, (i) a firmware code fixpack in RPM format and (ii) a cover letter in XML format.
- The managed frames must be in the Standby/Standby state on the "Frame Management" panel prior to the power subsystem microcode install/upgrade.

#### Documentation Reference:

- [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#)

#### Power subsystem microcode Download Information:

- <http://www14.software.ibm.com/webapp/set2/firmware/gjsn>

### Level Check

To view the expected installed and activated power subsystem licensed internal code (LIC) level after a successful install/upgrade:

- On the HMC GUI, select the "Licensed Internal Code Updates" tab.
- From the "Change Internal Code" task panel, select "View system information" and click OK.
- Select "None" on the "Specify LIC Repository" panel and click OK.
- EC Number LIC Type Machine Type/Model/Serial Number Installed Level Activated Level Accepted Level: where <nnn> is the Accepted LIC level last successfully installed and activated power subsystem LIC level

Refer to the [Component Update/Download Information](#) section for the Power Subsystem Microcode.

#### Note:

The HMC command line can also be used to update power subsystem microcode using the lslic and updlic commands. Refer to the HMC man pages for detailed information on using using these commands.

### Install GFW

Install managed system firmware on all managed systems/CECs in the cluster. Refer to "Installing power subsystem microcode and managed system (GFW) firmware" in the "Firmware Installation" section in Chapter 6 ("Installation") of the [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#) for installation details.

### Important Preliminary Notes:

- A complete install/update consists of two files, (i) a firmware code fixpack in RPM format and (ii) a cover letter in XML format.
- The managed systems must be in either Operating, Standby, or Power Off state on the "Server Management" GUI panel prior to the managed system firmware install/upgrade.
- Verify that the managed frames are in the Standby/Standby state on the "Frame Management" GUI panel prior to the power subsystem microcode install/upgrade.

### Documentation Reference:

- [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#)

### Managed system firmware (GFW) Download Information:

- <http://www14.software.ibm.com/webapp/set2/firmware/gjsn>

### Level Check

To view the expected installed and activated power subsystem licensed internal code (LIC) level after a successful install/upgrade:

- On the HMC GUI, select the *Licensed Internal Code Updates* tab.
- On the *Change Internal Code* task panel, select *View system information* and click *OK*.
- Select "None" on the "Specify LIC Repository" panel and click *OK*.
- EC Number LIC Type Machine Type/Model/Serial Number Installed Level Activated Level Accepted Level: [See: GFW Levels](#)

where <nnn> is the Accepted LIC level last successfully installed and activated power subsystem LIC level

### Note:

The HMC command line can also be used to update power subsystem microcode using the `lslic` and `updlc` commands. Refer to the HMC man pages for detailed information on using using these commands.

### Create LPAR definition and assign adapters

For details refer to "HMC code load" in the "Software Installation" section in Chapter 6, "Installation", [pSeries HPS Planning, Installation and Service Guide](#).

### Install Cluster System Manager Software

CSM software is part of the base AIX installation. The recommended AIX service levels :[See Component Updates](#)

## a. Preliminary Notes:

- o CSM requires openCIMOM 0.8(5.2) RPM update which is available on the AIX Toolbox page: <http://www.ibm.com/servers/aix/products/aixos/linux/download.html>
- o The following opensource images also available on the AIX Toolbox page, <http://www.ibm.com/servers/aix/products/aixos/linux/download.html>
- o pre-requisites for applying csm.server which will be carried out in Step 6b below:
  - tcl
  - tk
  - expect
  - conserver-8.1

## Documentation Reference:

- o For information on AIX installation, refer to [AIX 5L Version 5.2 Installation Guide and Reference \(SC23-4389-03\)](#)
- o For information on CSM installation, refer to CSM for AIX5L Planning and Installation Guide
- o For information on CSM configuration, refer to CSM for AIX5L Administration Guide
- o [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#)

For AIX5L Maintenance Package Download Information go to:

<http://www.ibm.com/servers/eserver/support/unixservers/aixfixes.html>

**Notes:**

- i. Check that the csm.gui.websm and csm.hpsnm filesets were installed as part of the AIX installation media and the option to "Automatically increase filesystems" was selected during the installation. These filesets are required for the operation of the High Performance Switch Network Manager (HPSNM) software on the CSM management server.
- ii. Check that the size of the /var directory on the CSM Management Server is approximately 1 Gigabyte to accommodate the HPSNM log files.
- iii. Additional information on installing the CSM software is also available in Chapter 6 ("Installation") of the [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers \(SA38-0646-00\)](#).

## b. Apply RSCT and CSM Updates to CSM MS

Apply the RSCT and CSM PTF update images for AIX on the CSM Management Server.

RSCT PTF Download Information - refer to Component Update/Download Information for RSCT

CSM PTF Download Information - refer to Component Update/Download Information for CSM

## Level Check:

- o `lslpp -L csm.client csm.core csm.diagnostics csm.dsh csm.gui.dcem csm.gui.websm csm.server csm.hams`
- o `lslpp -L rsct.core.sensorrm rsct.core.utils rsct.exp.cimrm rsct.basic.rte rsct.core.lprm rsct.core.rmc rsct.core.sec rsct.basic.hacmp rsct.core.auditrm`

Define the nodes/LPARs in the cluster

To define the nodes/LPARS in the cluster, review the following:

- Refer to Chapter 6, "Software Installation", Set up the CSM cluster' in the [HPS Planning Guide](#)
- For detailed information about setting up the CSM cluster, refer to Chapter 8 of: [Cluster System Management \(CSM\) Library](#)
- CSM for AIX 5L Planning and Installation Guide

Assign IP Addresses for SNIs

"Step 5: Assign IP Addresses for SNIs" of the "Software Installation" section in Chapter 6 ("Installation") of the [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers \(SA38-0646-00\)](#) cannot be implemented at this stage of the installation sequence due to a known problem with NIM whereby the defaults used by NIM for the number and size of technical large pages are not big enough to support the automatic configuration of more than one SNI as secondary adapters by NIM.

This step to assign IP Addresses to the SNIs will now be carried out after AIX is installed on the LPARs, the HPS/SNI updates are applied and large page support enabled on the nodes (see step 10c below).

Install AIX on all LPARs in the cluster

Refer to [pSeries HPS Planning, Installation and Service Guide](#) , Chapter 6, "Installation", Software Installation", "Install AIX on the nodes".

For the recommended service levels of AIX5L version 5.2 and AIX5L version 5.3 refer to the [Component Update/Download Information for AIX](#)

**Note:**

For the PE LP - DPCL is no longer a part of the IBM PE for AIX licensed program. Instead, DPCL is now available as an open source offering that supports PE. For more information and to download the DPCL open source project go to <http://oss.software.ibm.com/developerworks/opensource/dpcl>

This page should link to <http://sourceforge.net/projects/dpcl> where you can download the required code.

Because /var is a system data repository, system administrators should check periodically to maintain /var such that there is at least 30 Mb free [use 'df -k']. If /var is more than 75% full, use the command `du /var | sort -n` to find directories containing the most data.

Documentation Reference:

- For information on AIX installation, refer to [AIX 5L Version 5.2 Installation Guide and Reference \(SC23-4389-03\)](#)
- [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#)
- Chapter 12, "Installing the AIX operating system on the nodes", in [CSM for AIX5L Planning and Installation Guide](#) which also contains details on installing the AIX operating system on the LPARs.

AIX5L Maintenance Package Download Information

To download the package, complete the following steps:

1. Go to <http://www.ibm.com/servers/eserver/support/unixservers/aixfixes.html>
2. Select Maintenance Packages and choose AIX52 or AIX53
3. Specify your "Current level"
4. Specify "Desired level" and click "GO."
5. Follow instructions on this page.
6. Check AIX5L Critical Fixes.

Level check AIX by running the following command on the LPARs:

- `oslevel -r`
- `lspp -L bos.mp`

Refer to [Component Update/Download Information for AIX](#).

**Note:**

If filesets "csm.hpsnm" and "csm.server" are packaged with AIX5L, they should NOT be installed on the LPARs in the cluster.

Apply HPS/SNI Updates to all LPARs

Note that a filter installing AIX on the LPARs, only the HPS and SNI base level images are on LPARs in the cluster.

Download and apply the HPS/SNI PTF update referenced in the ["Detailed LP Check" for AIX5L 5.2 or AIX5L 5.3](#).

Level Check:

- `lspp -Lc | egrep "HPS|sni" | cut -d : -f 2,3 | sed 's:/ /'`
- `dsh "lspp -Lc | egrep "HPS|sni" | cut -d : -f 2,3 | sed 's:/ /' "|dshbak|more`

[Expected Levels are provided in Table 2](#) " HPS/SNI Detailed LP Level Check"

**Notes:**

- i. Notes on using TLP (Large Page) Settings in High Performance Computing (HPC) environment:
  - It is strongly recommended that users familiarize themselves with TLP basics and configuration options available.
  - The High Performance Switch adapter requires TLP usage and these TLP requirements are documented.
  - A formula to calculate the required TLP is outlined below.
  - You should also consult the section on the Large Page feature on AIX in [AIX 5L Version 5.2 Performance Management Guide](#)  
OR  
[AIX 5L Version 5.3 Performance Management Guide](#)
  - Users need to be aware of the usage of the LoadLevelerR pre-emption features with TLP (Large Pages) - specifically the fact that jobs that are using TLP that are pre-empted will essentially "lock up" the real memory the TLP's use, which is pinned by AIX. Unwise use of TLPs with LoadLeveler pre-emption can result in exhausting real memory available for jobs. If one wants LoadLeveler to schedule jobs based on the availability of large page, (especially if the job is going to run in mandatory Large Page mode) he/she may consider

making use of the LoadLeveler consumable resource feature. The consumable resource function, which has already been around for several years, is documented in the LoadLeveler manual.

ii. Notes on tuning Virtual Memory(VMM) Settings in an HPC environment:

Customers should be advised that the AIX VMM parameters (set by the vmo command) minfree and maxfree will most likely have to be adjusted (increased) in an HPC environment based on your cluster size, the amount of system memory, and number of processors per CEC. These settings when tuned properly will ensure enough memory remains available for core cluster infrastructure applications (RSCT, GPFS, LoadL). The recommended initial value for these tunables are minfree = 10000 and maxfree = 12000. Users are strongly urged to consult the following AIX documentation on virtual memory and vmstat tools and tune their system accordingly:

- [http://publib16.boulder.ibm.com/doc\\_link/en\\_US/a\\_doc\\_lib/aixbman/prftungd/memperf.htm](http://publib16.boulder.ibm.com/doc_link/en_US/a_doc_lib/aixbman/prftungd/memperf.htm)
- [http://publib16.boulder.ibm.com/doc\\_link/en\\_US/a\\_doc\\_lib/aixbman/prftungd/memperf1.htm#i50853](http://publib16.boulder.ibm.com/doc_link/en_US/a_doc_lib/aixbman/prftungd/memperf1.htm#i50853) The [AIX 5L Version 5.2 Performance Management Guide](#) should also be consulted.

Tuning these settings have been shown to help users avoid conditions where core cluster applications shut down and restart due to extensive blockage caused by "out of memory" issues. Keep in mind that all cluster applications should be designed and cluster tuned accordingly as to avoid oversubscribing to the real memory available.

After successful update of HPS/SNI filesets to the latest level, 64 bit kernel and technical large page support option must be enabled.

Set up your LPARs with 64-bit kernel

- i. Check which kernel is currently in use: bootinfo -K a response of "32" is a 32bit Kernel
- ii. In -fs /usr/lib/boot/unix\_64 /unix
- iii. In -fs /usr/lib/boot/unix\_64 /usr/lib/boot/unix
- iv. Determine which rootvg hdisk contains the boot logical volume (usually hd5). This hdisk will be your "ipldevice".
  - lspv |grep rootvg
    - hdisk0 009b982332a1f9b8 rootvg active
    - hdisk1 009b982332a2321a rootvg active
  - lspv -l hdisk0 |grep hd5
    - hd5 1 1 01.00.00.00 N/A (hdisk0 is your ipldevice)
- v. Issue: bosboot -ad /dev/<ipldevice> (eg. bosboot -ad /dev/hdisk0)
- vi. Reboot: shutdown -Fr
- vii. Verify 64 bit kernel is running after reboot: bootinfo -K 64

Set up Large Page Option

For configuration details see Large Page Support in [AIX 5L 5.2 Performance Management Guide](#) or

### [AIX 5L 5.3 Performance Management Guide](#)

The number of TLP depends on customer configuration and relates to the number of windows required for each adapter(sni) plus any Large Pages used by other applications. Set up Large Page Option using the vmo command for each LPAR:

vmo -r -o v\_pinshm=1 -o lgpg\_size=16777216 -o lgpg\_regions=YYY

where YYY is the amount of Technical Large Pages to export.

**Note:** you can use /usr/sni/aix5?/debugtools/sni\_calc\_lgpg\_cnt to calculate the minimum number of TLP's.

### Example:

On an LPAR with 2 sni's :

```

/usr/sni/aix5?/debugtools/sni_calc_lgpg_cnt
number_of_sni = 2
num_windows = 16
total_num_windows = 23
spool_size = 0x2000000
rpool_size = 0x2000000
Total required LPs == 0x39 [57]

```

You can also use `sni_calc_lgpg_cnt` to calculate TLP for a number of different vars.

### Example:

```

/usr/sni/aix5?/debugtools/sni_calc_lgpg_cnt -a 8
number_of_sni = 8
num_windows = 16
total_num_windows = 23
spool_size = 0x2000000
rpool_size = 0x2000000
Total required LPs == 0xd5 [213]

```

### Example:

To setup a node with 8 sni adapters:

```

16MB Large Page: lgpg_size = 16777216
256 Large Pages: lgpg_regions = 256
dsh <nodelist> "echo y|vmo -r -o v_pinshm=1 -o
lgpg_size=16777216 -o lgpg_regions=256"

```

(Use `, echo y|vmo` because otherwise `vmo` will prompt for verification to run `bosboot`) Would generate this response:

```

Setting v_pinshm to 1 in nextboot file
Setting lgpg_size to 16777216 in nextboot file
Setting lgpg_regions to 256 in nextboot file
Warning: some changes will take effect only after a bosboot and a reboot
Run bosboot now?
bosboot: Boot image is 19624 512 byte blocks.
Warning: changes will take effect only at next reboot

```

### Note:

The `vmtune` sample program is being phased out and is not supported in future releases. It is replaced with the `vmo` command (for all the pure VMM parameters) and the `ioo` command (for all the I/O related parameters) which can be used to set most of the parameters that were previously set by `vmtune`. The `-v` flag has been added to `vmstat` to replace the `-A` flag which display counter values instead of tuning parameters. For AIX 5.2, a compatibility script calling `vmo` and `ioo` is provided to help the transition.

To Check that Large Page Option is set:

```
vmo -a|grep lg
```

```

lgpg_size = 16777216
lgpg_regions = YYY <where YYY is the amount of Technical Large Pages to export
soft_min_lgpgs_vmpool = 0

```

Reboot LPARs. The LPARs should be rebooted as soon as possible to properly integrate the changes and to avoid disruption of current functionality.

## Using memory by Remote Direct Memory Access (RDMA) and TLP

The following items outline information on using memory by RDMA and TLP:

- o Real memory is divided into two categories - Small Pages and Large pages.
- o It is the user's responsibility to achieve an optimal balance between the the two categories based on the expected and/or experienced needs of both SNI adapters memory requirements expressed in TLP and applications use of Small Pages as expressed in RDMA.
- o TLP can allocate up to 75% of real memory.
- o RDMA can pin and map up to 75% of small page application memory.
- o Total Real Memory is a function of  $N(\text{bytes of real mem}) = T(\text{bytes of real mem allocated to TLP}) + S(\text{bytes of real mem allocated to Small Pages})$
- o Small Page memory is a function of  $S(\text{bytes of real mem allocated to Small Pages}) = N(\text{bytes of real mem}) - T(\text{bytes of real mem allocated to TLP})$
- o Large Page memory is a function of  $T(\text{bytes of real mem allocated to TLP}) = N(\text{bytes of real mem}) - S(\text{bytes of real mem allocated to Small Pages})$
- o The amount of small page memory can be calculated as follows:
  - `lsattr -E -l sys0 -a realmem` returns the number of kbytes real memory, call this number A.
  - `vmo -o lgpg_regions` returns the number of large pages, call this number B.
  - Then  $A * 1024 - B * 16 * 1024 * 1024$  is the amount of small page memory in bytes.

For example:

```

#!/bin/ksh
real_mem=`lsattr -E -l sys0 -a realmem|awk '{print $2}'`
lgpg_regions=`vmo -o lgpg_regions|awk '{print $3}'`
A=$(( real_mem * 1024 ))
B=$(( lgpg_regions * 16*1024*1024 ))
print "Real Mem=$A, TLP=$B; Small pages=$((A - B))"

```

Real Mem=32212254720, TLP=4294967296; Small pages=27917287424

- o The `rdma_xlat_limit` will limit the amount of memory that a user application can pin and map for use with RDMA.
- o This pinning and mapping only survives as long as the job is executing. After it exits the memory is unpinning and freed.

## Assign IP addresses to all adapter Switch Network Interfaces (SNIs)

Refer to [pSeries \(HPS\) Planning, Installation and Service Guide](#), Chapter 6, "Installation", "Assign IP addresses for SNIs" in the "Software Installation" section in of the for more details.

**Note:** The IP addresses and netmask are assigned to the SNIs using the `chdev` command.



Examples of the *chdev* command:

- o `chdev -l sn0 -a netaddr=192.168.0.3 -a netmask=255.255.255.0 -a state=up`
- o `chdev -l sn1 -a netaddr=192.168.1.3 -a netmask=255.255.255.0 -a state=up`
- o `chdev -l ml0 -a netaddr=10.10.10.3 -a netmask=255.255.255.0 -a state=up`

## Dynamic Host Configuration Protocol (DHCP)

- a. Disable Dynamic Host Configuration Protocol (DHCP) on the HMC and reboot the HMC.
- b. Configure DHCP on CSM Management Server so that the lease time never expires. Details available in Chapter 7 ("Using Cluster-Ready Hardware Server (CRHS)") of the [CSM for AIX5L Administration Guide](#)
- c. Configure Cluster Ready Hardware Server (CRHS) software on the CSM Management Server. Detailed instructions to configure CRHS on the CSM Management Server is available in Chapter 7 ("Using Cluster-Ready Hardware Server (CRHS)") of the [CSM for AIX5L Administration Guide](#).

## Preliminary Notes:

The Secure Sockets Layer (SSL) RPM is a prerequisite for Secure Shell (SSH) which is required for the CRHS support.

## Download Information:

- Download the SSL RPM from <http://www.ibm.com/link/oss.software.ibm.com/redirect.shtml/projects/openssh>. The current version of SSL at the time of CSM 1.4.1 publication is `openssl-0.9.7d-2.aix5.1.ppc.rpm`.
- Download `openssh-3.8.1-p1_52.tar.gz` from <http://www.ibm.com/link/oss.software.ibm.com/redirect.shtml/projects/openssh> and open the SSH tarball. The SSH tarball should include the following files:
  - o `openssh.base.client 3.8.0.5200 COMMITTED Open Secure Shell Commands`
  - o `openssh.base.server 3.8.0.5200 COMMITTED Open Secure Shell Server`
  - o `openssh.license 3.8.0.5200 COMMITTED Open Secure Shell License`
  - o `openssh.man.en_US 3.8.0.5200 COMMITTED Open Secure Shell`
  - o `openssh.msg.en_US 3.8.0.5200 COMMITTED Open Secure Shell Messages`
  - o `openssh.base.client 3.8.0.5200 COMMITTED Open Secure Shell Commands`
  - o `openssh.base.server 3.8.0.5200 COMMITTED Open Secure Shell Server`

Use the following documentation references:

- An overview of the CRHS setup is available in Chapter 4 ("System management components"), sub-section titled "Cluster-Ready Hardware Server concepts" of the [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#).
- Detailed instructions to configure CRHS on the CSM Management Server is available in Chapter 7 ("Using Cluster-Ready Hardware Server (CRHS)") of the [CSM for AIX5L Administration Guide](#).
- [CSM for AIX5L Planning and Installation Guide](#)
- [CSM download info \(select 'view'\)](#)

## Level check

Verify the levels of RSCT and CSM on the CSM Management server:

- `lspp -L csm.client csm.core csm.diagnostics csm.dsh csm.gui.dcem csm.gui.websm csm.server csm.hams`

- [AIX52 / AIX53 CSM Level check](#)
- `lspp -L rsct.core.sensorm rsct.core.utils rsct.exp.cimrm rsct.basic.rte rsct.core.lprm rsct.core.rmc rsct.core.sec rsct.basic.hacmp rsct.core.auditrm`
  - [AIX52 RSCT level check](#)
  - [AIX53 RSCT level check](#)

## Notes:

- a. Please see the following CSM webpage for packages and known issues  
<http://www14.software.ibm.com/webapp/set2/sas/f/csm/download/home.html>
- b. The CSM Management Server should have the right levels of RSCT and CSM PTFs after successfully completing Steps 6a & 6b above in order to configure CRHS.
- c. From the [CSM FAQs](#):
  - How should the service network be configured on the HMC as part of the Cluster Ready Hardware Server setup after the DHCP server migration to the CSM Management Server?
  - The service network interface on the HMC must be configured as "static" to prevent the DNS nameserver in the `/etc/resolv.conf` file from getting modified during an HMC update. Use the following steps on the HMC to enable a static service network on the HMC:
    - i. On the HMC GUI, in the "HMC Management" panel, select the "HMC Configuration" option.
    - ii. Select the "Customize Network Settings" option.
    - iii. Under the "LAN Adapters" tab, select the service network interface for your HMC, example, "Ethernet eth0" and click on "Details"
    - iv. Under the "LAN Adapter" tab, in the "Local Area Network Information sub-section, select the "open" option.
    - v. In the "DHCP Client/IP Address" sub-section, select the "Specify an IP address" option and enter the TCP/IP interface address and network mask of the service network.
    - vi. Click *OK*.
    - vii. The HMC will have to be rebooted in order for the changes to be in effect.

## Power off CECs

Ensure all CECs in the cluster are in the powered off state before proceeding.

## Configure the High Performance Switch Network Manager (HPSNM)

Configure the High Performance Switch Network Manager (HPSNM) software, bring the network online and report installation complete.

- i. Install the `HPSNM_Serv_Pack.zip` on the HMC and apply the `csm.hpsnm` PTF fileset to the CSM MS.
- ii. Bring the network online and report installation complete using the instructions in the "Bringing the network online and reporting Installation Complete" section, in Chapter 6 ("Installation") of the [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#).

## Download Information:

For the HMC:

Install the HPSNM Service Pack package from the HPSNM/IBMNM fixes tab of the appropriate HMC Level as indicated by the System Firmware shown in the "[Component Update/Download Information Section](#)" for HPSNM:

- [230](#)

- [235](#)
- [240](#)

For the CSM MS:

Download and Install csm.hpsnm AIX PTF as indicated by the "[Component Update/Download Information Section](#)" in the HPSNM section.

CSM Packages for AIX and Linux are available at:

<https://www14.software.ibm.com/webapp/set2/sas/f/csm/download/home.html>

Installation Instructions:

Installation on the HMC:

- The HPSNM\_Serv\_Pack\_<n>.zip is installed on all HMCs in the cluster, and each HMC should be rebooted.
- Install the zip file on all HMCs from the HMC GUI using the following options:
  - Licensed Internal Code Maintenance -> HMC Code Update -> Install Corrective Service
- Select the appropriate install method:
  - Apply corrective service from removable media if HPSNM\_Serv\_Pack\_2.zip was downloaded to a removable media
- OR
  - download the corrective service file from a remote system, and then apply the downloaded service file if the zip file was downloaded to a remote system.
- Reboot all HMCs with the HPSNM Service Pack installed.

Installation on the CSM Management Server (CSM MS):

- The csm.hpsnm base fileset is installed on the CSM Management Server as part of the CSM MS installation with AIX5L Maintenance package (Use the "Automatically increase filesystems" option when doing this installation).
- Apply the csm.hpsnm PTF fileset on the CSM MS.

NOTE: In order to accommodate the HPSNM log files, /var on the CSM Management Server should be increased to 1 Gigabyte.

More Configuration:

- ELA Master Selection. This is needed for tracelogd.
- /opt/csm/hpsnm/bin/chswelamast -q # Used to query the ELA Master and Backup HMCs
- /opt/csm/hpsnm/bin/chswelamast -m <hostname or IP address> [-b <hostname or IP address>] # Used to set the ELA Master and Backup HMCs.

Switch Topology Selection:

- /opt/csm/hpsnm/bin/chswlogtop -n1 <n1's\_topology> -n2 <n2's\_topology> # This should be done for each network.
- /opt/csm/hpsnm/bin/chswlogtop -h Shows syntax, including supported topologies.
- /opt/csm/hpsnm/bin/chswlogtop -n <network\_number> none To clear a network topology.

Activation and Verification:

- o Verify that all switch frames are powered.
- o Verify that all CECs are powered off.
- o Complete the procedure to bring the network online and report installation complete, otherwise known as, Service code 20 in the US. Refer to the section titled, "Bringing the network online and reporting Installation Complete" in Chapter 6 ("Installation") of the [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers \(SA38-0646-00\)](#) for complete details.
- o Examine switch link status by running the following command: `/opt/csm/hpsnm/bin/lsswtopol {-n network}`
- o Examine endpoint link status by running the following command: `/opt/csm/hpsnm/bin/lsswendpt`

Looking for Events:

On the ELA Master HMC GUI, select the following options to view the reported events/errors: Service Applications --> Service Focal Point --> Manage Serviceable Events

Collecting Data:

In case you need to report a problem, run `/opt/csm/hpsnm/bin/fnm.snap` to generate a snap. Look for core dumps in `/var/opt/csm/hpsnm/log/`

Documentation Reference:

- o [pSeries High Performance Switch \(HPS\) Planning, Installation and Service Guide for IBM eServer p5 servers](#) .

Level Check:

On the CSM MS, do either one of the following:

- o Use `lspp -L csm.hpsnm` to verify csm.hpsnm successfully installed. See CSM in the HPSNM component
- b. Create a service login ID on the CSM Management Server.

For instructions on creating a service login ID, refer to "Step 21: Create hardware service representative login ID" in Chapter 5 ("Installing the management server on AIX") of the [CSM for AIX5L V1.4.1 Planning and Installation Guide](#).

**Note:**

The service login ID, with the appropriate permissions, is necessary for the IBM Service Representative to access service-related HPSNM functions on the CSM Management Server without requiring root authority.

## IBM HPS POWER5 Readme - Service Pack 14 Addendum #1

[Introduction](#)[AIX LP](#)[Supporting documentation](#)[Known problems and workarounds](#)[Component updates/Download information](#)[Fix list](#)[Installation sequence](#)[Readme archive](#)

## AIX Licensed Program (LP)

The LP fileset fix levels listed in the [Detailed LP Level Check](#) table below indicate the latest available levels at the time this HPS Service Pack was released. The published LP fix levels in the table below are intended to be the minimum levels for this Service Pack, unless explicitly stated otherwise. They are available from [pSeries support fixes](#).

To order the latest filesets for all LP components of this HPS Service Pack, click the APAR link for your Version of AIX:

**AIX 5.3:** [APAR IZ01094](#)

**AIX 5.2:** [APAR IZ01094](#)

As a convenience, the table contains an "order the latest" APAR number for each of the LPs.

Clicking on the LP Component link will open a new page on the 'pSeries support fixes' website. There you will be presented with an opportunity to get the latest available fixes for that component.

Alternatively, clicking on the 'Order All the Latest' link will open a new page on the 'pSeries support fixes' website. There you will be presented with an opportunity to get all the latest available fixes for this Service Pack.

Please be aware of the "Replace superseded fixes with the latest" packaging option. If you choose to get the exact levels as stated in this Service Pack, you must uncheck the option before proceeding to download .

The selected APAR package will contain fix levels that are the same or higher than the levels listed below.

To check the LP service levels, on each logical partition issue:

```
lslpp -Lc | egrep "vsd|LAPI|HPS|sni|ppe|LoadL|mmfs|rsct|csm|essl|pessl" | cut -d : -f 2,3 | sed 's:// /'
```

LP	AIX 5.3	AIX 5.2
VSD	4.1.0	4.1.0
LAPI	2.4.4	2.3.3
HPS/SNI (CSS)	1.2.0	1.1.3
PE	4.3.1	4.2.2
LoadLeveler	3.4.1	3.3.2
GPFS	3.1.0	2.3.0
CSM	1.6.0	1.5.1
RSCT	2.4.7	2.3.11

ESSL	4.2.0	4.2.0
Parallel ESSL	3.3.0	3.2.0

## Detailed LP Level Check

Depending on the LP's that are installed, your output should match the LP fileset levels listed in the Detailed LP Level Check table. Use the following Detailed LP Level Check table to order the latest APARs that are available from [pSeries support fixes](#).

LP	Release	Component ID	APAR	Level check
<a href="#">VSD</a>	4.1.0	5765G2602	IZ00329	rsct.vsd.cmds 4.1.0.18 rsct.vsd.rvsd 4.1.0.15 rsct.vsd.vsdd 4.1.0.20 rsct.vsd.vsdrm 4.1.0.7
<a href="#">LAPI</a> AIX52 only	2.3.3	5765G2601	IZ01009	rsct.lapi.nam 2.3.3.3 rsct.lapi.rte 2.3.3.8 rsct.lapi.samp 2.3.3.0
<a href="#">LAPI</a> AIX53 only	2.4.4	5765G2601	IZ00331	rsct.lapi.nam 2.4.4.0 rsct.lapi.rte 2.4.4.1 rsct.lapi.samp 2.4.4.0
<a href="#">HPS/SNI</a> <a href="#">(devices)</a> AIX52 only	1.1.3	5765G2400	IZ00332	devices.chrp.IBM.HPS.hpsfu 1.1.3.0 devices.chrp.IBM.HPS.rte 1.1.3.12 devices.common.IBM.sni.ml 1.1.3.2 devices.common.IBM.sni.ntbl 1.1.3.0 devices.common.IBM.sni.rte 1.1.3.10 devices.msg.en_US.chrp.IBM.HPS.hpsfu 1.1.3.0 devices.msg.en_US.chrp.IBM.HPS.rte 1.1.3.1 devices.msg.en_US.common.IBM.sni.ml 1.1.3.1 devices.msg.en_US.common.IBM.sni.ntbl 1.1.3.1 devices.msg.en_US.common.IBM.sni.rte 1.1.3.0
<a href="#">HPS/SNI</a> <a href="#">(devices)</a> AIX53 only	1.2.0	5765G2400	IZ00333	devices.chrp.IBM.HPS.rte 1.2.0.8 devices.common.IBM.sni.ml 1.2.0.2 devices.common.IBM.sni.ntbl 1.2.0.0 devices.common.IBM.sni.rte 1.2.0.8 devices.msg.en_US.chrp.IBM.HPS.rte 1.2.0.2 devices.msg.en_US.common.IBM.sni.ml 1.2.0.0 devices.msg.en_US.common.IBM.sni.ntbl 1.2.0.1
<a href="#">PE</a>	4.2.2	5765F8300	IZ00334	ppe.man 4.2.2.2 ppe.perf 4.2.2.3 ppe.poe 4.2.2.11 ppe.pvt 4.2.2.0
<a href="#">PE</a>	4.3.1	5765F8300	IZ00825	ppe.man 4.3.1.1 ppe.perf 4.3.1.1 ppe.poe 4.3.1.2 ppe.pvt 4.3.1.1

<a href="#">LoadLeveler</a>	3.3.2	5765E6900	IZ00336	LoadL.full 3.3.2.11 LoadL.msg.En_US 3.3.2.5 LoadL.msg.en_US 3.3.2.5 LoadL.so 3.3.2.11
AIX53 only				
<a href="#">LoadLeveler</a>	3.4.1	5765E6900	IZ00827	LoadL.full 3.4.1.1 LoadL.msg.en_US 3.4.1.1 LoadL.so 3.4.1.1 LoadL.webui 3.4.1.1
<a href="#">GPFS</a>	2.3.0	5765F64AP	IZ00338	gpfs.base 2.3.0.22 gpfs.docs.data 2.3.0.8 gpfs.msg.en_US 2.3.0.14
<a href="#">GPFS</a>	3.1.0	5765G66P	IZ01012	gpfs.base 3.1.0.12 gpfs.docs.data 3.1.0.5 gpfs.msg.en_US 3.1.0.10
<a href="#">CSM</a>	1.5.1	5765F6700	IZ00341	csm.server 1.5.1.3 csm.bluegene 1.5.1.1 csm.client 1.5.1.3 csm.core 1.5.1.4 csm.deploy 1.5.1.4 csm.diagnostics 1.5.1.0 csm.dsh 1.5.1.6 csm.essl 1.5.1.0 csm.gpfs 1.5.1.0 csm.gui.dcem 1.5.1.0 csm.gui.websm 1.5.1.0 csm.hams 1.5.1.1 csm.hpsnm 1.4.1.17 csm.ll 1.5.1.0 csm.pe 1.5.1.0 csm.pessl 1.5.1.0 csm.server 1.5.1.6

**RPMS:**

```

expect 5.32-1
openCIMOM 0.8-1
openssl 0.9.7d-2
AIX-rpm 5.2.0.40-1
tcl 8.3.3-1
tk 8.3.3-1
conserver 8.1.7-2

```

[CSM](#)      1.6.0    5765F6700    IZ00342

```

csm.bluegene 1.6.0.10
csm.client 1.6.0.10
csm.core 1.6.0.11
csm.deploy 1.6.0.11
csm.diagnostics 1.6.0.10
csm.dsh 1.6.0.10
csm.essl 1.6.0.10
csm.gpfs 1.6.0.10
csm.gui.dcem 1.6.0.10
csm.gui.websm 1.6.0.10
csm.hams 1.6.0.10
csm.hc_utils 1.6.0.10
csm.ivm.server 1.6.0.10
csm.ll 1.6.0.10
csm.pe 1.6.0.10
csm.pessl 1.6.0.10
csm.server 1.6.0.11

```

**RPMS:**

```

expect 5.32-1
openCIMOM 0.8-1
openssl 0.9.7d-2
AIX-rpm 5.2.0.40-1
tcl 8.3.3-1
tk 8.3.3-1
conserver 8.1.7-2

```

[RSCT](#)      2.3.11    5765F07AP    IZ00344

AIX52 only

```

rsct.core.utils 2.3.11.0
rsct.compat.basic.sp 2.3.11.0
rsct.opt.storagerm 2.3.11.0
rsct.core.hostrm 2.3.11.0
rsct.basic.hacmp 2.3.11.0
rsct.compat.basic.hacmp 2.3.11.0
rsct.opt.saf.amf 2.3.11.0
rsct.compat.basic.rte 2.3.11.0
rsct.core.errm 2.3.11.0
rsct.core.rmc 2.3.11.0
rsct.core.sr 2.3.11.0
rsct.core.gui 2.3.11.0
rsct.core.sec 2.3.11.0
rsct.core.lprm 2.3.11.0
rsct.compat.clients.hacmp 2.3.11.0
rsct.compat.clients.rte 2.3.11.0
rsct.basic.rte 2.3.11.0
rsct.core.fsrms 2.3.11.0
rsct.core.sensorrm 2.3.11.0
rsct.basic.sp 2.3.11.0

```



				rsct.compat.clients.sp 2.3.11.0
				rsct.core.auditrm 2.3.11.0
<a href="#">RSCT</a>	2.4.7	5765F07AP	IZ00345	devices.chrp.base.ServiceRM 1.3.0.61
AIX53 only				rsct.core.utils 2.4.7.1
				rsct.compat.basic.sp 2.4.7.0
				rsct.opt.storagerm 2.4.7.1
				rsct.core.hostrm 2.4.7.0
				rsct.basic.hacmp 2.4.7.1
				rsct.compat.basic.hacmp 2.4.7.0
				rsct.opt.saf.amf 2.4.7.0
				rsct.compat.basic.rte 2.4.7.0
				rsct.core.errm 2.4.7.0
				rsct.core.rmc 2.4.7.1
				rsct.core.sr 2.4.7.0
				rsct.core.gui 2.4.7.0
				rsct.core.sec 2.4.7.0
				rsct.core.lprm 2.4.7.0
				rsct.compat.clients.hacmp 2.4.7.0
				rsct.compat.clients.rte 2.4.7.0
				rsct.basic.rte 2.4.7.1
				rsct.core.fsrn 2.4.7.1
				rsct.core.sensorrm 2.4.7.0
				rsct.basic.sp 2.4.7.0
				rsct.compat.clients.sp 2.4.7.0
				rsct.core.auditrm 2.4.7.0
<a href="#">Parallel</a>	3.2.0	5765F8400	PK21664	pessl.rte.common 3.2.0.1
<a href="#">ESSL</a>				pessl.rte.hv 3.2.0.1
				pessl.rte.rs1 3.2.0.1
				pessl.rte.smp 3.2.0.1
				pessl.man.en_US 3.2.0.1
				pessl.rte.mp 3.2.0.0
				pessl.rte.rs2 3.2.0.0
				pessl.rte.up 3.2.0.0
				pessl.loc.license 3.2.0.0
Parallel	3.3.0	5765F8400		pessl.rte.common 3.3.0.0
ESSL				pessl.rte.hv 3.3.0.0
AIX53 only				pessl.rte.rs1 3.3.0.0
				pessl.rte.smp 3.3.0.0
				pessl.man.en_US 3.3.0.0
				pessl.rte.mp 3.3.0.0
				pessl.rte.rs2 3.3.0.0
				pessl.rte.up 3.3.0.0
				pessl.loc.license 3.3.0.0

ESSL	420	5765F8200	essl.rte.common	4.2.0.5
			essl.rte.rs1	4.2.0.5
			essl.rte.rs2	4.2.0.0
		AIX 5.3	essl.rte.smp	4.2.0.5
		<a href="#">PK20638</a>	essl.rte.mp	4.2.0.0
		AIX 5.2	essl.rte.up	4.2.0.0
		<a href="#">PK20638</a>	essl.man.en_US	4.2.0.0
			essl.loc.license	4.2.0.0
			essl.msg.en_US	4.2.0.1
			essl.msg.En_US	4.2.0.1

## IBM HPS POWER5 Readme - Service Pack 14 Addendum #1

---

[Introduction](#)

[Supporting documentation](#)

[Component updates/Download information](#)

[Installation sequence](#)

[AIX LP](#)

[Known problems and workarounds](#)

[Fix list](#)

[Readme archive](#)

### Restrictions/Known Problems/Workarounds

This pSeries HPS POWER5 release does not support concurrent firmware installation in an operational HPS POWER5 cluster pending further testing of this function.

The use of High Availability Management Server is restricted with this release pending further testing.

Customers who upgrade to this pSeries HPS POWER5 Service Pack and try to enable the redundant FSP feature with invalid Klingon configurations may result in ambiguous to troublesome errors.

Upon application of csm.hpsnm APAR IY88538 (available as of csm.hpsnm 1.4.1.16, included in p5 HPS SP11), customers can safely reenable the High Performance Switch (HPS) Time Of Day (TOD) support. In a previous service bulletin/flash, HPSNM Development recommended that customers disable this support by adding the following to `"/etc/environment "` on the Management Station:  
`"HPSNM_TOD_SUPPORT=off"`.

Customers that wish to reenable HPS TOD support should apply IY88538, remove the environment variable from `"/etc/environment"` and restart HPSNM. For customers that have not disabled the HPS TOD support, no action is required following the application of IY88538, but be aware there will be a momentary interruption of the TOD on the first restart (only) of HPSNM. This could impact the POE co-scheduler, as well as applications that use the `MPI_WTIME` subroutine that reads the TOD.

---

### Retain Tip Abstracts

[Upgrading HMC version 5 and early version 6 to 6.1 causes Resource Manager failure](#)

[GPFS maintenance level coexistence restriction](#)

[Unpredictable results can occur with the GPFS subsystem](#)

[SF240\\_298 VIOS](#)

[LAPI hang](#)

[HPS/SNI Protocol stack requires all sni in all servers to be on the same network](#)

[When updating Licensed Internal Code, if the "High Performance Switches"](#)

[No support in Service Focal Point for collecting VPD for High Performance Switches](#)

[B1818600 error is posted from Perc](#)

[Service Focal Point \(SFP\) flags a switch board or riser with a bad BIST and/or bad Signature.](#)  
[The HPS Network Manager End-Point View and lsswendpt command show cage 16 as cage 0.](#)  
[VPD databases lost on the HMC](#)  
[When verifying switch chip ports, you should look for Down:No Signal.](#)  
[Diagnostic SRC D103B0FF in error logs](#)  
[Cluster Ready Hardware Server data may not be restored after an upgrade install of the HMC](#)

---

**Retain Tip Abstract:**

The following GPFS maintenance level coexistence restriction was announced in the [Q2.3](#) of the [GPFS FAQs](#):

V3.1 maintenance levels 10 (GPFS-3.1.0.10) thru 12 (GPFS-3.1.0.12) do not coexist with other maintenance levels.

All nodes in the cluster must conform to one of these maintenance level compatibility restrictions:

- All nodes must be at maintenance levels 1-9 or 13 and later (GPFS-3.1.0.1 thru GPFS-3.1.0.9 or GPFS-3.1.0.13 and later).
- All nodes must be at maintenance levels 10-12 (GPFS-3.1.0.10 - GPFS-3.1.0.12).

**Problem Description:**

In a multi-cluster installation, if some nodes are running pre-3.1.0.10 GPFS and some nodes running 3.1.0.10 or later, the token manager space was filling up because of inconsistent token state between client nodes and the TM server.

**Customer Impact:**

GPFS daemon assert Signal 11 in unlock\_shark

**Workaround:**

Obtain the following APAR from IBM Support, when available: GPFS 3.1 - IZ00112.

---

**Retain Tip Abstract:**

**Problem Description:**

The new AIX 5.3 TL06 (kernel filesets 5.3.0.60) has a change in the pthread scheduling that breaks GPFS synchronization.

**Customer Impact:**

Unpredictable results can occur with the GPFS subsystem due to problems with GPFS synchronization

mechanisms.

**Workaround:**

Contact GPFS customer support to request an efix, or obtain the following APAR fixes, when available:

- GPFS 2.3 - APAR IZ00619
- GPFS 3.1 - APAR IY99258

---

**Retain Tip Abstract:**

Upgrading the HMC from version 5 and early version 6 to version 6.1 or later causes Hardware Server Resource Manager on the HMC to fail.

**Problem Description:**

The Hardware Server Resource Manager on the HMC fails to start after the upgrade.

**Customer Impact:**

The HMC does not display the hardware configuration.

**Workaround:**

When upgrading to HMC version 6.1.2 (in p5 HPS SP13 service pack), you must also install HMC interim fix PTF MH00946 as indicated in the [Component Updates](#) and [Installation Notes](#) sections of this ReadMe. MH00946 will be picked up in a future HMC V6.x update package.

---

**Retain Tip Abstract:**

System firmware level SF240\_298 has been removed from the web due to a problem when running virtual I/O services (VIOS).

**Problem Description:**

If you are currently running with SF240\_298 and using VIOS on the system, Product Engineering recommends that you install SF240\_299 as soon as possible. The VIOS fix is the only change in SF240\_299 from SF240\_298. This service pack can be installed concurrently.

**Customer Impact:**

Problem when running virtual I/O services (VIOS).

**Workaround:**

Intall SF240\_299 that was released on April 5, 2007.

**Retain Tip Abstract:**

When a LAPI hang is reported that does not involve a timeout and the new LAPI\_Xfer types LAPI\_HW\_PUT or LAPI\_HW\_GET are used then it is possible that this problem has been reproduced. This problem is restricted to jobs running in user space mode using the HPS switch adapter.

**Problem Description:**

When a LAPI program uses the new LAPI interfaces for hardware get or put using the LAPI call LAPI\_Xfer with the LAPI\_HW\_PUT or LAPI\_HW\_GET type and request target notification, it is possible that the program will hang. It is unlikely that this problem will be hit on a system with all links known to be reliable since it depends on the last packet of an RDMA operation being only partially completed. This problem is restricted to jobs running in user space mode using the HPS switch adapter.

**Customer Impact:**

Customers starting development of new programs using this new LAPI interface may have the program suspend operation because RDMA message completion notification never arrives.

**Workaround:**

Download the following files

1SF235\_181\_160.rpm

01SF235\_181\_160.xml

---

**Retain Tip Abstract:**

HPS/SNI Protocol stack requires all sni of same number in all servers to be on the same network in dual-network HPS clusters.

Search Keys:

Miswire, Miscable, SNI, ping problem, intermittent packet, intermittent ping, packet loss

**Problem Description:**

If the corresponding SNIs in the servers are not on the same network, packets over the switch will intermittently fail. For example, if sni0 in server A is on network 1 and sni0 in server B is on network 2, you will have packets intermittently fail. There is no indication of this in the HPSNM GUI. Furthermore, if an SNI fails in such a way that it is not recognized by AIX, and it would not be the highest numbered sni in the configuration, all SNIs that would have followed it in the tree are now one less than they would have been previously. This causes the appearance of a miswire.

**Customer Impact:**

Performance degradation and potential application failure.

**Workaround:**

While performing the "Bringing the Network online" procedure in the HPS Planning, Install and Service Guide, the following steps should be performed just before running the host verification tools: If intermittent packet failure is observed after installation, use the following steps to:

A) Check for incorrectly cabled SNIs:

1. Go to the CSM MS and check the "/var/opt/csm/hpsnm/log/topology.map" file for: "There are X inconsistently cabled adapters". They are listed in HPSNM logical locations and indicate frame, cage and chip locations.
2. Record the locations of the inconsistently cabled adapters.
3. Open the HPSNM Endpoint View on the CSM MS GUI.
4. Look up the SNIs frame, cage and chip in the HPSNM and cross-reference to the physical location on the GUI panel.
5. Select this SNI link.
6. Click "Selected-Properties" on the menu
7. Note the network for this SNI.
8. Check the cabling instructions and recable as instructed:

- i) If the cable instructions indicate that this SNI is cabled correctly, the cable planning should be redone such that this SNI is placed on the same network as the corresponding SNIs in the other servers.
- ii) Keep in mind that it may be possible that the entire switch has been wired into the incorrect network. In such a case, all SNIs connected to this switch will be considered to be cabled inconsistently.

9. After making changes, you should check GUI status and SFP for errors that may have been caused by recabling.

B) Check for unconfigured SNIs:

1. If the "Bringing the Network Online" procedures indicated any SNIs that were not configured and visible by AIX, perform the following on those SNIs:
2. For each server that had unconfigured SNIs:
  - i) `mv /usr/sni/aix52/cfgsni /usr/sni/aix52/cfgsni.orig`
  - ii) Reboot server
  - iii) For each snix on the server: `rmdev -d -l snix`
  - iv) `mv /usr/sni/aix52/cfgsni.orig /usr/sni/aix52/cfgsni`
  - v) `cfgmgr -s`

C) To double-check for unconfigured SNIs causing others to be on the incorrect netid.  
(assumption: all discrepancies found in the topology.map were fixed)

1. Run the following command string on the CSM MS. This assumes that all LPARs are accessible via "dsh -av"  
(Be mindful of the placement of quotation marks).

```
for x = 0 1 2 3 4 5 6 7; do echo sni$x;
dsh -av "/usr/sni/aix52/debugtools/sni_qry -l sni$x | grep netid"
2>/dev/null | uniq -f 3;
done
```

2. There is a problem if more than one adapter is listed under each "sniX" heading. If this is the case, specific queries for the SNIs that may potentially be bad should be carried out.

3. With a knowledge of the correct network for sniX, run the following command on the CSM MS:

(be mindful of quotation marks and backslashes)

```
dsh -av '/usr/sni/aix52/debugtools/sni_qry sniX | grep "netid: [wrong network]"'
```

where you give the wrong network as the [wrong network] part of the grep.

For example, if sni0 should be network 1:

```
dsh -av "/usr/sni/aix52/debugtools/sni_qry sni0 | grep "netid: 2"'"
```

4. Now that you have the list of LPARs with problem adapters, you can recover on each LPAR:

- i) mv /usr/sni/aix52/cfgsni /usr/sni/aix52/cfgsni.orig
- ii) Reboot server.
- iii) For each snix on the server: rmdev -d -l sniX
- iv) mv /usr/sni/aix52/cfgsni.orig /usr/sni/aix52/cfgsni
- v) cfgmgr -s

---

### Retain Tip Abstract:

When updating Licensed Internal Code, if the "High Performance Switches" target is selected with one or more managed system targets, a java.lang.ArrayStoreException occurs immediately.

### Problem Description:

Licensed Internal Code update fails with a java.lang.ArrayStoreException when the "High Performance Switches" target is selected with one or more managed system target. A serviceable event with refcode



E302F9D2 will be recorded in Service Focal Point. Licensed Internal Code is not updated on any of the specified targets.

**Customer Impact:**

Licensed Internal Code cannot be updated simultaneously on managed system and "High Performance Switches" targets.

**Workaround:**

Update Licensed Internal Code for the "High Performances Switches" target separately from any other targets. Updating multiple managed system targets simultaneously continues to work correctly.

---

**Retain Tip Abstract:**

No support in Service Focal Point for collecting VPD for High Performance Switches

**Problem Description:** The Collect VPD Information function under the Service Focal Point component of the Hardware Management Console does not support the collection of vital product data for High Performance Switch clusters.

**Customer Impact:**

The customer will have to manually execute a command on the HMC to collect VPD for High Performance Switch cluster.

**Workaround:**

Execute the following command on the HMC:

```
/opt/hsc/bin/vpdfs -x cluster
```

The command will produce an xml file in the working directory named *7045-SW4-bycluster.xml*. This file contains the VPD for the switch cluster.

---

**Retain Tip Abstract:**

B1818600 error is posted from Perc.

**Problem Description:**

A B1818600 error is posted from Perc with a user section showing:

*Process name: netsSlp*

**Customer Impact:**

There is no impact to the customer or the equipment.

**Workaround:**

No workaround is required since this is a recoverable situation.

---

**Retain Tip Abstract:**

Service Focal Point (SFP) flags a switch board or riser with a bad BIST and/or bad Signature.

Search Keys: *Bad BIST, Bad Signature.*

**Problem Description:**

A bad BIST error for a switch board or a riser is logged by fnmd when the self test computes a value that does not match what fnmd is expecting. This may or may not lead to subsequent errors.

**Customer Impact:**

Most likely no impact. Wait for other error types before taking corrective action. Return FNM\_Init.log or an fnmd snap to IBM for analysis.

---

**Retain Tip Abstract:**

The HPS Network Manager End-Point View and lsswendpt command show cage 16 as cage 0.

**Problem Description:**

If a frame has adapters in cage 16, the HPS Network Manager End-Point View and lsswendpt command will show these adapters in cage 0.

**Customer Impact:**

Customer is presented incorrect information, but there is no loss of function.

**Workaround:**

None

---

**Retain Tip Abstract:**

VPD databases lost on the HMC

Search Keys:

Trace, Tracelogd, VPD, ELA

**Problem Description:**

This is a problem which FVT and MPV have both hit. What happens is the following:

1. Tracelogd on the CSM and on the HMC are both running.

2. Tracelogd on the CSM starts sending the VPD files and manages to get one or two across.
3. Tracelogd on the HMC dies and starts to come back up. (it takes 5 seconds before tracelogd fully comes up and re-connects with hardware server and can start receiving messages again)
4. Tracelogd on the CSM realizes that there's a problem sending the files and goes into an error loop.

Unfortunately, this error loop will time out before the 5 seconds are up and the rest of the VPD files will not get across. This could possibly leave either a database completely off the HMC or leave only half of one there.

**Customer Impact:**

A database could either only be copied halfway onto the HMC or left off completely. This means that ELA could possibly not have the MTMS information needed to let a IBM SSR know where a problem is located.

**Workaround:**

The workaround is to take a look at the databases on the HMC. If one of the three databases (sma\_vpd.db, chassis\_vpd.db and bpa\_vpd.db) is missing, copy it over from the CSM (you can use scp or ftp for example). CSM directory: /var/opt/csm/hpsnm/data HMC directory: /opt/hsc/data

---

**Retain Tip Abstract:**

When verifying switch chip ports, you should look for Down:No Signal.

Search Keys: No Signal, Down:No Signal

**Problem Description:**

Down:No signal indicates that a clock or a light-present signal is not seen on a port. This can mean that a switch link has no cable, or that the link is faulty. There is a missing check for this in the HPS Service Doc procedure,

Bringing the Network Online, Step 3: Verify the network, Task 1: verify SNI and switch chip ports, 1) verify switch ports, step 2.b

**Customer Impact:**

If the link is faulty, it will be un-useable and may degrade performance.

**Workaround:**

When executing the HPS Service Doc procedure: Bringing the Network Online

Step 3: Verify the network

Task 1: verify SNI and switch chip ports

1) verify switch ports, step 2.b

you should also filter on "No Signal". If you find one of these, go to the "Network Status Codes on

HPSNM" table in Appendix A, and follow the instructions for "Down:No Signal".

---

**Retain Tip Abstract:**

DiagnosticSRC D103B0FF in error logs

Search Keys:

D103B0FF Predictive Error

**Problem Description:**

An informational error was incorrectly categorized as a predictive failure

**Customer Impact:**

Unnecessary call for service action

**Workaround:**

Ignore the error. It is not a true software problem. The indication is that a program attempted to get information about the state of the hardware when the hardware was powered off

---

**Retain Tip Abstract:**

Cluster Ready Hardware Server data may not be restored after an upgrade install of the HMC resulting in loss of CEC and switch configuration on the HMC and from the CSM management server.

Search Keys:

Cluster Ready Hardware Server (CRHS), HPS, HMC

Systems Affected:

CECs, HMCs HPS switch configured to use Cluster Ready Hardware Server

**Problem Description:**

It has been observed in several instances of upgrading the HMC from 01SF230\_xxx\_120 to a later SP level or to 01SF235\_xxx\_160 that the RSCT data which contains the Cluster Ready Hardware Server configuration is not restored. This happened when the HMC system clock was adjusted as specified in the update process.

**Customer Impact:**

HMC and CEC Configuration may be lost. Customers will not see CEC configuration in the GUI although the CEC/LPARS should still be functioning prior to the install.

**Workaround:**

1. If root access is enabled to the HMC then the data can still be restored by the following:

- log in as root
- check if the directory `"/var/ct.backup"` exists with a timestamp of when the save data was performed.
- If it exists then - run the command

```
"/usr/sbin/rsct/bin/ctrestore"
```

- wait a few minutes for the ClusterPeerDomain to be restored and activated.
- verify that the Cluster Ready Hardware Server data has been restored: run the command

```
"lsrsrc IBM.hw_manager"
```

The output should show the HMCs in the cluster and the CSM\_MS object.

- If the directory does not exist then:
- mount `/mnt/upgrade`
- verify the `/mnt/upgrade/RSCTSaveUpgrade.tar` file exists.
- If the tar file exists then run:

```
tar -xvf /mnt/upgrade/RSCTSaveUpgrade.tar
```

- check if the directory `"/var/ct.backup"` exists.
- If it exists then run the command

```
"/usr/sbin/rsct/bin/ctrestore"
```

- wait a few minutes for the ClusterPeerDomain to be restored and activated.
- verify that the Cluster Ready Hardware Server data has been restored:

```
run the command "lsrsrc IBM.hw_manager"
```

The output should show the HMCs in the cluster and the CSM\_MS object.

2. If the above was not successful or if the customer does not have root access to the HMC then the Cluster Ready Hardware Server data must be recreated as it originally was using the `addpeer` command from the CSM management server. Plan to Resolve:  
Plan to fix in a subsequent Service Pack.

## IBM HPS POWER5 Readme - Service Pack 14 Addendum #1

---

[Introduction](#)

[Supporting documentation](#)

[Component updates/Download information](#)

[Installation sequence](#)

[AIX LP](#)

[Known problems and workarounds](#)

[Fix list](#)

[Readme archive](#)

---

IBM HPS POWER5 FLASH/Readme Archive

[IBM HPS POWER5 FLASH/Readme - Service Pack 14](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 13](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 12](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 11](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 10](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 9](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 8](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 7](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 6](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 5](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 4](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 3](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 2](#)

[IBM HPS POWER5 FLASH/Readme - Service Pack 1](#)

## IBM HPS POWER5 Readme - Service Pack 14 Addendum #1

---

[Introduction](#)

[Supporting documentation](#)

[Component updates/Download information](#)

[Installation sequence](#)

[AIX LP](#)

[Known problems and workarounds](#)

[Fix list](#)

[Readme archive](#)

---

### HPS Service Pack Abstract Fix List - By Component

[HMC](#)

[VSD](#)

[Parallel Environment](#)  [CSM](#)

[HPSSNM](#)

[LoadLeveler](#)

[RSCT](#)

[GFW](#)

[HPS/SNI \(Devices\)](#)

[GPFS](#)

#### GFW

Refer to the Global Firmware web site for specific details: <http://www14.software.ibm.com/webapp/set2/firmware/gjsn>

#### HMC

Refer to the HMC web site for specific details:

<http://www14.software.ibm.com/webapp/set2/sas/f/hmc/home.html>

#### HPSSNM

##### 1.1.0 (HMC component)

PA Framework hangs waiting for lsrsrc command to complete.

##### 1.4.1 (AIX Cluster Management Server Component)

Bad location codes passed to ELA

Reparents FNM GUI if CSM not installed

FIX FNM RETRY LOGIC

cut AIX errlog entry for TOD thread exit

FNM UTILITY: HPS\_CHECKROUTE.PL IS BROKEN FOR 256WAY TOPO

ERROR RETURN FROM SWJTAGWRITE() STOPS THAT SWITCHES INIT FLOW

rebuild TOD candidate list on Comm timeout/error

#### VSD

##### 4.1.0.x

RVSD hangs during low paging space

Enhance debug/data integrity code  
removevsd -fa failed to cleanup vgs on VSD primary server  
defvsd prints out extraneous info  
System Crash in CpyRd()  
vsd.snap needs additional info

## LAPI

### 2.4.4.1

Tune P6 copy routine  
lapi\_init RC605 and seg fault on sles IB cluster  
Linux: PE 431 & LAPI 244 Fix Level update

## HPS/SNI Devices

### 1.2.0.x

PATH table reader non-shipping tool.  
Performance degraed when 64k large pages are used.

### 1.1.3.x

Performance degraed when 64k large pages are used.

## Parallel Environment

### 4.2.2.11

MPI\_TYPE\_CREATE\_RESIZED IN 64 BITS CAN SEGFAULT  
Incorrect msg matching for short MPI\_Irecv from MPI\_ANY\_SOURCE

### 4.3.1.2

Ckpt jobs hang in mpi\_ckpt\_thread\_handler with PPE rfal release

### 4.3.1.1

SMT processor core affinity support phase 1



SMT processor core affinity support phase 2  
MPI\_TYPE\_CREATE\_RESIZED IN 64 BITS CAN SEGFAULT  
PE man pages contain garbled AIX & Linux paths  
Incorrect msg matching for short MPI\_Irecv from MPI\_ANY\_SOURCE  
PMB BENCHMARK PROBLEM WITH MPI  
Clean up MP\_TIMEOUT related code  
Linux: PE 431 & LAPI 244 Fix Level update  
Update README for PE 4.3.1 GA

## Loadleveler

### 3.3.2.11

RETROFIT THE LL\_RVEN DEFECT BACK TO LL\_RMER FOR DPRINTF  
LL ckpt 64bit job fails on both AIX52S and AIX53J (0709A)  
WALL CLOCK LIMIT CORRUPTED AFTER CM RECYCLE  
NEGOTIATOR HUNG  
LL: change the file system permission of socket files to 0700  
XLOADL CORE WITH CUSTOMER DEFINED CLUSTERCPUS RESOURCE  
Starter fails connect to unix socket when startd runs as root  
Level Bump Defect for sprelmer/ptf11

### 3.4.1.1

SMT processor core affinity support phase 2  
LINUX INHERITS ENVIRONMENT FROM RSHD/SSHD WHEN STARTING PMD  
Job stuck at P state when machine names are in mixed case  
LL\_GET\_DATA FOR THE LL\_STEPWALLCLOCKUSED, ALWAYS RETURNS 0  
IB4: LoadLever fail during initialization with IB adapters  
llchres contractions in -H help text  
llchres -F fopen only reads first argument in command list  
General parsing of integer keywords should not allow negatives  
job submission issues  
WebUI: ship with console=false  
XLOADL CORE WITH CUSTOMER DEFINED CLUSTERCPUS RESOURCE  
WebUI: add to tabbed panel job builder  
Periodic Lapi Init failures on c275 cluster causing test  
fix job categories, remove health monitoring states  
RSCT 2.4.6.2 REQUIRES LOADL TO MAKE CHANGES FOR RMCAPI CALLS.  
WebUI: Total number shows wrong number in job status panel  
WebUI: widget can be enveloped by enlarging size of characters  
LOADL\_NEGOTIATOR CORE DUMP FROM SERIALIZATION PROBLEM

SMT processor core affinity support phase 2  
unexpected adapter count  
Starter fails connect to unix socket when startd runs as root  
Submit a JCF without read permission executable cause core dump  
updates for mach graphics view to complete functionality inPTF1  
LINUX LOADL ADMIN FILE WITH ADAPTER\_STANZAS = SEGFA  
LOADLEVELER IS GENERATING A BAD DYNAMIC BLOCK.  
mcm\_affinity differences between ven and ven2  
Job not scheduling when ConsumableCpus available  
fix some bugs and improvements of job graphics view in PTF1  
FAIRSHARE PROB WITH LARGE VALUES FOR TOTAL\_SHARES & INTERVAL  
error info when "initialdir" without R permission to directory  
ptf1:mcm\_accumulate mcm\_sni\_req jobs not always schedul  
Level Bump Defect for sprelven2/ptf1  
WebUI: incomplete data in ResourcesElement  
Man page updates  
WebUI:Order of users is affected by the latest JobID  
WebUI: Number of jobs is missing when the space is not enough  
when 1 cpus\_per\_core used the other cpu not available  
WebUI:Info in Job Status Table is cut off in FireFox  
Two blanks with class drop-down List  
WebUI: inaccurate expression of "Select Action"  
WebUI: No warning message for command that not allowed  
WebUI: Button has no effect when page is enlarged in Firefox  
WebUI: Unclear description of protocol choice  
WebUI: Button "SAVE" may remove original JCF  
preemption rset check not considering cpus that will be avail  
WebUI: unknown keyword "start\_date"  
WebUI: Format of "Start date" is unexpected  
No error msg as invalid date for LL version with preferences  
Hard/Soft wall clock limit's value can't be saved and submit  
WebUI: changes for jcf as script support  
Update message ELIB488 with info on setuid programs  
data can't be submitted and saved in Simple Parallel Job window  
Restore failed with Job type in Simple Parallel window  
WebUI: Help msg needed in Job Status Panel  
WebUI: Help msg needed in Machine Status Panel  
SCHEDULING PROBLEMS IN A BLUEGENE ENVIRONMENT  
LL startd crashes while jobs running  
ptf1:default mcm\_affinity\_options and ConsumableCpus in llstatu  
WebUI: fix fields not cleared or restored  
Update lowest AIX release needed to run LL  
WebUI: Widgets of Filters are useless  
Find PAM path failed on 64 bit platform

invalid default limit value on starter  
experienced seven startd coredumps during NIC run

## GPFS

Refer to the following change logs:

- [GPFS 2.3.0.22](#)
- [GPFS 3.1.0.12](#)
- [GPFS 3.1.0.13](#)

## CSM

### 1.5.1.6

ANOTHER PROCESS CAN GREP RMCS PORT (657) BEFORE CSMFIRSTBOOT R  
AIX: No CSM post install activities and install.log  
RH:dsh failed because known\_hosts didn't update after install  
ANOTHER PROCESS CAN GRAB RMCS PORT (657) BEFORE OSFIRSTBOOT  
CT: MM peer domain partitioned and can not merge back  
Varying type byte in Crichton VPD causes lshwstat uuid to fail  
CSM DSH COMMAND RUNS OUT OF FILE DESCRIPTORS  
bmc2 lib causing HwCtrlRM to core dump  
ERRMSGQUE OVERFLOW CAN CAUSE NODE TO HANG  
dsh hangs when we run updatenode -a with more than 2 nodes  
Update VRMF and READMEs for CSM 1.5.1.6

### 1.6.0.11

getserviceableevents fails on P5 hmc's  
ERRMSGQUE OVERFLOW CAN CAUSE NODE TO HANG  
rfwflash waits to completion before notification of error  
Remove eClipz OpenSLP attribute unicast  
definenode assigns wrong InstallServiceLevel for a RHEL4.5 node  
csmsetupinstall fails if IS is nodegrp  
Porting: CSM support RHEL4.5 RC1  
hwmaint: invoker seg fault  
rconsole: BMC keep alive message not displayed  
Change Pegasus CIMOM port from 15988 to 5989  
licutil script may allow removal of system files  
Update VRMF and tarball tools for CSM 1.6.0.11  
hdwr\_svr.models file needs to be updated with eClipz single-sid

rpower query does not work on P5 system  
Setup for Linux install fails  
Netboot fails on JS21 blades with 0717A csm build  
Porting: support RHEL4.5 GA  
hwmain: rfwsan failing in pre-OS mode  
rpower cec query shows cec status incorrectly on p6  
Porting: support SLES 10 SP1 GMC on System x and System p  
Update README for (1.6.0.11)

## RSCT

### 2.3.11.1

Multi-node DHB networks: DHB NIM + dhb\_reader  
rmcd cored at pci\_prm\_first\_init  
NODE FAILS TO REJOIN RPD DUE TO GLOBAL VERSION MISMATCH  
lsrpdomain command hangs  
output not the same  
GL ConfigRM core at PeerDomainRcp::selectCSSK  
ctsnap doesn't get lssrc -ls output on AIX  
selectCSSK handles unreachable nodes badly  
ConfigRM hit core in scalar test.  
WLMRM deadlock at RMRccp::unbindRCP  
ctrl operation support  
AIX: SDD driver disk monitoring fails  
StorageRM core file due to buffer overflow  
HATS hit core during IB regression.  
the CSSKTYPE\_DES\_MD5 version is incorrect  
cthats cored at RPDSecStatus  
null out both length and value members of sec\_buffer\_desc  
hagsglsm hit core during IB regression.  
bad indexing in SelCSSKEncrCache.C  
Set VRMF for Elgar/Elgar52 PTF 1  
interop: Domain partitioned after UpdateKey  
interop: lssrc -ls IBM.ConfigRM shows security disabled  
rsct.basic.rte msgs during elg52 apply  
nodes repeatedly online / pending online  
correct error handling on failed selectCSSKOps  
domain pending online if mkrpdomain with -k CSSKTYPE\_None  
interop: starttrpnode failed to bring all nodes online  
fix forcerpoffline error msg EMsgforcerpofflineRMCErr  
RMCD CORES WHEN INTERNET SCANNER 7.0 (ISSCAN) USED  
Several messages with invalid format in IBM.StorageRM.msg

CSSKRefreshInterval should = 0 when cssk changes to None  
 caGetPMFile fails on partition  
 IBM.FSRMD CORE DUMP DUE TO MEMORY LEAK  
 core passing NULL pointer  
 DeviceLockMode for MD rsrc changed from 0 to 4  
 interop: CSSK not refreshed periodically  
 Client Monitoring Interval set to 0 when no CGs are defined  
 old level of chkconfig affects start order of RSCT daemons  
 LX: RSCT Elgar man page updates  
 CONFIGRM CORE DUMP DUE TO CSSKTYPE IS NOT SET.  
 DeviceLockMode fixes for AIX/Linux  
 CSSKRefreshInterval is not set to 0 after ptf apply

### 2.3.7.1

Multi-node DHB networks: DHB NIM + dhb\_reader  
 rmcd cored at pci\_prm\_first\_init  
 NODE FAILS TO REJOIN RPD DUE TO GLOBAL VERSION MISMATCH  
 lsrpdomain command hangs  
 output not the same  
 GL ConfigRM core at PeerDomainRcp::selectCSSK  
 ctsnap doesn't get lssrc -ls output on AIX  
 G1D: selectCSSK handles unreachable nodes badly  
 ConfigRM hit core in G1D large scalar test.  
 WLMRM deadlock at RMRccp::unbindRCP  
 MD: ctrl operation support  
 AIX: SDD driver disk monitoring fails  
 StorageRM core file due to buffer overflow  
 HATS hit core during IB regression.  
 the CSSKTYPE\_DES\_MD5 version is incorrect  
 cthats cored at RPDSecStatus  
 null out both length and value members of sec\_buffer\_desc  
 hagsglsmc hit core during IB regression.  
 bad indexing in SelCSSKEncrCache.C  
 Set VRMF for Elgar/Elgar52 PTF 1  
 interop: Domain partitioned after UpdateKey  
 interop: lssrc -ls IBM.ConfigRM shows security disabled  
 rsct.basic.rte msgs during elg52 apply  
 nodes repeatedly online / pending online  
 correct error handling on failed selectCSSKOps  
 domain pending online if mkrpdomain with -k CSSKTYPE\_None  
 interop: starttrpnode failed to bring all nodes online  
 fix forcerpoffline error msg EMsgforcerpofflineRMCErr

RMCD CORES WHEN INTERNET SCANNER 7.0 (ISSCAN) USED  
Several messages with invalid format in IBM.StorageRM.msg  
CSSKRefreshInterval should = 0 when cssk changes to None  
caGetPMFile fails on partition  
IBM.FSRMD CORE DUMP DUE TO MEMORY LEAK  
core passing NULL pointer  
DeviceLockMode for MD rsrc changed from 0 to 4  
interop: CSSK not refreshed periodically  
Client Monitoring Interval set to 0 when no CGs are defined  
old level of chkconfig affects start order of RSCT daemons  
LX: RSCT Elgar man page updates  
CONFIGRM CORE DUMP DUE TO CSSKTYPE IS NOT SET.  
DeviceLockMode fixes for AIX/Linux  
CSSKRefreshInterval is not set to 0 after ptf applied