Down-Sampling (4B)

-
-

Please send corrections (or suggestions) to youngwlim@hotmail.com.

This document was produced by using OpenOffice and Octave.

Decreasing Sampling Frequency

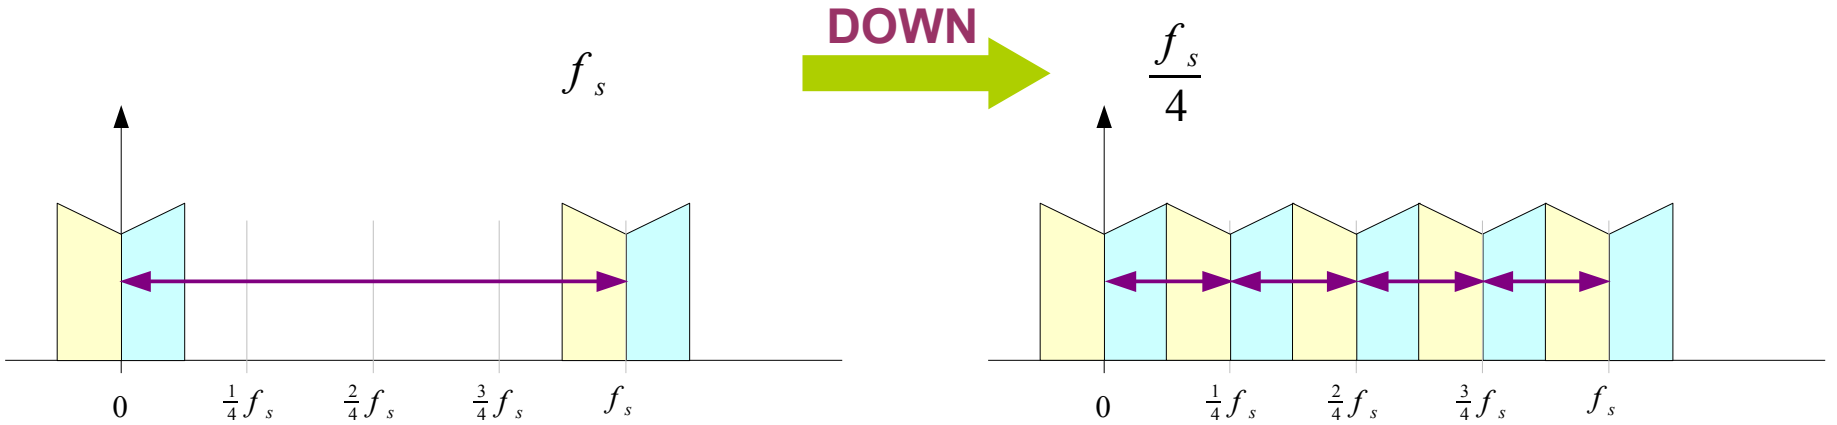

Sampling Frequency f_s

Sampling Time $T = \frac{1}{f_s}$

Sampling Frequency $f'_s = \frac{1}{4} f_s$

Sampling Time $T' = \frac{4}{f_s}$

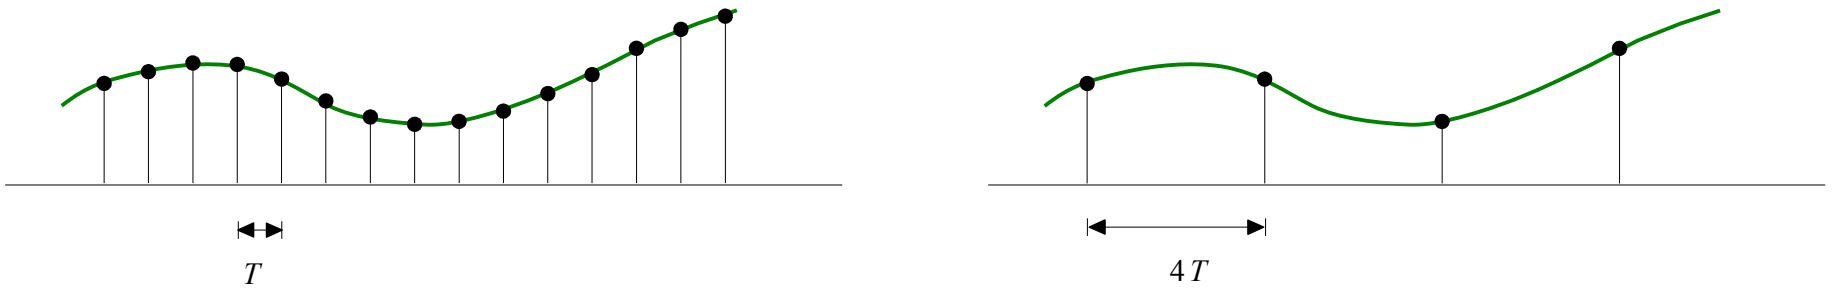

Coarse Sequence & Spectrum

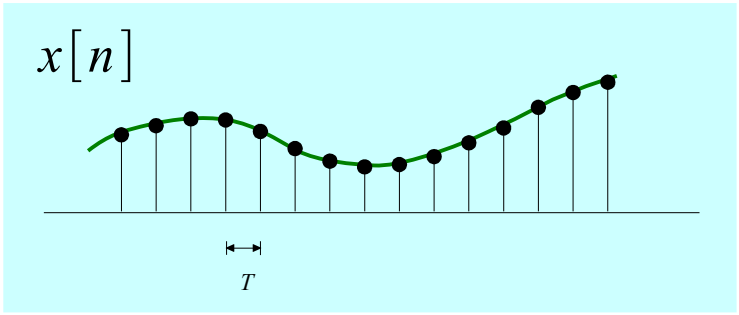

DOWN

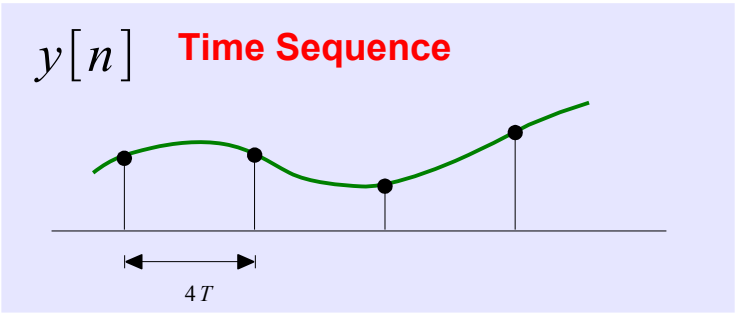

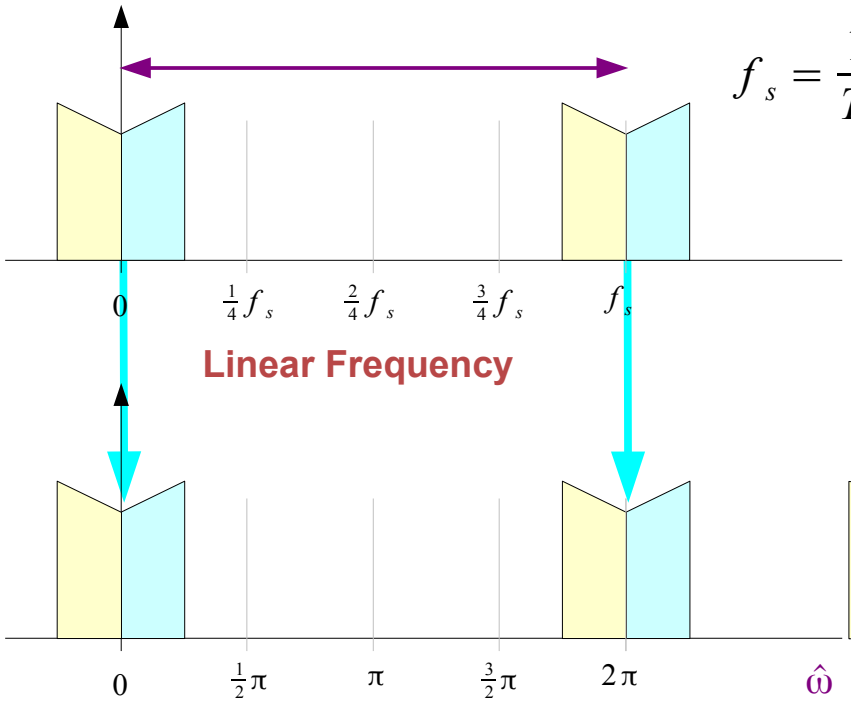

Normalized Radian Frequency

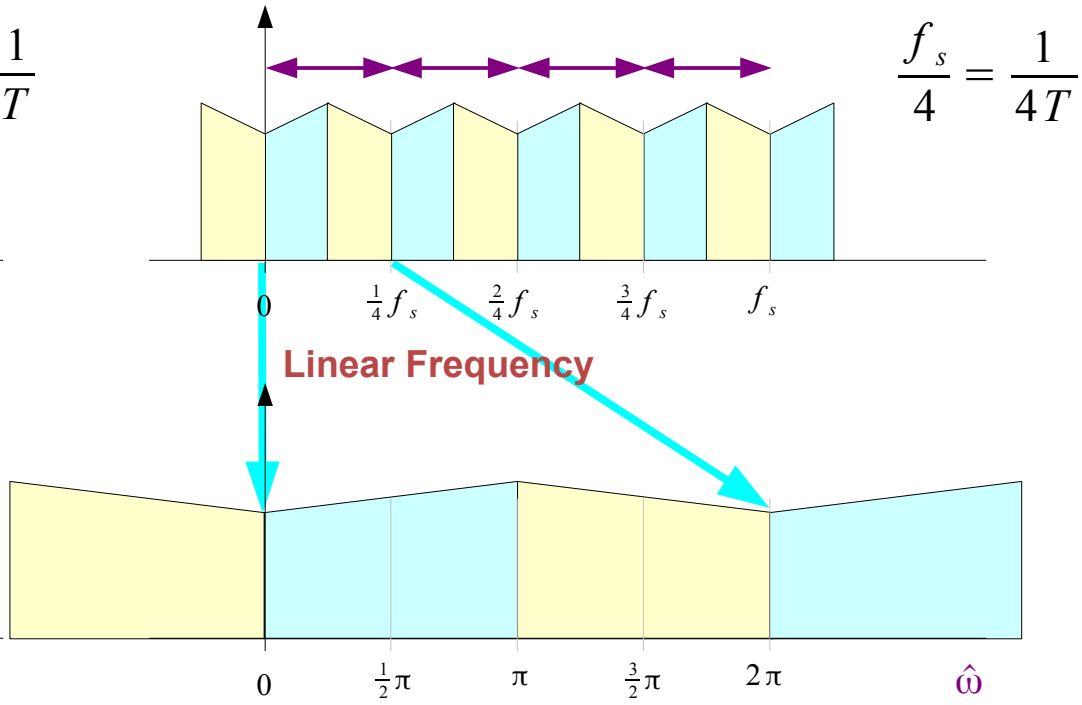

Normalized Radian Frequency

Normalized Radian Frequency

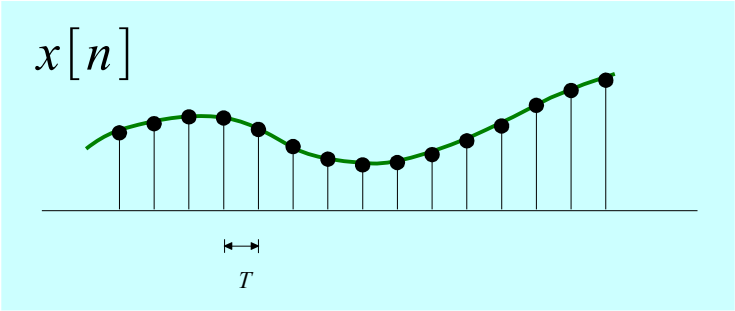

$$\hat{\omega} = \omega \cdot T_s = \frac{\omega}{1/T_s}$$

$$\hat{\omega} = \frac{\omega}{f_s} = 2\pi \frac{f}{f_s}$$

Normalized to f_s

Normalized Radian Frequency

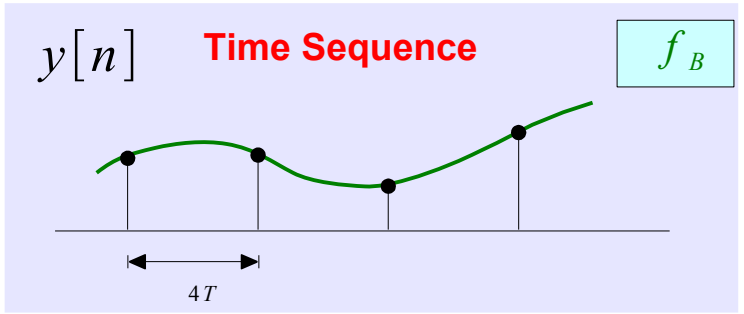

$$\frac{f}{f_s} = \frac{f_B}{1/4T} = f_B \cdot 4T$$

The Same

- **Time Sequence**
- **Normalized Radian Frequency**

$$\frac{f}{f_s} = \frac{4f_B}{1/T} = f_B \cdot 4T$$

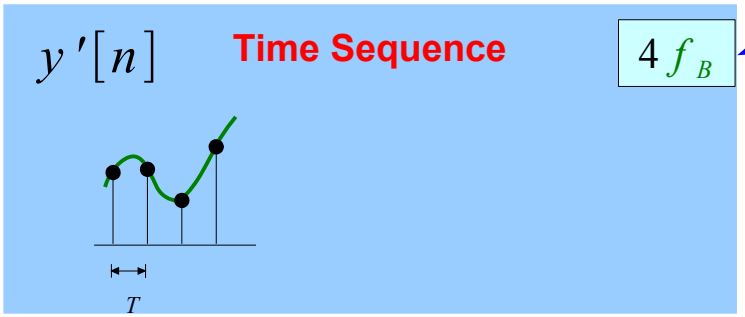

The Highest Frequency:

Coarse Sequence Spectrum – Linear Frequency

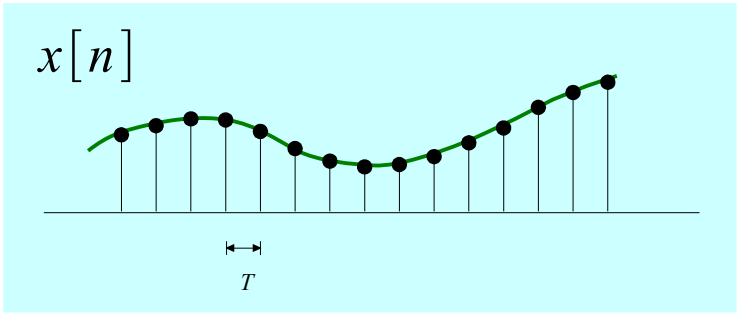

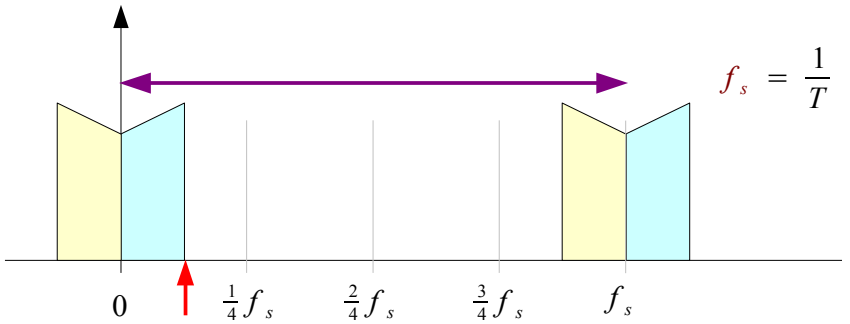

DOWN

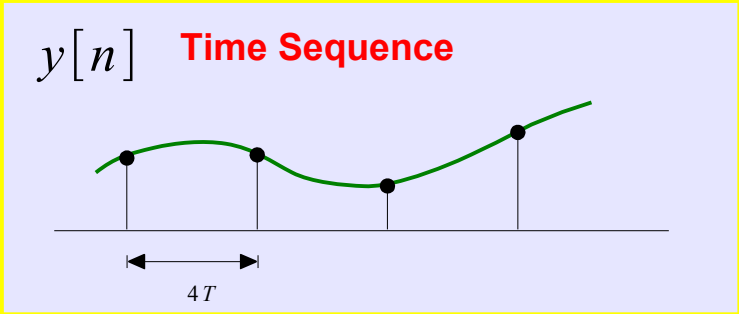

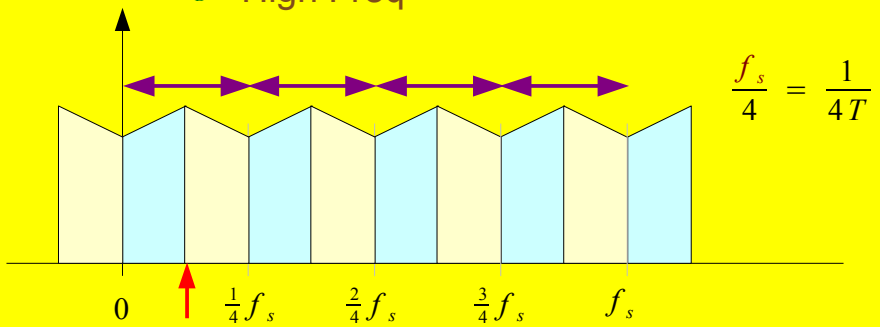

The Same Time Sequence

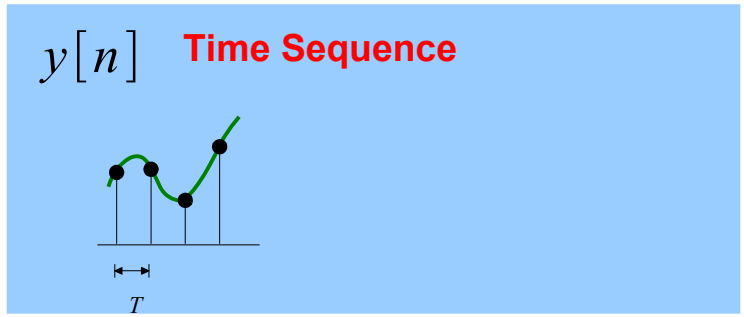

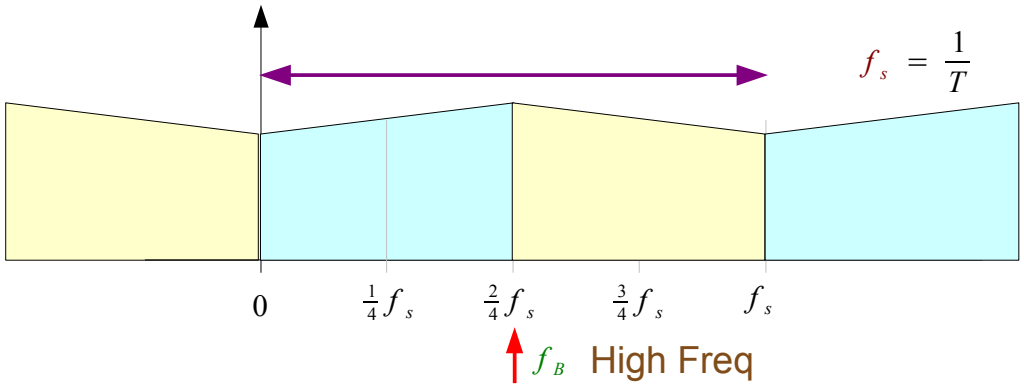

Coarse Sequence Spectrum – Normalized Frequency

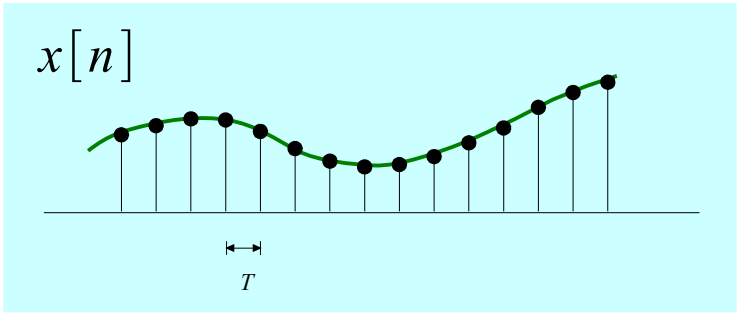

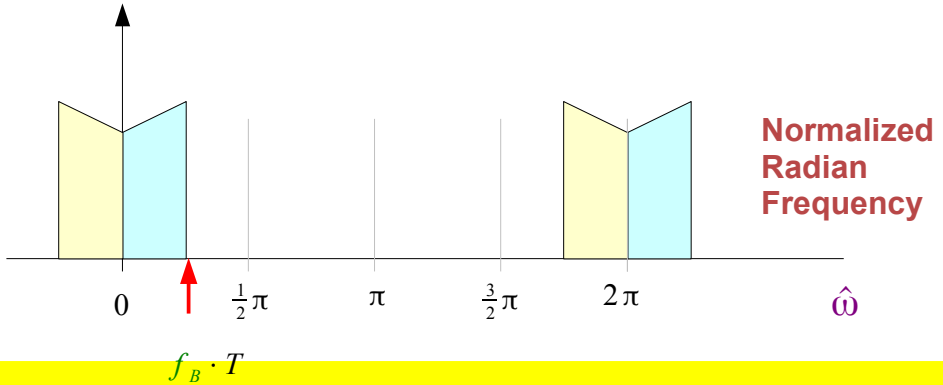

DOWN

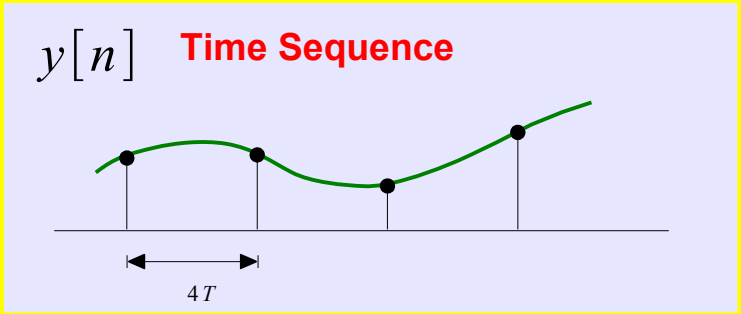

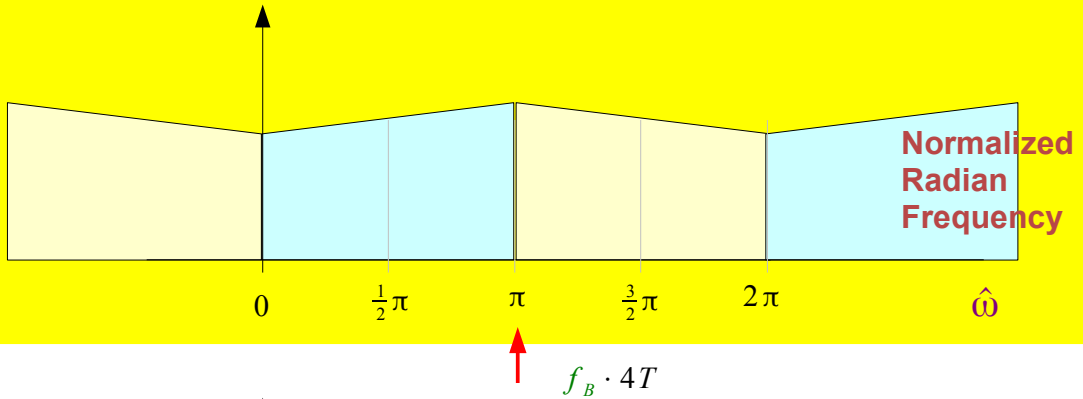

The Same Time Sequence

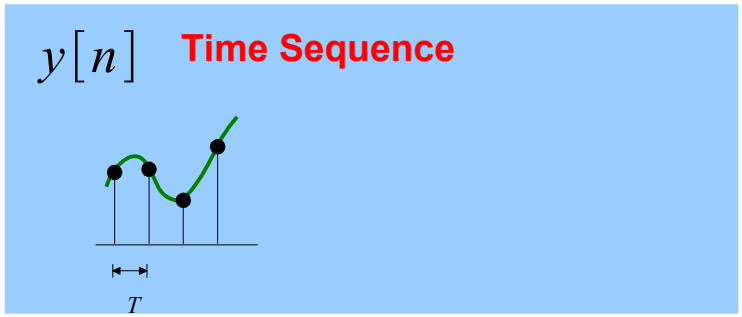

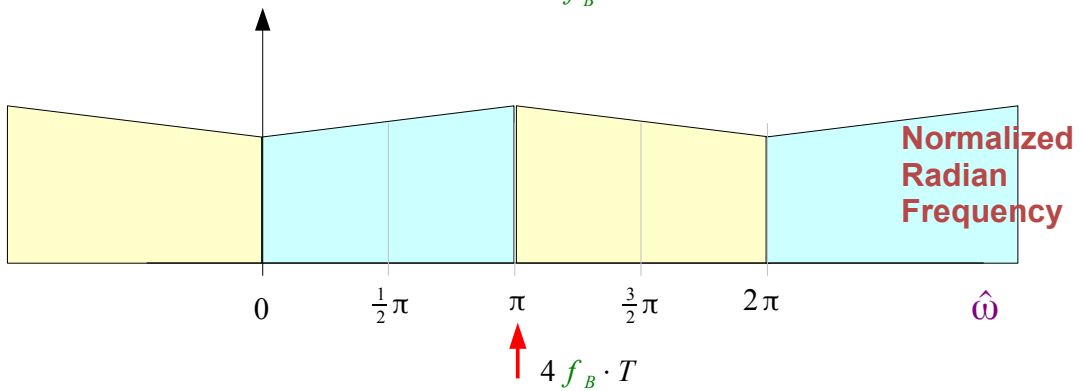

Coarse Sequence Spectrum

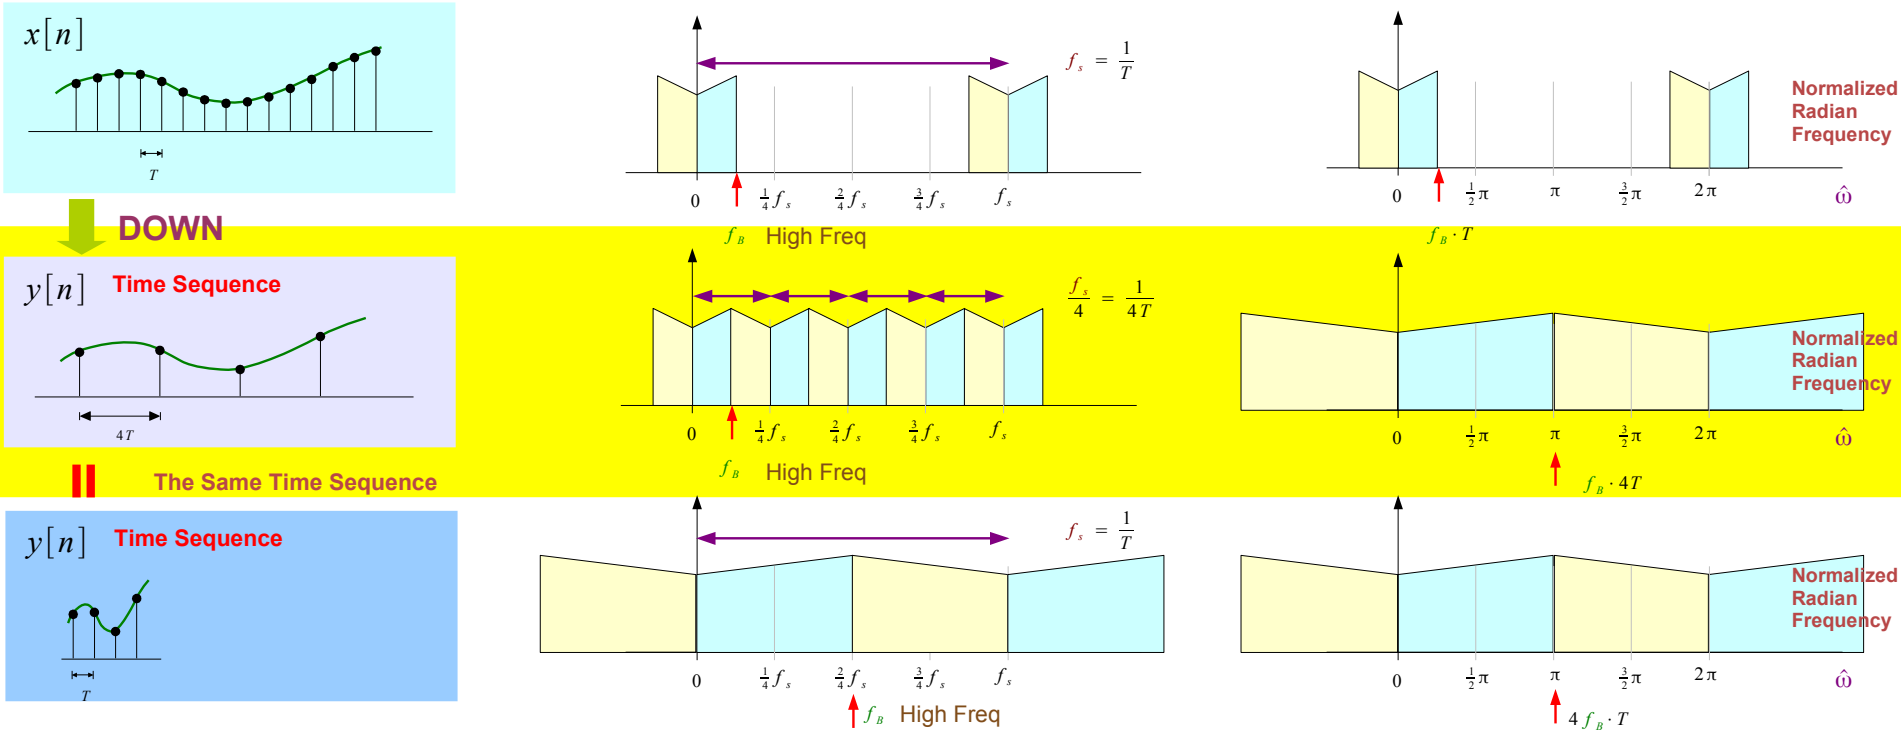

Coarse Sequence Generation

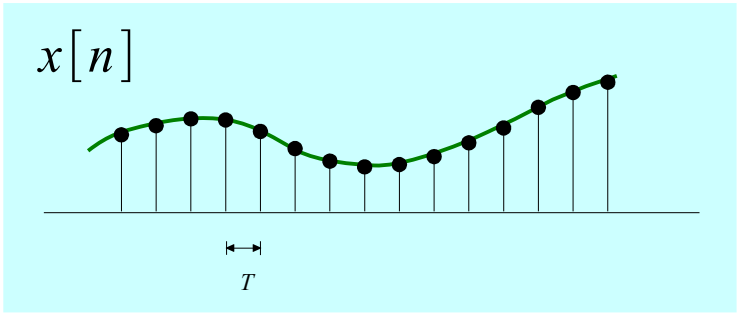

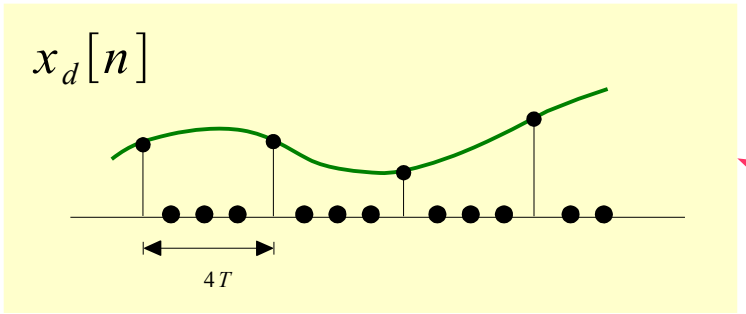

T **Sampling Period**

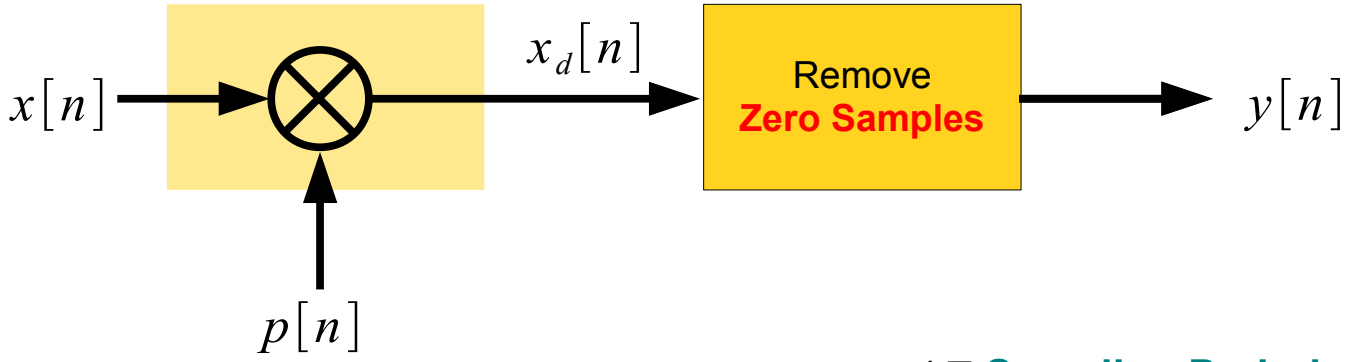

$4T$ **Sampling Period**

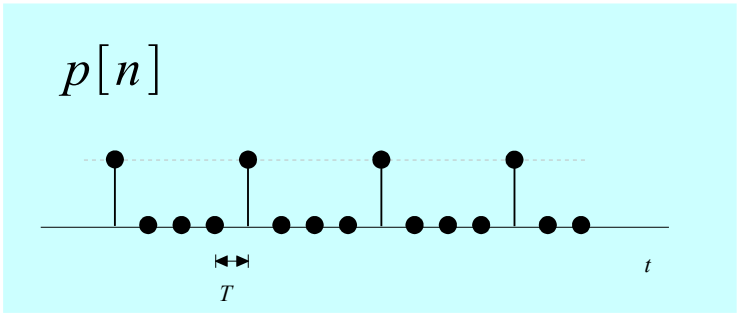

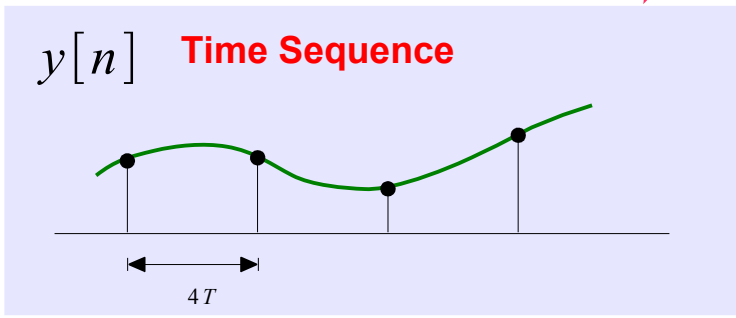

Down Sampling in Two Steps

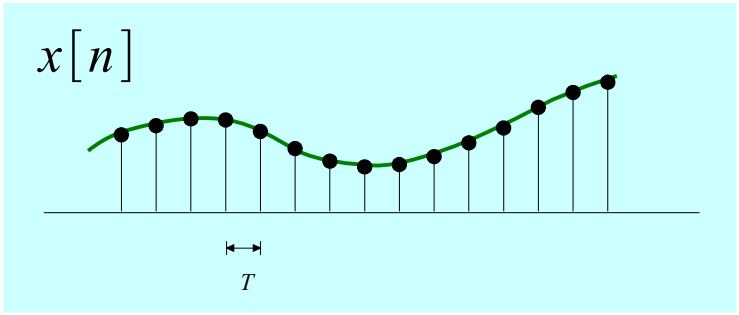

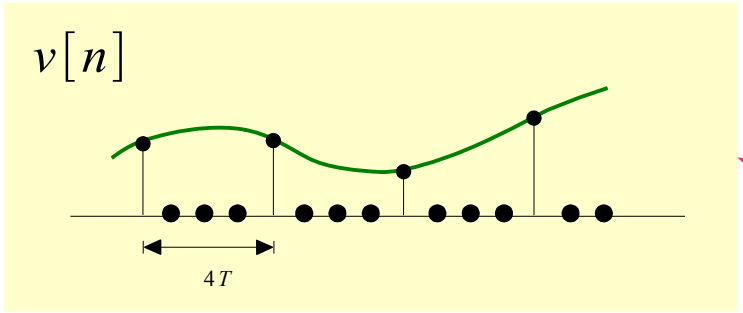

T **Sampling Period**

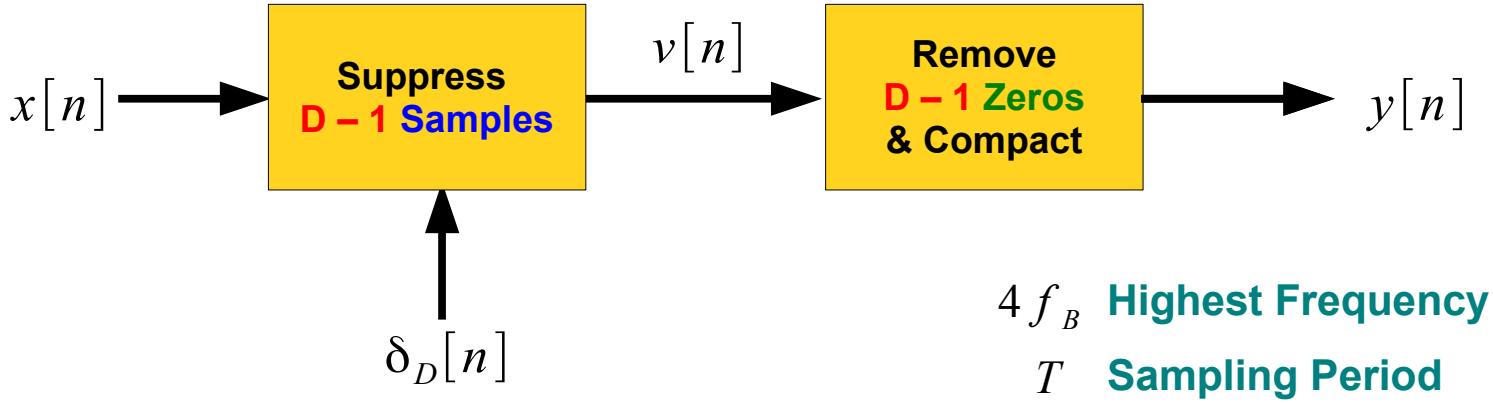

$4 f_B$ **Highest Frequency**

T **Sampling Period**

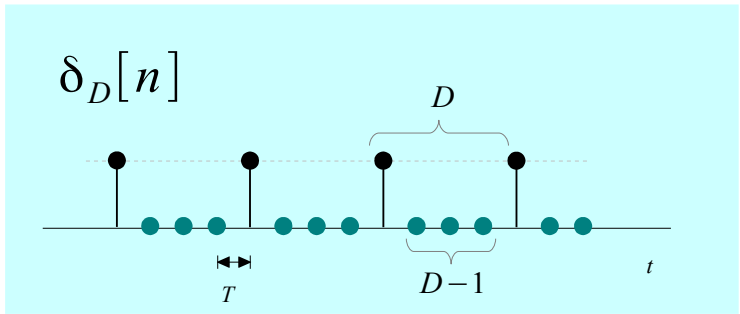

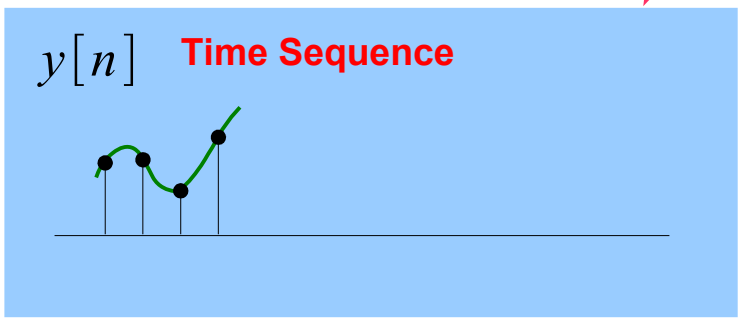

Down-Sampling Operator

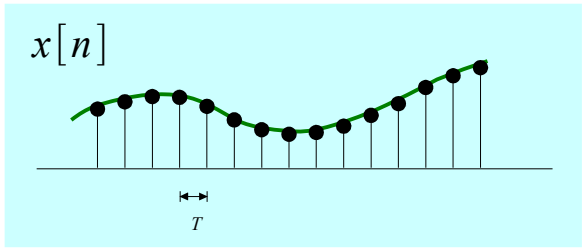

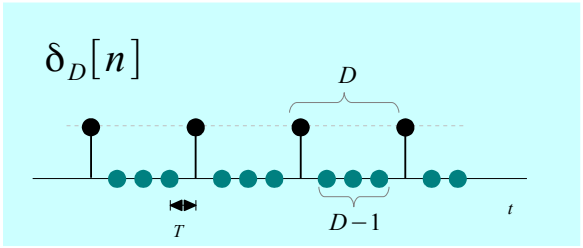

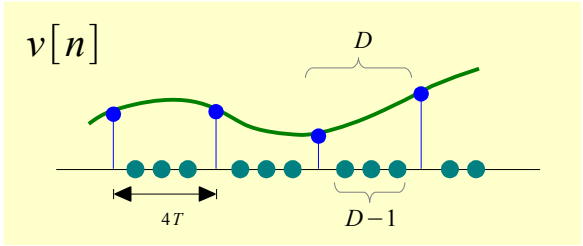

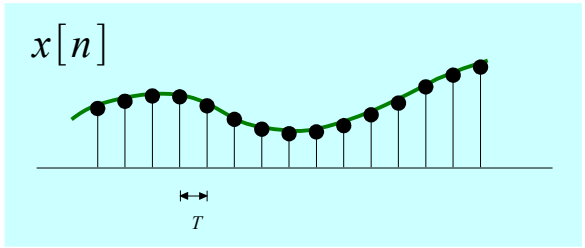

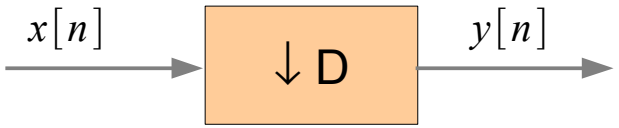

D-fold Decimator

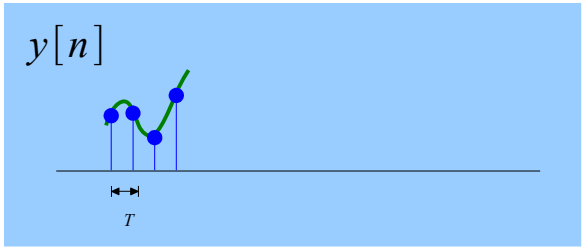

$$y[n] = S_{1/D}\, x[n] = x[nD]$$

$$y[1] = x[1D]$$
$$y[2] = x[2D]$$
$$y[3] = x[3D]$$
$$\dots$$

Suppressing D-1 Samples

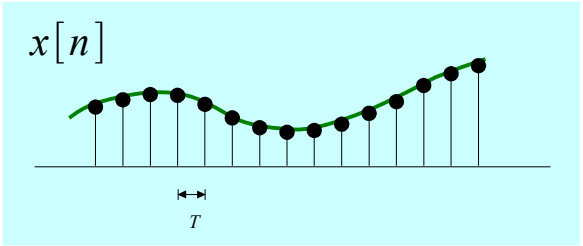

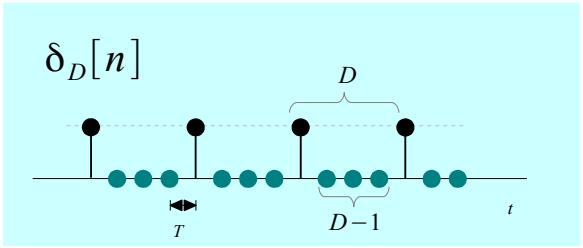

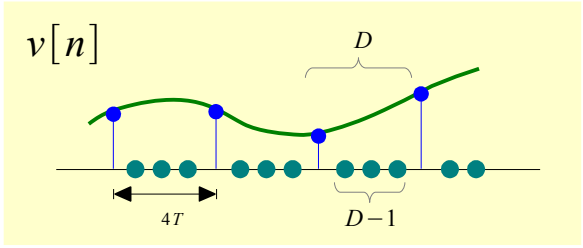

$$\delta_D[n] = \begin{cases} 1 & \text{if } \mathbf{mod}(n, D) = 0 \\ 0 & \text{otherwise} \end{cases} \qquad v[n] = \delta_D[n]x[n]$$

$$V[z] = \cdots + v[0]z^{0} + v[D]z^{-D} + v[2D]z^{-2D} + \cdots$$

$$V[z] = \sum_{n=-\infty}^{+\infty} v[n]z^{-n} = \sum_{m=-\infty}^{+\infty} v[mD]z^{-mD} = F(z^{D})$$

Example When D=2 (1)

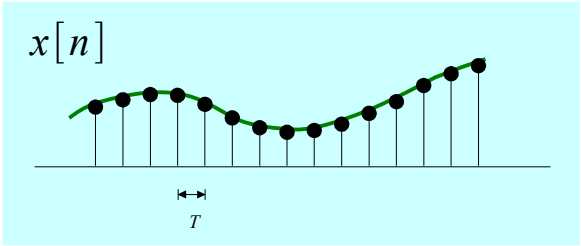

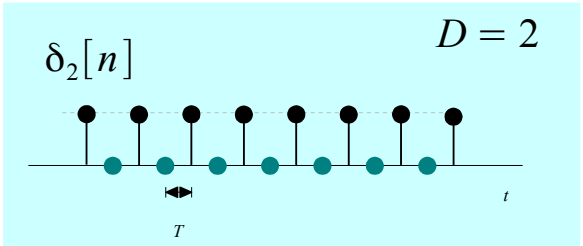

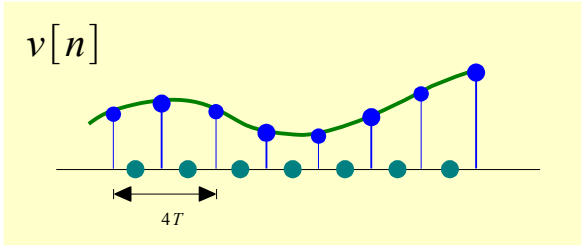

$$x[n] = e^{j\omega n}$$

$$\delta_2[n] = \tfrac{1}{2}\left(1 + (-1)^n\right)$$

$$= \tfrac{1}{2}\left(1 + e^{-j\pi n}\right)$$

$$\left(e^{-j\pi} = -1\right)$$

$$v[n] = \tfrac{1}{2}x[n] + \tfrac{1}{2}e^{-j\pi n}x[n]$$

$$= \tfrac{1}{2}e^{j\omega n} + \tfrac{1}{2}e^{-j\pi n}e^{j\omega n}$$

$$= \tfrac{1}{2}e^{j\omega n} + \tfrac{1}{2}e^{+j(\omega-\pi)n}$$

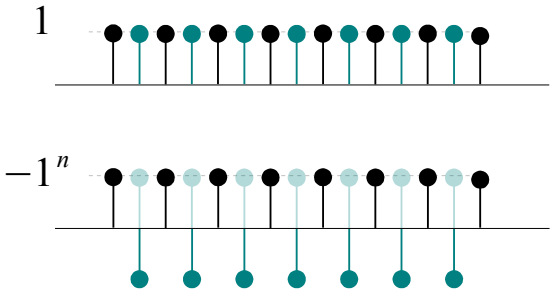

$$V(z) = \tfrac{1}{2}\textstyle\sum_{n=-\infty}^{+\infty}\left(x[n]z^{-n} + x[n](-z)^{-n}\right)$$

$$= \tfrac{1}{2}X(z) + \tfrac{1}{2}X(-z)$$

$$V\left(e^{j\hat{\omega}}\right) = \tfrac{1}{2}X\left(e^{j\hat{\omega}}\right) + \tfrac{1}{2}X\left(e^{-j\pi}e^{j\hat{\omega}}\right)$$

$$V(\hat{\omega}) = \tfrac{1}{2}X(\hat{\omega}) + \tfrac{1}{2}X(\hat{\omega} - \pi)$$

Example When D=2 (2)

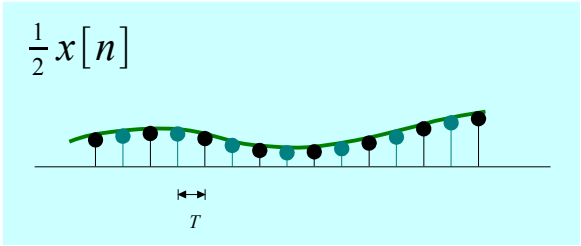

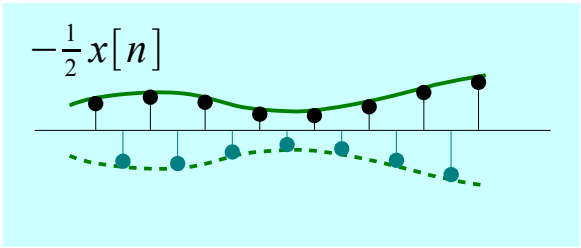

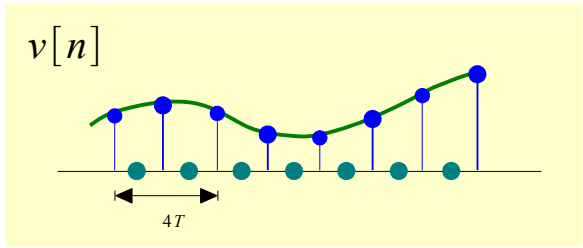

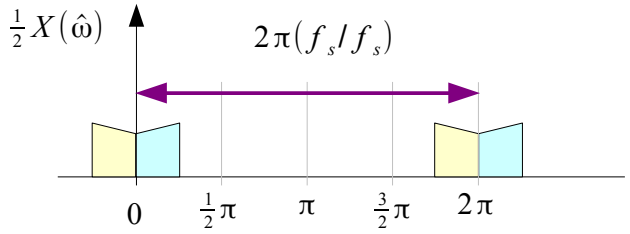

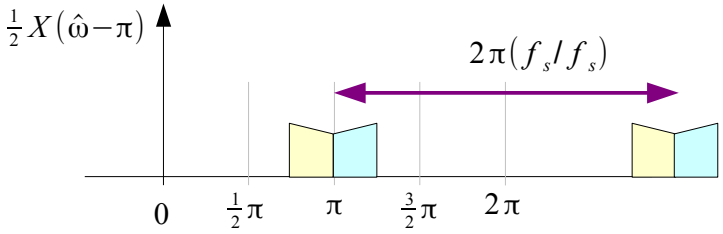

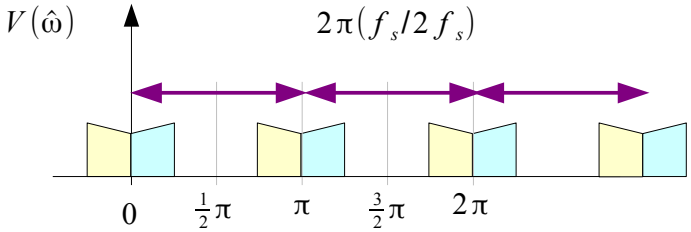

$$v[n] = \frac{1}{2}x[n] + \frac{1}{2}e^{-j\pi n}x[n]$$

$$V(z) = \frac{1}{2}X(z) + \frac{1}{2}X(-z)$$

$$V(e^{j\hat{\omega}}) = \frac{1}{2}X(e^{j\hat{\omega}}) + \frac{1}{2}X(e^{-j\pi}e^{j\hat{\omega}})$$

$$V(\hat{\omega}) = \frac{1}{2}X(\hat{\omega}) + \frac{1}{2}X(\hat{\omega}-\pi)$$

Example When D=2 (3)

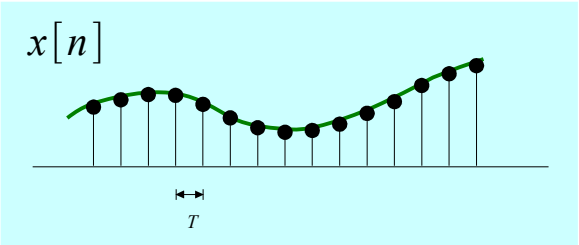

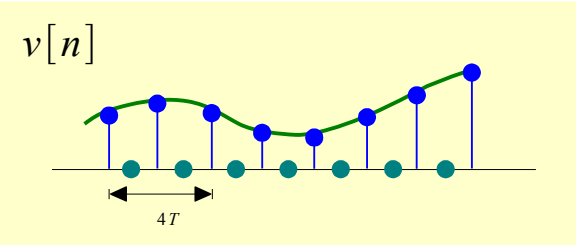

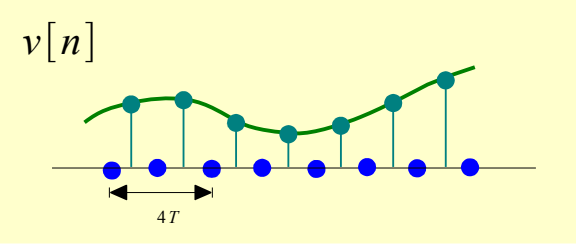

Z-Transform & Suppressing D-1 Samples (1)

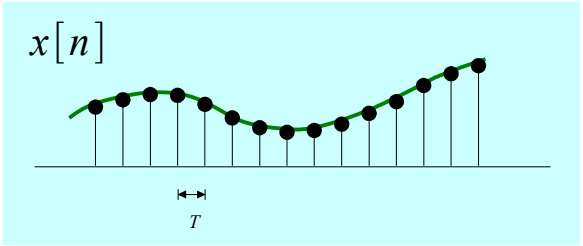

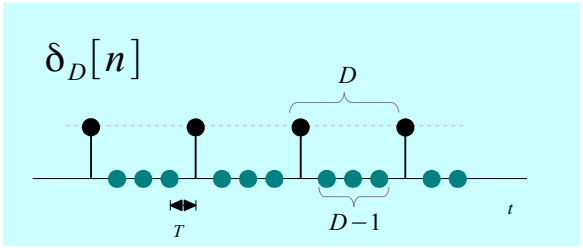

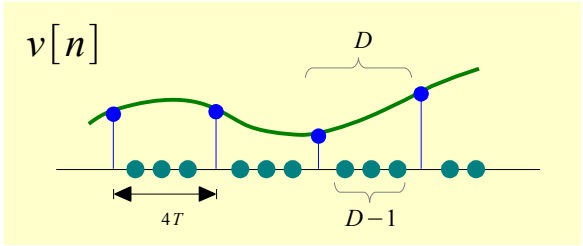

$$\delta_D[n] = \frac{1}{D}\sum_{k=0}^{D-1} e^{-j2\pi k n/D} = \begin{cases} \frac{1}{D} D = 1 & \text{if } \mathbf{mod}(n, D) = 0 \\ \frac{1}{D}\frac{1-e^{-j2\pi n}}{1-e^{-j2\pi n/D}} = 0 & \text{otherwise} \end{cases}$$

$$v[n] = \delta_D[n]x[n]$$

$$v[n] = \delta_D[n]x[n] = \frac{1}{D}\sum_{k=0}^{D-1} x[n]e^{-j2\pi k n/D}$$

$$Z\{x[n]e^{-j\hat{\omega}_k n}\} = \sum_{n=-\infty}^{+\infty} x[n](e^{j\hat{\omega}_k}\cdot z)^{-n} = X(e^{j\hat{\omega}_k}\cdot z)$$

$$V(z) = \frac{1}{D}\sum_{k=0}^{D-1} X(e^{-j2\pi k/D}\cdot z)$$

$$\hat{\omega}_k = 2\pi k/D$$

$$e^{-j2\pi k/D}\cdot z = e^{-j2\pi k/D} e^{j\hat{\omega}} = e^{j(\hat{\omega}-2\pi k/D)}$$

$$V(\hat{\omega}) = \frac{1}{D}\sum_{k=0}^{D-1} X(\hat{\omega} - 2\pi k/D)$$

Z-Transform & Suppressing D-1 Samples (2)

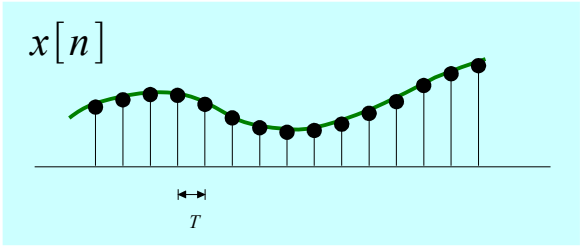

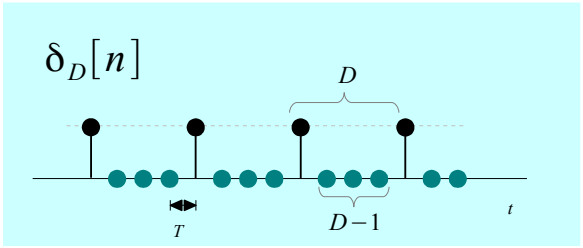

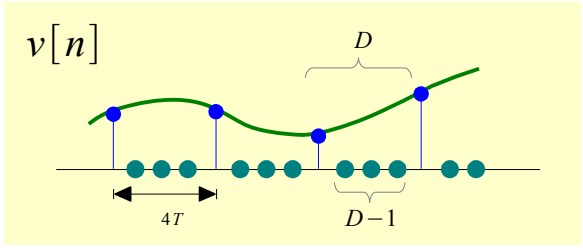

$$V(z) = \frac{1}{D}\sum_{k=0}^{D-1} X\left(e^{-j2\pi k/D}\cdot z\right)$$

$$V(\hat{\omega}) = \frac{1}{D}\sum_{k=0}^{D-1} X\left(\hat{\omega} - 2\pi k/D\right)$$

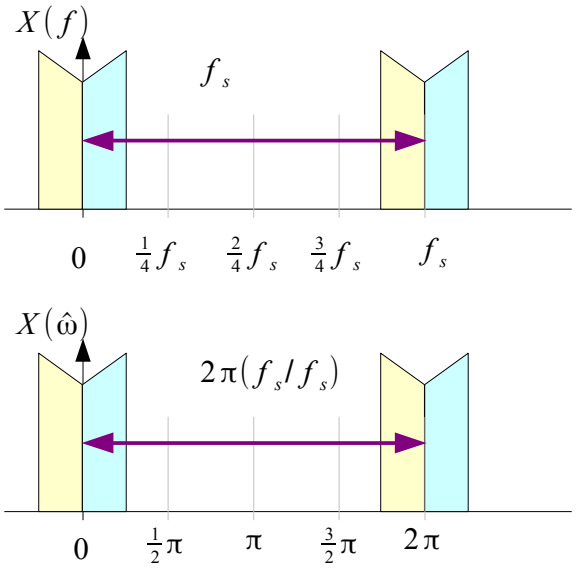

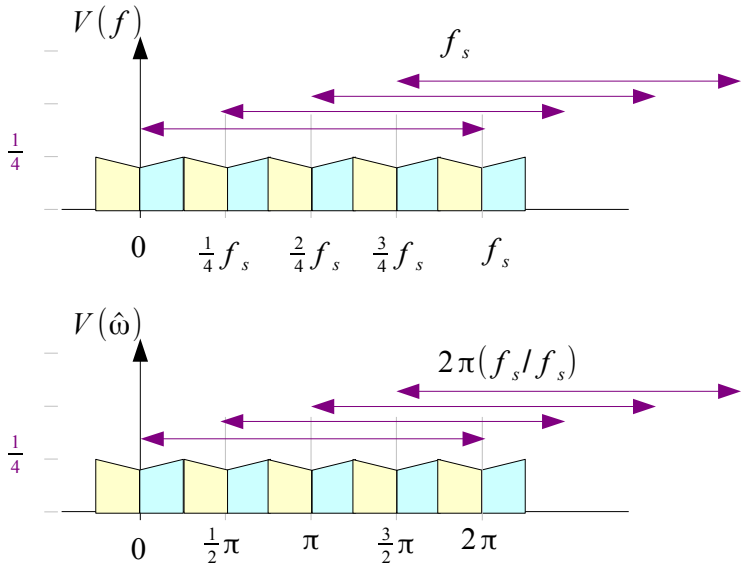

Z-Transform & Removing D-1 Zeros (1)

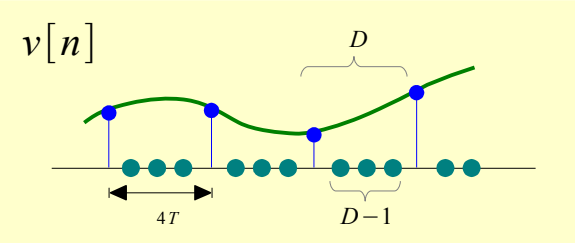

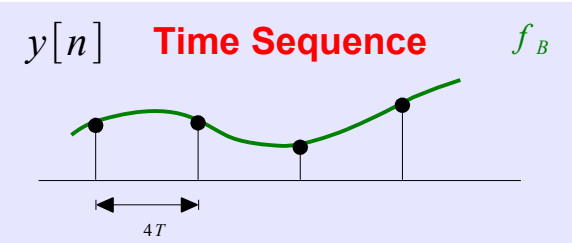

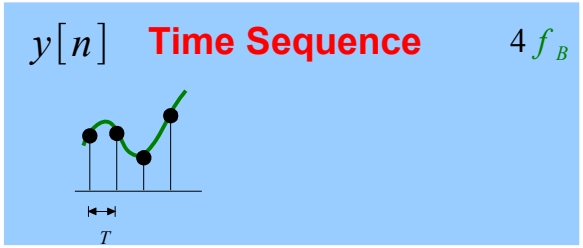

$$Y(z) = \cdots + y[0] + y[1]z^{-1} + y[2]z^{-2} + \cdots + y[n]z^{-n} + \cdots$$
$$= \cdots + v[0] + v[D]z^{-1} + v[2D]z^{-2} + \cdots + v[nD]z^{-n} + \cdots$$

$$Y(z) = V(z^{1/D})$$

$$V(z) = \frac{1}{D}\sum_{k=0}^{D-1} X(e^{-j2\pi k/D}\cdot z)$$

$$Y(z) = \frac{1}{D}\sum_{k=0}^{D-1} X(e^{-j2\pi k/D}\cdot z^{1/D})$$

$$V(\hat{\omega}) = \frac{1}{D}\sum_{k=0}^{D-1} X(\hat{\omega} - 2\pi k/D)$$

$$V(\hat{\omega}) = \frac{1}{D}\sum_{k=0}^{D-1} X(\hat{\omega}/D - 2\pi k/D)$$

Z-Transform & Removing D-1 Zeros (2)

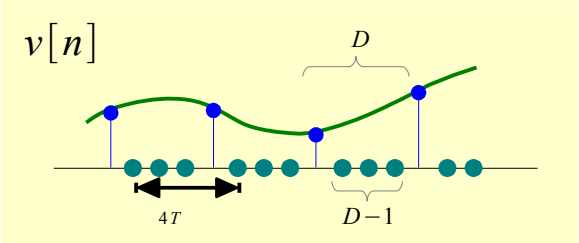

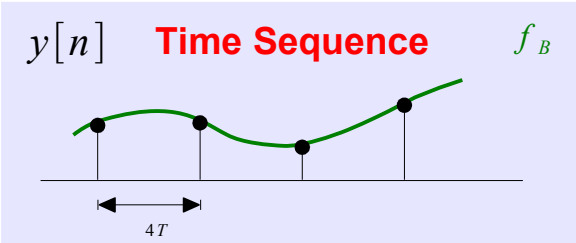

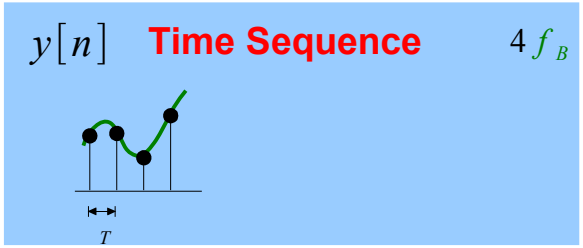

$$V(z) = \frac{1}{D}\sum_{k=0}^{D-1} X\left(e^{-j2\pi k/D}\cdot z\right)$$

$$Y(z) = \frac{1}{D}\sum_{k=0}^{D-1} X\left(e^{-j2\pi k/D}\cdot z^{1/D}\right)$$

$$V(\hat{\omega}) = \frac{1}{D}\sum_{k=0}^{D-1} X\left(\hat{\omega} - 2\pi k/D\right)$$

$$V(\hat{\omega}) = \frac{1}{D}\sum_{k=0}^{D-1} X\left(\hat{\omega}/D - 2\pi k/D\right)$$

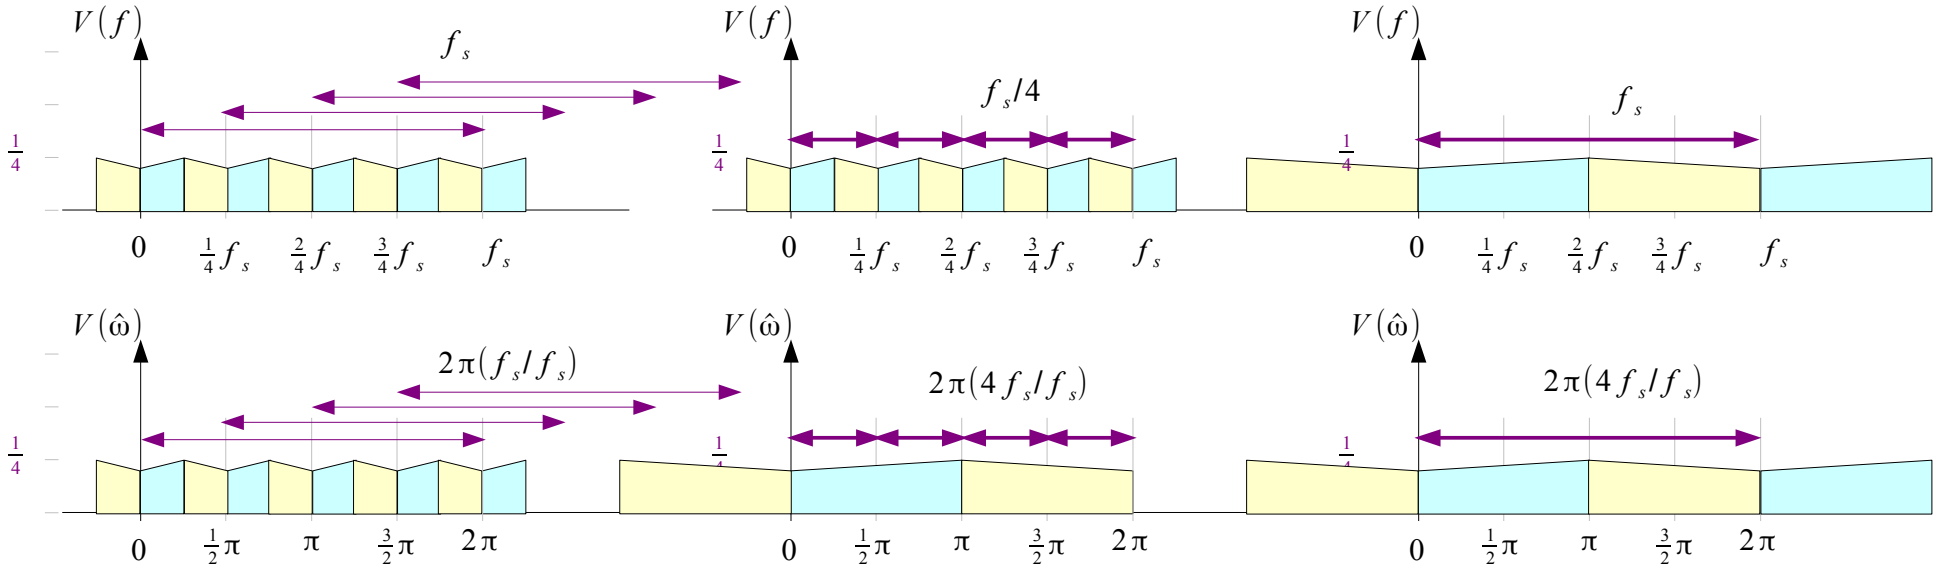

Example When D=2 (3)

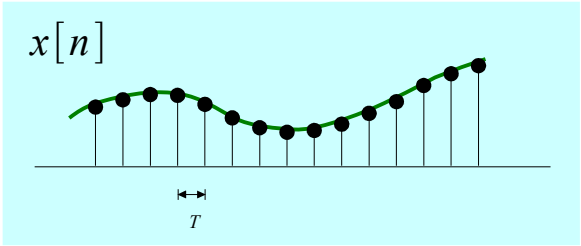

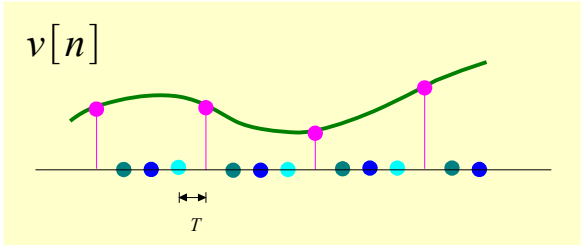

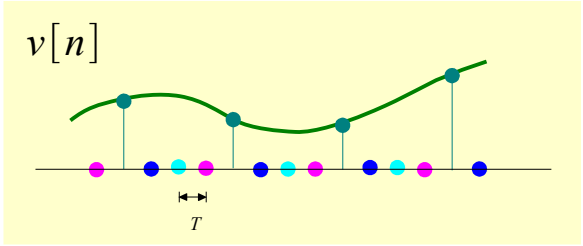

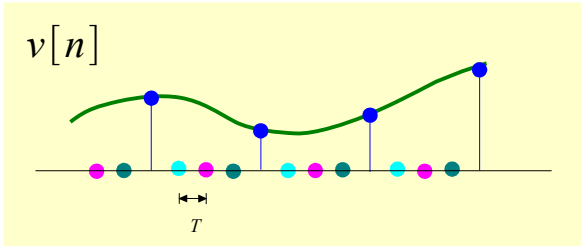

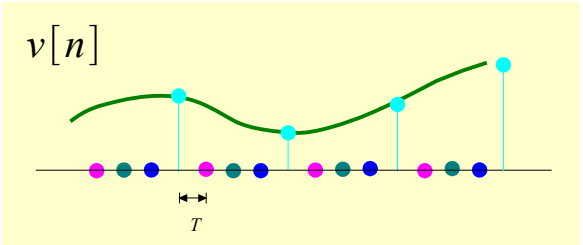

Down Sampling

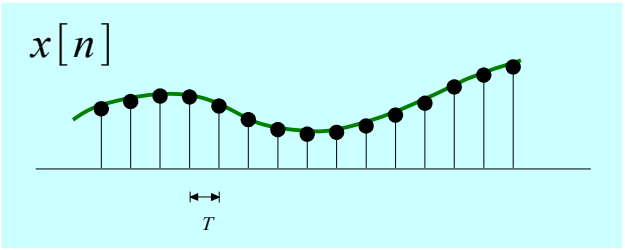

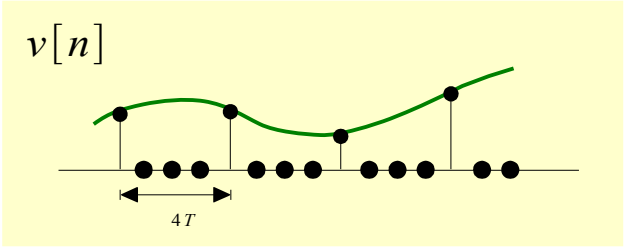

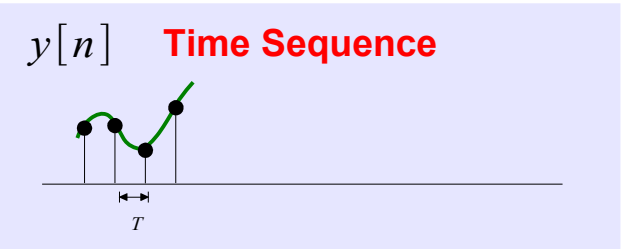

T **Sampling Period**

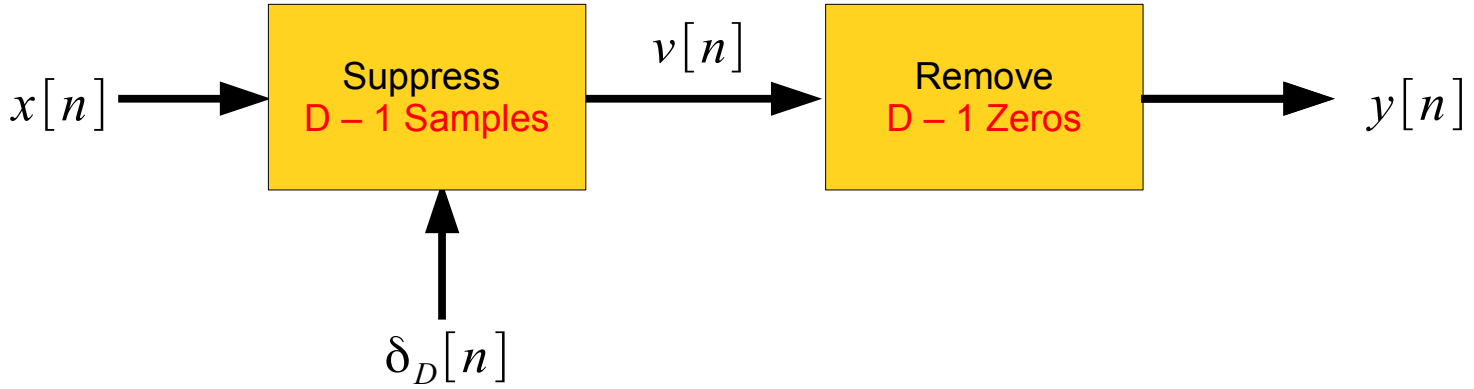

Ideal Sampling

Amplitude Axis Scaling
1 / D

Time Axis Scaling
1 / D

Spectrum Replication
f_s / D

Stretching Spectrum
ω / D

Measuring Rotation Rate

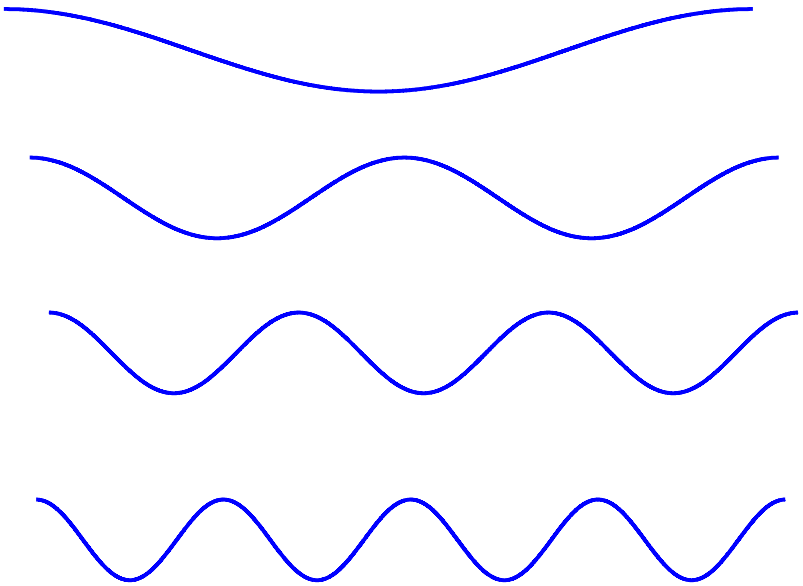

Signals with Harmonic Frequencies (1)

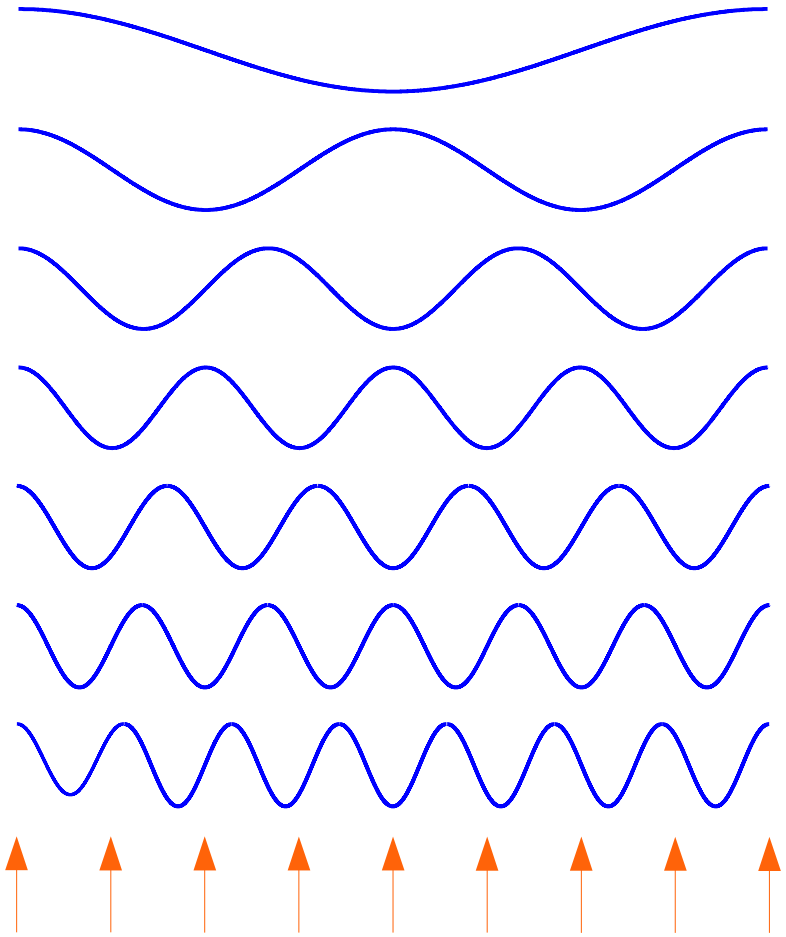

1 Hz
1 cycle / sec

$$\cos(1 \cdot 2\pi t) = \frac{e^{+j(1 \cdot 2\pi)t} + e^{-j(1 \cdot 2\pi)t}}{2}$$

2 Hz
2 cycles / sec

$$\cos(2 \cdot 2\pi t) = \frac{e^{+j(2 \cdot 2\pi)t} + e^{-j(2 \cdot 2\pi)t}}{2}$$

3 Hz
3 cycles / sec

$$\cos(3 \cdot 2\pi t) = \frac{e^{+j(3 \cdot 2\pi)t} + e^{-j(3 \cdot 2\pi)t}}{2}$$

4 Hz
4 cycles / sec

$$\cos(4 \cdot 2\pi t) = \frac{e^{+j(4 \cdot 2\pi)t} + e^{-j(4 \cdot 2\pi)t}}{2}$$

5 Hz
5 cycles / sec

$$\cos(5 \cdot 2\pi t) = \frac{e^{+j(5 \cdot 2\pi)t} + e^{-j(5 \cdot 2\pi)t}}{2}$$

6 Hz
6 cycles / sec

$$\cos(6 \cdot 2\pi t) = \frac{e^{+j(6 \cdot 2\pi)t} + e^{-j(6 \cdot 2\pi)t}}{2}$$

7 Hz
7 cycles / sec

$$\cos(7 \cdot 2\pi t) = \frac{e^{+j(7 \cdot 2\pi)t} + e^{-j(7 \cdot 2\pi)t}}{2}$$

Signals with Harmonic Frequencies (2)

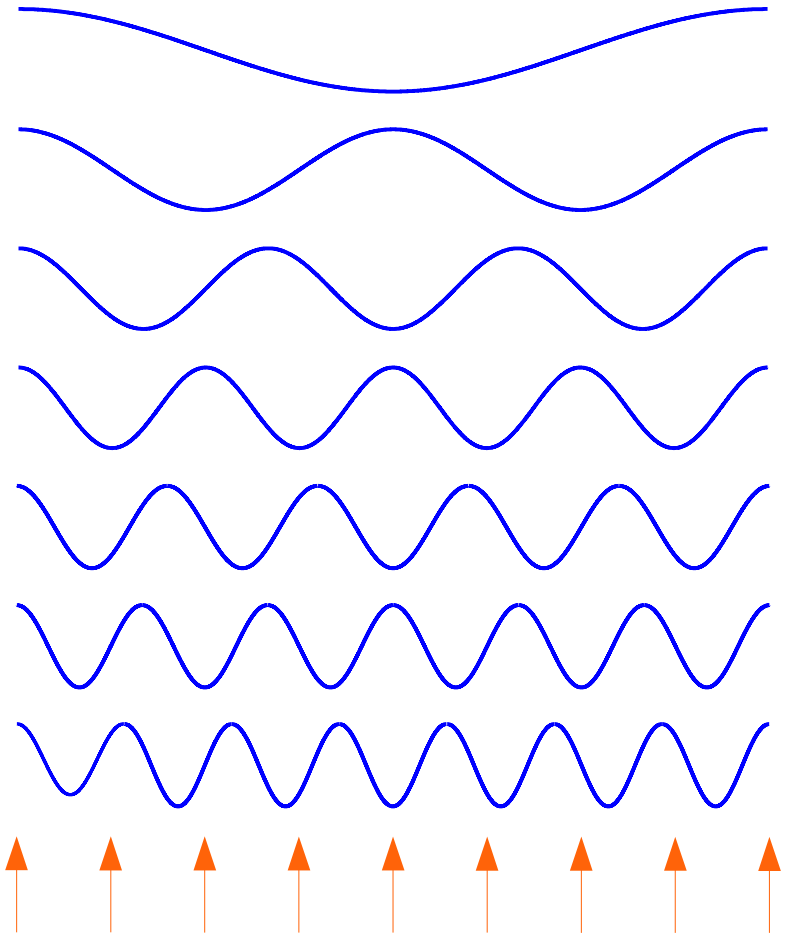

1 Hz
1 cycle / sec

2 Hz
2 cycles / sec

3 Hz
3 cycles / sec

4 Hz
4 cycles / sec

5 Hz
5 cycles / sec

6 Hz
6 cycles / sec

7 Hz
7 cycles / sec

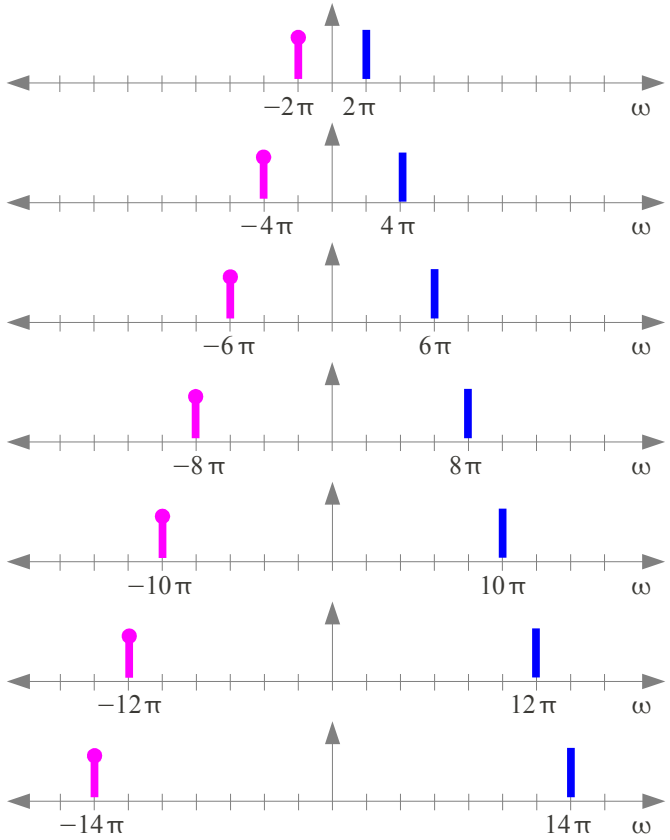

Sampling Frequency

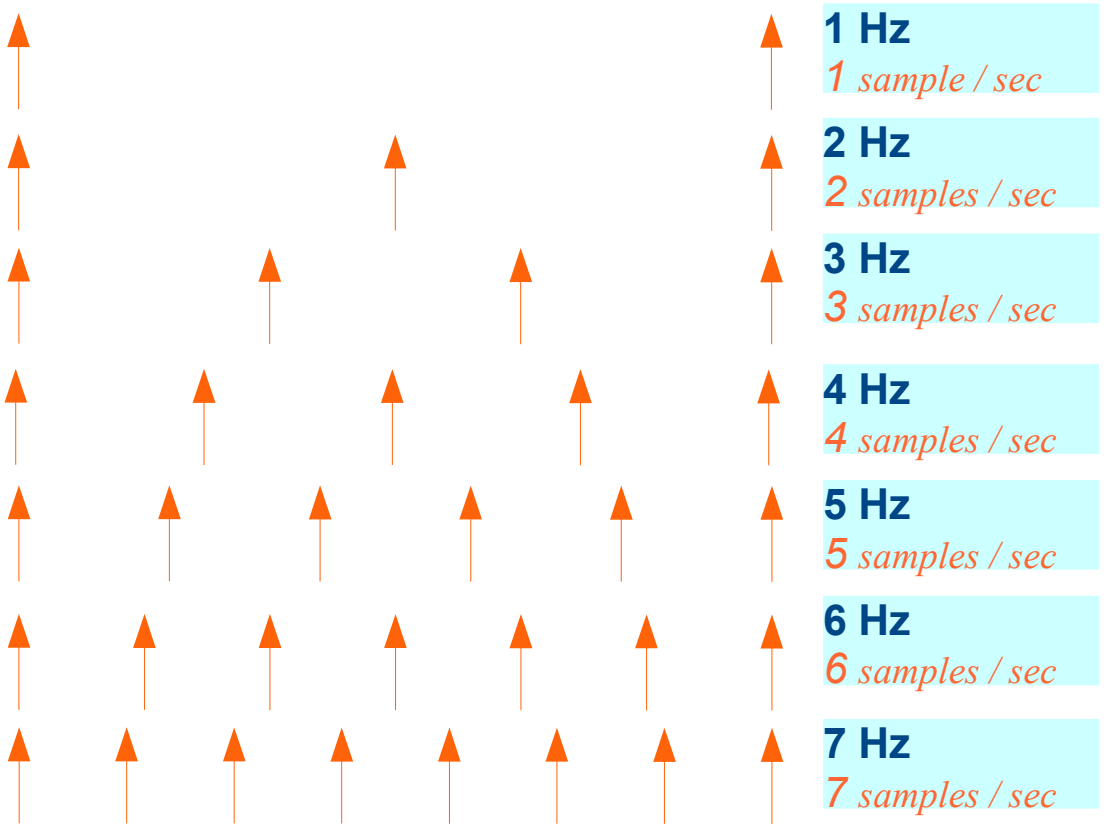

1 Hz
1 sample / sec

2 Hz
2 samples / sec

3 Hz
3 samples / sec

4 Hz
4 samples / sec

5 Hz
5 samples / sec

6 Hz
6 samples / sec

7 Hz
7 samples / sec

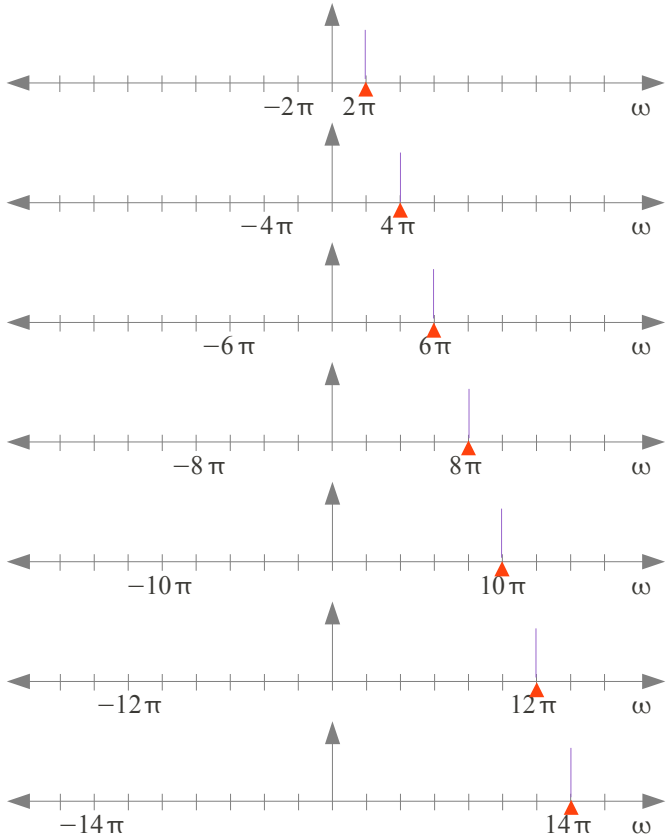

Nyquist Frequency

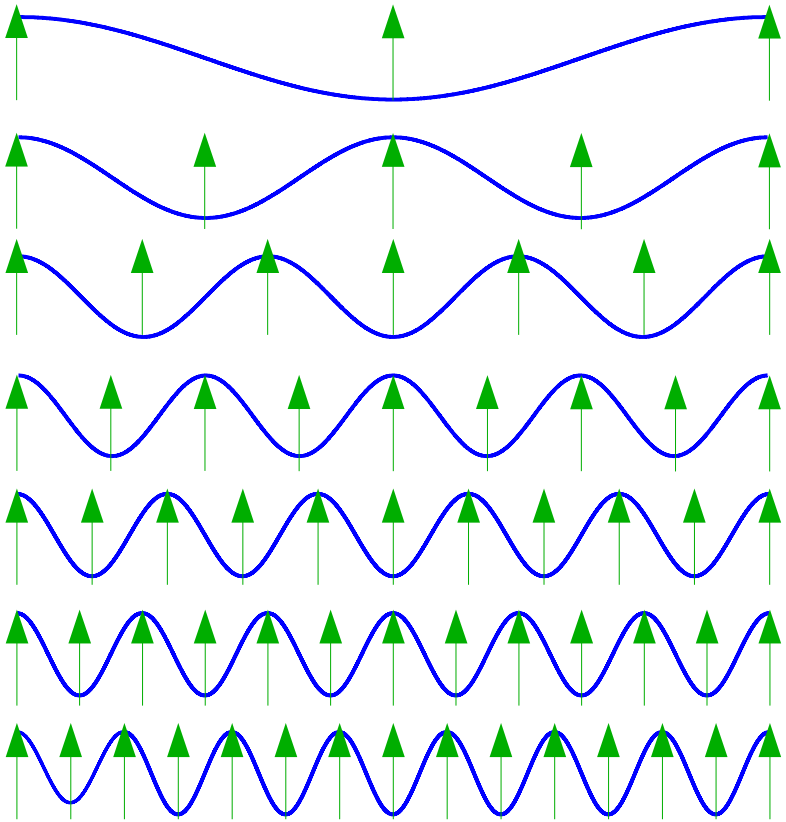

1 Hz *1 cycle / sec*	*2x1 sample / sec*
2 Hz *2 cycles / sec*	*2x2 samples / sec*
3 Hz *3 cycles / sec*	*2x3 samples / sec*
4 Hz *4 cycles / sec*	*2x4 samples / sec*
5 Hz *5 cycles / sec*	*2x5 samples / sec*
6 Hz *6 cycles / sec*	*2x6 samples / sec*
7 Hz *7 cycles / sec*	*2x7 samples / sec*

Aliasing

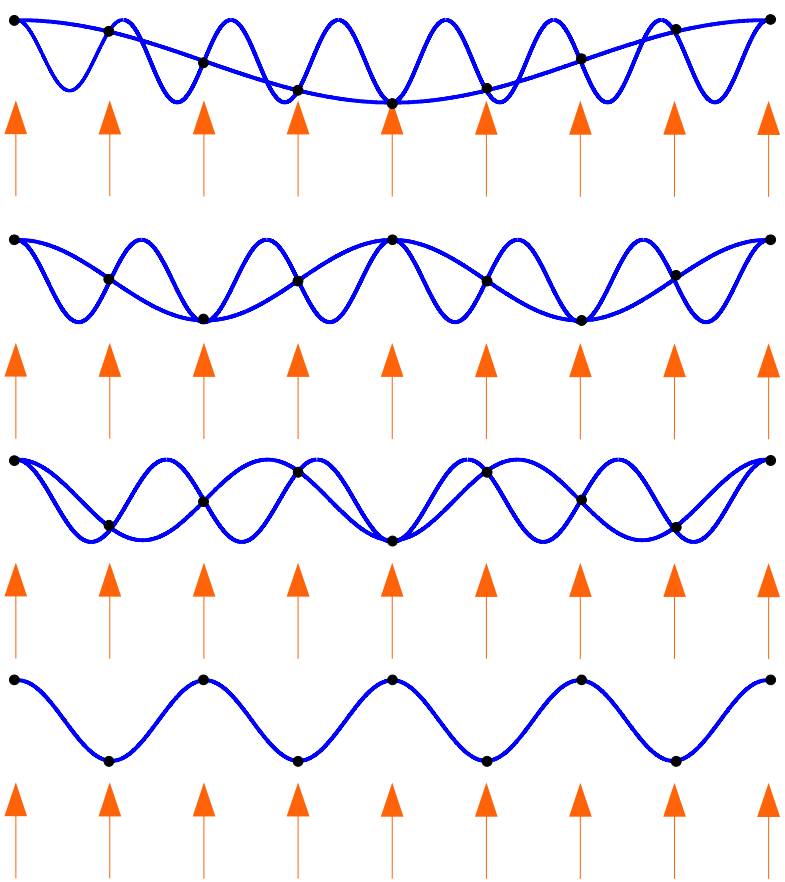

1 Hz
7 Hz

2x4 samples / sec

2 Hz
6 Hz

2x4 samples / sec

3 Hz
5 Hz

2x4 samples / sec

4 Hz

2x4 samples / sec

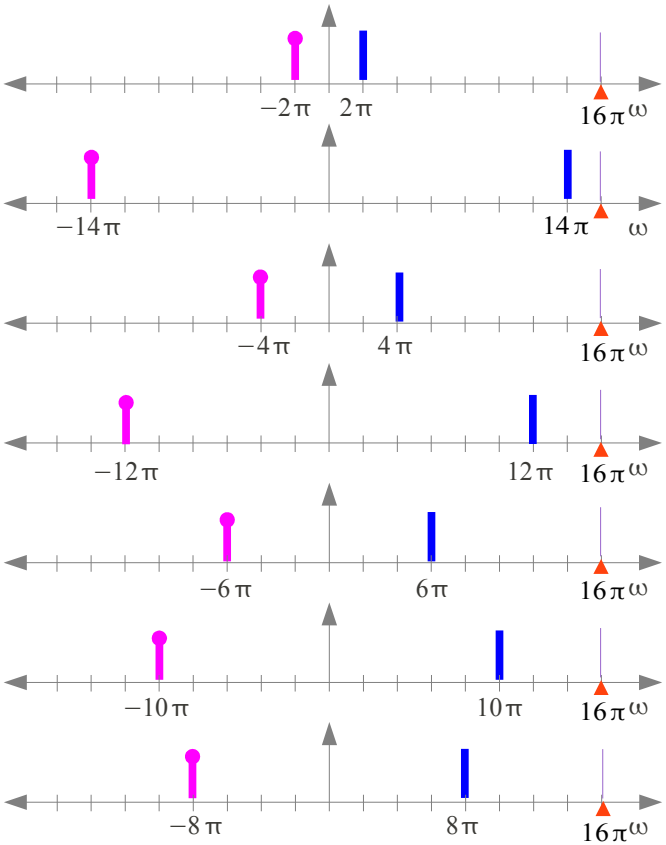

Sampling

$$\omega_s = 2\pi f_s \ (rad/sec)$$

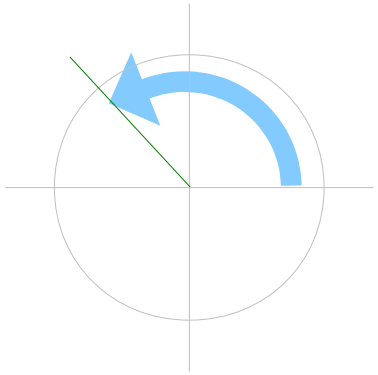

$$\omega_1 = 2\pi f_1 \qquad \omega_2 = 2\pi f_2$$

$$\omega_1 = \frac{\omega_s}{2} \ (rad/sec) \qquad \omega_2 = -\frac{\omega_s}{2} \ (rad/sec)$$

$$f_1 = \frac{f_s}{2} \ (rad/sec) \qquad f_2 = -\frac{f_s}{2} \ (rad/sec)$$

$2\pi \ (rad) \ / \ T_s \ (sec)$

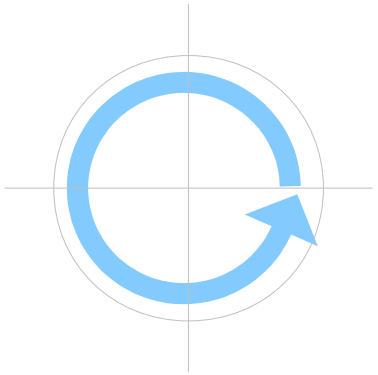

$\pi \ (rad) \ / \ T_s \ (sec)$

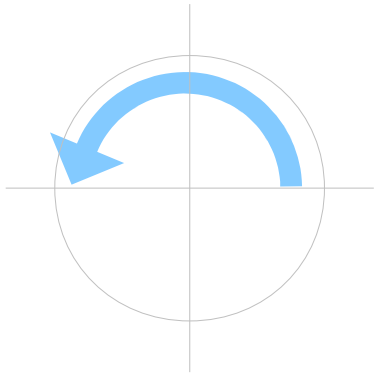

$-\pi \ (rad) \ / \ T_s \ (sec)$

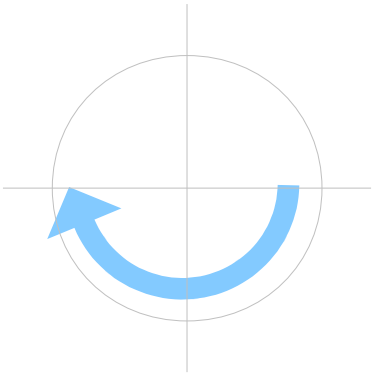

Sampling

$\omega_1 = 2\pi f_1 \ (rad/sec)$

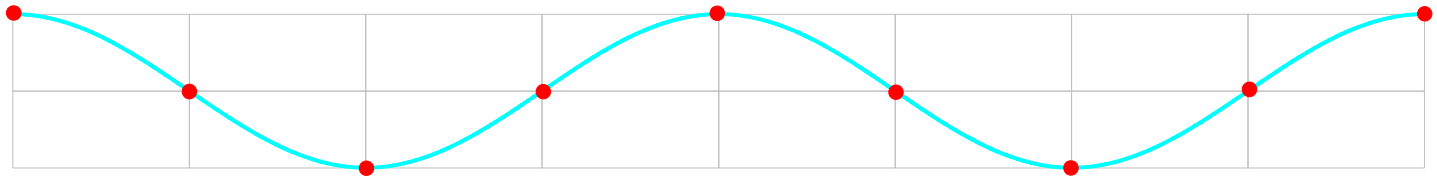

$\omega_s = 2\pi f_s \ (rad/sec)$

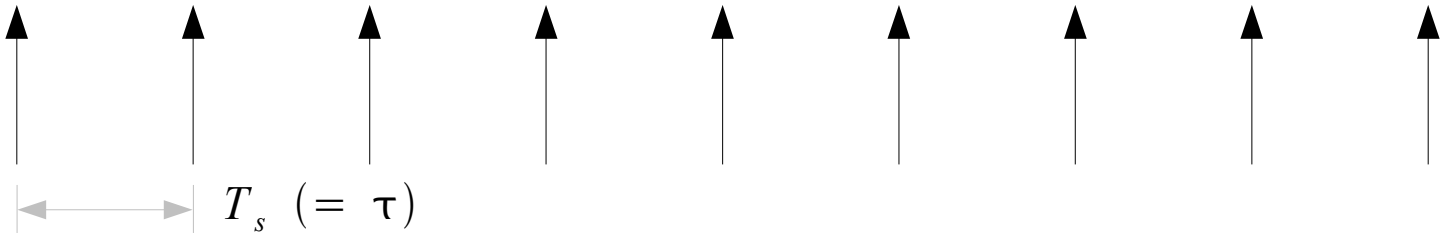

$2\pi \ (rad) \ / \ T_s \ (sec)$

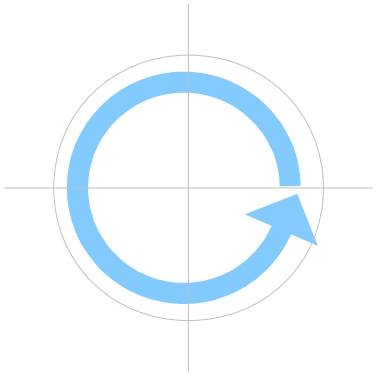

$\frac{\pi}{2} \ (rad) \ / \ T_s \ (sec)$

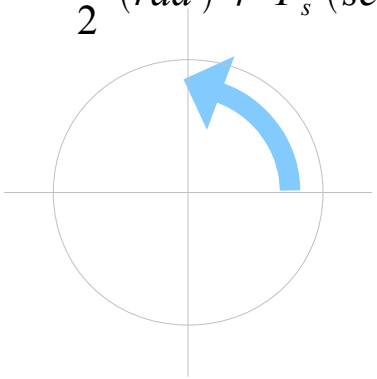

For the period of T_s

Angular displacement $\frac{\pi}{2} \ (rad)$

$$\hat{\omega} = \omega \cdot T_s \ (rad)$$

$$= 2\pi f_1 \cdot T_s \ (rad)$$

$$= 2\pi \frac{f_s}{4} \cdot T_s \ (rad)$$

$$= \frac{\pi}{2} \ (rad)$$

Angular Frequencies in Sampling

continuous-time signals

Signal Frequency

$$f_0 = \frac{1}{T_0}$$

Signal Angular Frequency

$$\omega_0 = 2\pi f_0 \ (rad/sec)$$

sampling sequence

Sampling Frequency

$$f_s = \frac{1}{T_s}$$

Sampling Angular Frequency

$$\omega_s = 2\pi f_s \ (rad/sec)$$

For 1 second $\omega_0 = 2\pi f_0 \ (rad/sec)$

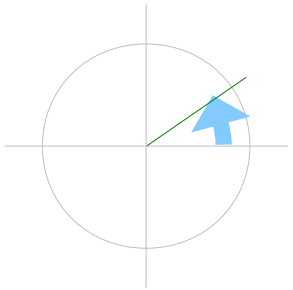

For 1 revolution $2\pi \ (rad) = T_0 \ (sec)$

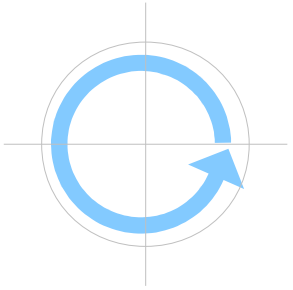

For 1 second $\omega_s = 2\pi f_s \ (rad/sec)$

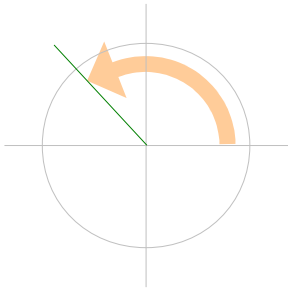

For 1 revolution $2\pi \ (rad) = T_s \ (sec)$

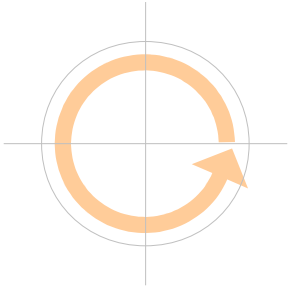

References

[1] http://en.wikipedia.org/
[2] J.H. McClellan, et al., Signal Processing First, Pearson Prentice Hall, 2003
[3] A "graphical interpretation" of the DFT and FFT, by Steve Mann
[4] R. Cristi, "Modern Digital Signal Processing"